


## Smart Sensor

Vision Sensor with built-in LCD monitor

ZFX-C

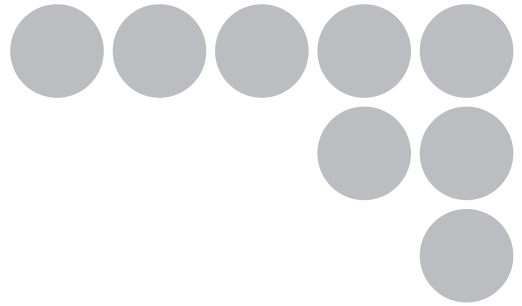

## User's Manual



# Introduction

---


Thank you for purchasing the ZFX-C.

This manual provides information regarding functions, performance and operating methods that are required for using the ZFX-C.

When using the ZFX-C, be sure to observe the following:


- The ZFX-C must be operated by personnel knowledgeable in electrical engineering.
- To ensure correct use, please read this manual thoroughly to deepen your understanding of the product.
- Please keep this manual in a safe place so that it can be referred to whenever necessary.

## Manuals Provided with this Product

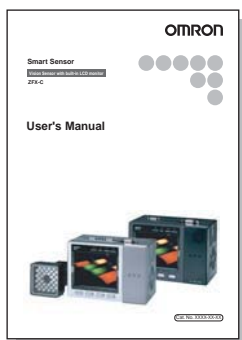

### User's Manual (this document)

This manual describes basic operations, such as installation and connections, and information on settings and specifications to ensure safe and correct use of this product.

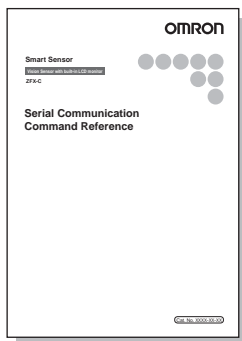

### Serial Communication Command Reference

This manual provides reference information for when this product performs communications with an external device, such as a PC or a programmable controller, via the serial interface.

# User's Manual

APPLICATION CONSIDERATIONS  
(Please Read)

BEFORE USE

1

BASIC OPERATIONS

2

SETTING THE MEASUREMENT  
CONDITIONS

3

FUNCTIONS USED DURING OPERA-  
TION

4

ADDITIONAL FUNCTIONS

5

PARALLEL INTERFACE

6

APPENDICES

7

Smart Sensor

Vision Sensor with built-in LCD monitor  
ZFX-C

## **READ AND UNDERSTAND THIS DOCUMENT**

Please read and understand this document before using the products. Please consult your OMRON representative if you have any questions or comments.

## **WARRANTY**

OMRON's exclusive warranty is that the products are free from defects in materials and workmanship for a period of one year (or other period if specified) from date of sale by OMRON.

OMRON MAKES NO WARRANTY OR REPRESENTATION, EXPRESS OR IMPLIED, REGARDING NON-INFRINGEMENT, MERCHANTABILITY, OR FITNESS FOR PARTICULAR PURPOSE OF THE PRODUCTS. ANY BUYER OR USER ACKNOWLEDGES THAT THE BUYER OR USER ALONE HAS DETERMINED THAT THE PRODUCTS WILL SUITABLY MEET THE REQUIREMENTS OF THEIR INTENDED USE. OMRON DISCLAIMS ALL OTHER WARRANTIES, EXPRESS OR IMPLIED.

## **LIMITATIONS OF LIABILITY**

OMRON SHALL NOT BE RESPONSIBLE FOR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, LOSS OF PROFITS OR COMMERCIAL LOSS IN ANY WAY CONNECTED WITH THE PRODUCTS, WHETHER SUCH CLAIM IS BASED ON CONTRACT, WARRANTY, NEGLIGENCE, OR STRICT LIABILITY.

In no event shall responsibility of OMRON for any act exceed the individual price of the product on which liability is asserted.

IN NO EVENT SHALL OMRON BE RESPONSIBLE FOR WARRANTY, REPAIR, OR OTHER CLAIMS REGARDING THE PRODUCTS UNLESS OMRON'S ANALYSIS CONFIRMS THAT THE PRODUCTS WERE PROPERLY HANDLED, STORED, INSTALLED, AND MAINTAINED AND NOT SUBJECT TO CONTAMINATION, ABUSE, MISUSE, OR INAPPROPRIATE MODIFICATION OR REPAIR.

## **SUITABILITY FOR USE**

THE PRODUCTS CONTAINED IN THIS DOCUMENT ARE NOT SAFETY RATED. THEY ARE NOT DESIGNED OR RATED FOR ENSURING SAFETY OF PERSONS, AND SHOULD NOT BE RELIED UPON AS A SAFETY COMPONENT OR PROTECTIVE DEVICE FOR SUCH PURPOSES.

Please refer to separate catalogs for OMRON's safety rated products.

OMRON shall not be responsible for conformity with any standards, codes, or regulations that apply to the combination of products in the customer's application or use of the product.

At the customer's request, OMRON will provide applicable third party certification documents identifying ratings and limitations of use that apply to the products. This information by itself is not sufficient for a complete determination of the suitability of the products in combination with the end product, machine, system, or other application or use.

The following are some examples of applications for which particular attention must be given. This is not intended to be an exhaustive list of all possible uses of the products, nor is it intended to imply that the uses listed may be suitable for the products:

- Outdoor use, uses involving potential chemical contamination or electrical interference, or conditions or uses not described in this document.

- Nuclear energy control systems, combustion systems, railroad systems, aviation systems, medical equipment, amusement machines, vehicles, safety equipment, and installations subject to separate industry or government regulations.
- Systems, machines, and equipment that could present a risk to life or property.

Please know and observe all prohibitions of use applicable to the products.

NEVER USE THE PRODUCTS FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCT IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

## **PERFORMANCE DATA**

Performance data given in this document is provided as a guide for the user in determining suitability and does not constitute a warranty. It may represent the result of OMRON's test conditions, and the users must correlate it to actual application requirements. Actual performance is subject to the OMRON Warranty and Limitations of Liability.

## **CHANGE IN SPECIFICATIONS**

Product specifications and accessories may be changed at any time based on improvements and other reasons.

It is our practice to change model numbers when published ratings or features are changed, or when significant construction changes are made. However, some specifications of the product may be changed without any notice. When in doubt, special model numbers may be assigned to fix or establish key specifications for your application on your request. Please consult with your OMRON representative at any time to confirm actual specifications of purchased products.

## **DIMENSIONS AND WEIGHTS**

Dimensions and weights are nominal and are not to be used for manufacturing purposes, even when tolerances are shown.

## **ERRORS AND OMISSIONS**

The information in this document has been carefully checked and is believed to be accurate; however, no responsibility is assumed for clerical, typographical, or proofreading errors, or omissions.

## **PROGRAMMABLE PRODUCTS**

OMRON shall not be responsible for the user's programming of a programmable product, or any consequence thereof.

## **COPYRIGHT AND COPY PERMISSION**

This document shall not be copied for sales or promotions without permission.

This document is protected by copyright and is intended solely for use in conjunction with the product. Please notify us before copying or reproducing this document in any manner, for any other purpose. If copying or transmitting this document to another, please copy or transmit it in its entirety.

## Meanings of Signal Words




The following signal words are used in this manual.

### **WARNING**

Indicates a potentially hazardous situation which, if not avoided, will result in minor or moderate injury, or may result in serious injury or death. Additionally there may be significant property damage.

## Meanings of Alert Symbols

The following alert symbols are used in this manual

	Indicates general prohibitions for which there is no specific symbol.
	Indicates the possibility of laser radiation.
	Indicates the possibility of explosion under specific conditions.

### **WARNING**

This product is not designed or rated for ensuring safety of persons.  
Do not use it for such purposes.



The camera with lighting emits visible light, which may adversely affect the eyes in rare instances.  
Do not look directly into the light emitted from the Camera. When the subject is a specular reflective object, protect your eyes from reflected light.



A lithium battery is built into the Controller and may occasionally combust, explode, or burn if not treated properly.  
Dispose of the Controller as industrial waste, and never disassemble, apply pressure that would deform, heat to 100 °C or higher, or incinerate the Controller.



## Precautions for Safe Use

The following points are important to ensure safety, so make sure that they are strictly observed.

### 1. Installation Environment

- Do not use the product in environments where it can be exposed to inflammable/explosive gas.
- To secure the safety of operation and maintenance, do not install the product close to high-voltage devices and power devices.
- Install the product in such a way that its ventilation holes are not blocked.
- Tighten mounting screws at the torque specified in this manual.

### 2. Power Supply and Wiring

- The voltage and AC power supply must be within the rated range (24 VDC  $\pm$ 10%).
- Reverse connection of the power supply is not allowed.
- Use the power supply within the rated load.
- High-voltage lines and power lines must be wired separately from this product. Wiring them together or placing them in the same duct may cause induction, resulting in malfunction or damage.
- Use the product within the power supply voltage specified in this manual.
- Use a DC power supply with safety measures against high-voltage spikes (safety extra low-voltage circuits on the secondary side).
- Tighten mounting screws at the torque specified in this manual.

### 3. Regulations and Standards

- EN61326-1
- Electromagnetic environment : Industrial electromagnetic environment (EN/IEC 61326-1 Table 2)
- The following condition is applied to the immunity test of this product: If the level of disturbance of the video is such that characters on the monitor are readable, the test is a pass.

#### ● Notice for Korea Radio Law

A 급 기기 (업무용 방송통신기자재)  
이 기기는 업무용 ( A 급 ) 전자파적합기기로서 판매자  
또는 사용자는 이 점을 주의하시기 바라며 , 가정외의  
지역에서 사용하는 것을 목적으로 합니다.

### 4. Other

- Do not use this product in safety circuits associated with nuclear power and human life.
- Do not disassemble, repair, modify, deform by pressure, or incinerate this product.
- Dispose of this product as industrial waste.
- Connect the exclusive devices (Camera, Controller, Strobe Controller, Cable). The product might break down or malfunction if you use a part not included in the exclusive products.
- Should you notice any abnormalities, immediately stop use, turn OFF the power supply, and contact your OMRON representative.
- Electromagnetic environment : Industrial electromagnetic environment (EN/IEC 61326-1 Table 2)

## Precautions for Correct Use

Observe the following precautions to prevent failure to operate, malfunctions, or undesirable effects on product performance.

### 1. Installation Site

Do not install this product in locations subjected to the following conditions:


- Ambient temperature outside the rating
- Rapid temperature fluctuations (causing condensation)
- Relative humidity outside the range of 35 to 85%
- Direct vibration or shock
- Reflection of intense light (such as other laser beams, electric arc-welding machines, or ultra-violet light)
- Direct sunlight or near heaters
- Strong magnetic or electric field

Also, do not install this product in locations subjected to the following conditions to ensure its protective performance as described in the specifications:

- Presence of corrosive or flammable gases
- Presence of dust, salt, or iron particles
- Water, oil, or chemical fumes or spray, or mist atmospheres

### 2. Power Supply and Wiring

- When using a commercially available switching regulator, make sure that the FG terminal is grounded.
- If surge currents are present in the power lines, connect surge absorbers that suit the operating environment.
- Before turning ON the power after the product is connected, make sure that the power supply voltage is correct, there are no incorrect connections (e.g. load short-circuit) and the load current is appropriate. Incorrect wiring may result in breakdown of the product.
- Before connecting/disconnecting cables, make sure that the product is turned OFF. The product may break down if it is connected/disconnected while the power is ON.
- For cables, use only the exclusive products specified in this manual.

 p.14, p.15

- Use only combinations of the Camera, Controller and Strobe Controller specified in this manual. Using other combinations may cause malfunction or damage.
- Do not turn the power OFF in the following instances. Doing so will damage data that is in the process of being saved.
  - While data is being saved on the Controller
  - While data is being saved on the SD card
- The LCD panel has been made using precision technology, and sometimes a few pixels are missing in the panel. This is due to the structure of the LCD panel, and is not a malfunction.
- Do not remove the base from the Camera.

### 3. Maintenance and Inspection

Do not use thinner, benzene, acetone or kerosene to clean the Camera and Controller. If large dust particles adhere to the Camera, use a blower brush (used to clean camera lenses) to blow them off. Do not use breath from your mouth to blow the dust off. To remove dust particles from the Camera, wipe gently with a soft cloth (for cleaning lenses) moistened with a small amount of alcohol. Do not use excessive force to wipe off dust particles. Scratches to the Camera might cause error.

### 4. Ventilation Film

- Do not peel of the ventilation film or prod it with a sharp-pointed object. This might impair its protective structure.
- Do not cover the ventilation film. Doing so might cause the Camera's front panel to cloud.



### 5.Optional Lighting Connector

When the optional lighting is not connected, be sure to attach the connector cap. Otherwise, its protective structure might be impaired.

### 6.Camera's Connector Cap

When using only one camera, attach the connector cap to cameras that are not in use.

### 7.Communication with a Host Device

Before communicating with a host device, make sure that the product has started up.

Also, clear the receive buffers on the device in use or perform other measures since undetermined signals might be output from the host interface when this product is started up.

## Editor's Note

### ■ Meaning of Symbols

Menu items that are displayed on the Controller's LCD screen, and windows, dialog boxes and other GUI elements displayed on the PC are indicated enclosed by brackets "[ ]".

### ■ Visual Aids

#### Important

Indicates points that are important to achieve the full product performance, such as operational precautions.

#### Note

Indicates application procedures.



Indicates pages where related information can be found.

### ■ Differences in functions between controllers

This manual is intended for following Controllers. Unless otherwise specified, explanations are given for the ZFX-C20/C25. The following table summarizes the main differences.

Item		ZFX-C20/C25	ZFX-C10H/C15H	ZFX-C10/C15
Number of connected cameras		2	1	1
Available measurement items	Shape inspection	Pattern Search Sensitive Search Flexible Search Graphic Search		Pattern search Sensitive search
	Size inspection	Area, Labeling Multi Colors		Area
	Edge inspection	Position, Width, Count, Angle		
	Brightness/color inspection	Brightness, HUE		
	Application-based inspection	Grouping, Defect		Defect
Available position correction items		All available		Edge position Area 1 model 2 model Angle
Number of measurement items that can be measured simultaneously		Max. 128 items/bank		Max. 32 items/bank
Logging monitor function		Available		Not available

# CONTENTS

## 1.BEFORE USE

<b>ZFX-C</b> .....	<b>14</b>
System Configuration .....	14
Part Names and Functions .....	16
<b>Mounting and Connecting Devices</b> .....	<b>19</b>
Installing Cameras .....	19
Installing the Controller .....	25
Connecting Devices .....	28
<b>Overview of Settings and Measurement</b> .....	<b>31</b>
Operation Modes .....	31
Outline of MENU mode .....	32
Measurement Items and Banks .....	33
Initializing Controller Settings .....	35
Saving Setup Data .....	36

## 2.BASIC OPERATIONS

<b>Inspection Setup and Measurement</b> .....	<b>38</b>
Setting Measurement Conditions - MENU Mode .....	38
Checking the Measurement Status - ADJ Mode .....	42
Starting Measurement - RUN Mode .....	42
<b>Troubleshooting</b> .....	<b>43</b>
Clear Images Cannot be Obtained .....	43
Measurement Target Cannot be Measured Accurately Due to Movement .....	43
To Output Measurement Values to a PC or PLC .....	44
To Output Position Information of Measurement Targets as Actual Coordinates .....	44

# 3.SETTING THE MEASUREMENT CONDITIONS

<b>Setting Measurement Items</b> .....	<b>46</b>
Shape Inspection .....	46
Pattern Search .....	46
Graphic Search .....	51
Flexible Search .....	56
Sensitive Search .....	59
Size Inspection .....	63
Area .....	63
Labeling .....	67
Multi Colors .....	71
Edge Inspection .....	73
Position .....	73
Width .....	78
Count .....	82
Angle .....	85
Bright/Color Inspection .....	89
Bright .....	89
HUE .....	91
Inspection by Individual Application .....	94
Grouping .....	94
Defect .....	97
Image Adjustment .....	101
<b>Cameras/Lighting</b> .....	<b>106</b>
Shutter Speed .....	106
Gain Setting .....	106
Partial Function Settings .....	107
Image Rate .....	107
Light Control (Recipe Functions) .....	108
Calibration .....	109
<b>Registering Images</b> .....	<b>114</b>
<b>Position Correction</b> .....	<b>115</b>
<b>Additional Functions</b> .....	<b>117</b>
Calculation .....	117
Setting Reflection of Individual Results .....	121
Logging Monitor .....	122

## 4.FUNCTIONS USED DURING OPERATION

<b>Monitoring the Measurement Status - RUN Mode</b> .....	<b>126</b>
Displaying Measurement Information .....	126
Switching the Image Display Method .....	128
<b>Checking/Adjusting the Measurement - ADJ Mode</b> .....	<b>129</b>
Checking Measurement Status .....	129
Switching the Image Display Method .....	131
Using a Saved Image to Perform Re-measurement .....	131
Adjusting Measurement Conditions .....	132

## 5.ADDITIONAL FUNCTIONS

<b>Bank Settings</b> .....	<b>136</b>
Bank Data Operations .....	137
Bank Group Operations .....	137
<b>System Settings</b> .....	<b>138</b>
Camera Specifications .....	138
Communication Setup .....	138
Output Settings .....	142
Display Settings .....	144
Operation Settings .....	147
Measurement Control Conditions .....	150
Operation Conditions during Startup .....	151
Setting/Changing the Display Language .....	152
Setting/Changing the Date .....	152
Clearing Saved Images .....	152
<b>Tools</b> .....	<b>153</b>
Saving/Loading Data .....	153
SD Card Operations .....	154
Checking Density Distribution (Profile) .....	154
Checking the Communication Status with External Devices .....	155
Displaying the Controller Information .....	156

## 6. PARALLEL INTERFACE

<b>Connection</b> .....	<b>160</b>
Parallel Connector Specifications .....	160
<b>Internal Specifications</b> .....	<b>164</b>
<b>Signal I/O</b> .....	<b>166</b>
Input Signal .....	166
Output Signal .....	168
<b>Timing Charts</b> .....	<b>171</b>
Measurement (Handshaking OFF) .....	171
Measurement (Handshaking ON) .....	174
Commands Other than for Measurement .....	175
Signal Operation in terms of Measurement .....	176

## 7. APPENDICES

<b>Error Messages and Corrective Actions</b> .....	<b>180</b>
<b>List of Available Functions for Each Camera</b> .....	<b>181</b>
<b>AUTO Setting</b> .....	<b>182</b>
AUTO Setting of Measurement Items .....	182
AUTO Setting in Individual Adjustment Screens .....	184
<b>Specifications and External Dimensions</b> .....	<b>186</b>
Camera .....	186
Controller .....	196
Accessories & Options .....	199
<b>LED Safety</b> .....	<b>212</b>
<b>Basic Knowledge for Operation</b> .....	<b>213</b>
<b>Menu List</b> .....	<b>217</b>
<b>INDEX</b> .....	<b>221</b>
<b>How Color Images are Processed</b> .....	<b>225</b>
Color Filter .....	226
Color Pickup .....	228
Hue, Saturation and Brightness Value .....	230
<b>Version Upgrade Information</b> .....	<b>231</b>
<b>Revision History</b> .....	<b>234</b>

# BEFORE USE

---

<b>ZFX-C</b>	<b>14</b>
System Configuration	14
Part Names and Functions	16
<b>Mounting and Connecting Devices</b>	<b>19</b>
Installing Cameras	19
Installing the Controller	25
Connecting Devices	28
<b>Overview of Settings and Measurement</b>	<b>31</b>
Operation Modes	31
Outline of MENU mode	32
Measurement Items and Banks	33
Initializing Controller Settings	35
Saving Setup Data	36


# ZFX-C

The ZFX-C is a series of vision sensors that senses objects by their “surfaces.” Objects captured by a camera can be checked on the built-in 3.5-inch LCD monitor.

## System Configuration

Basically, the ZFX-C is configured by the Controller and the camera.

Other external devices can be selected to be used in combination with the ZFX-C according to the user's specific requirements.

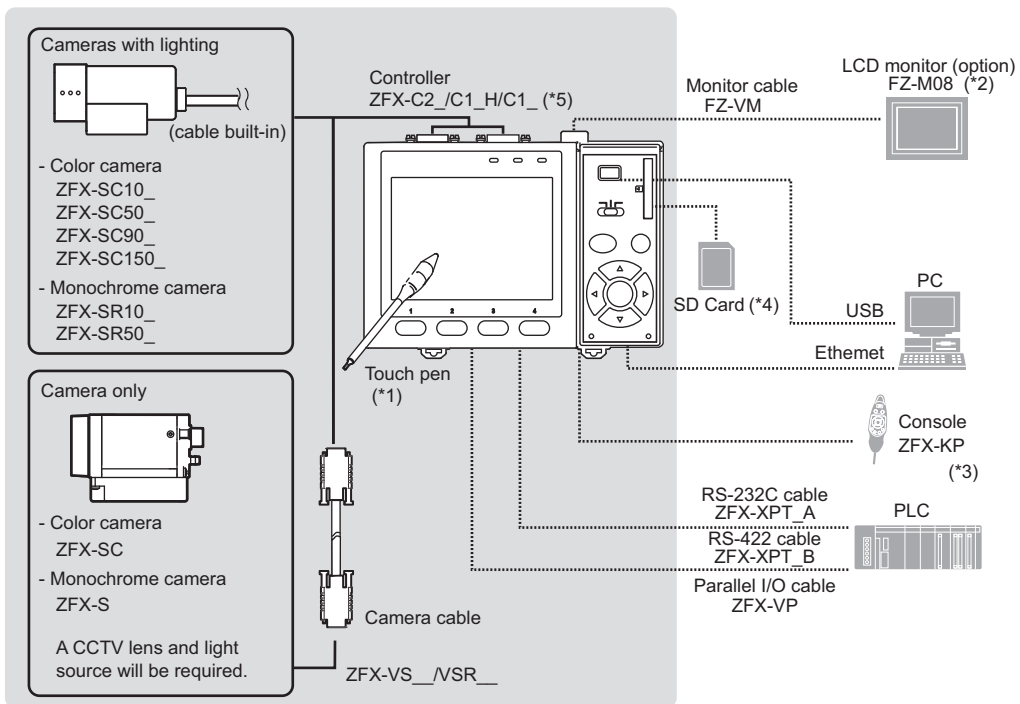

\*1: The Touch Pen (ZFX-TP) is supplied with the Controller.

\*2: The same image as in the Controller's LCD monitor can be displayed in the LCD monitor (option).

\*3: The console can be used instead of the Controller's keys and menu buttons.

\*4: Conforms to the SD Card “Physical layer specifications 1.01.”  
File format: FAT16


\*5: Only connector 1 for camera 1 is provided on the ZFX-C1\_H/C1\_.




## Options

### Extension cable for connecting cameras and the Controller

Cameras with Lighting

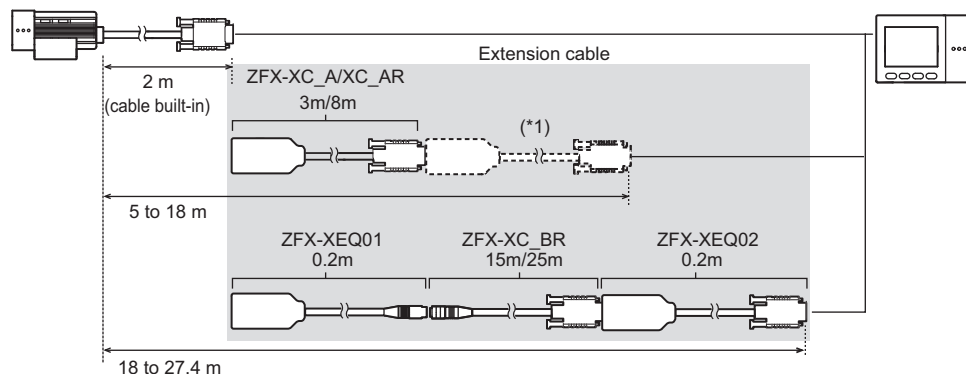

Camera only

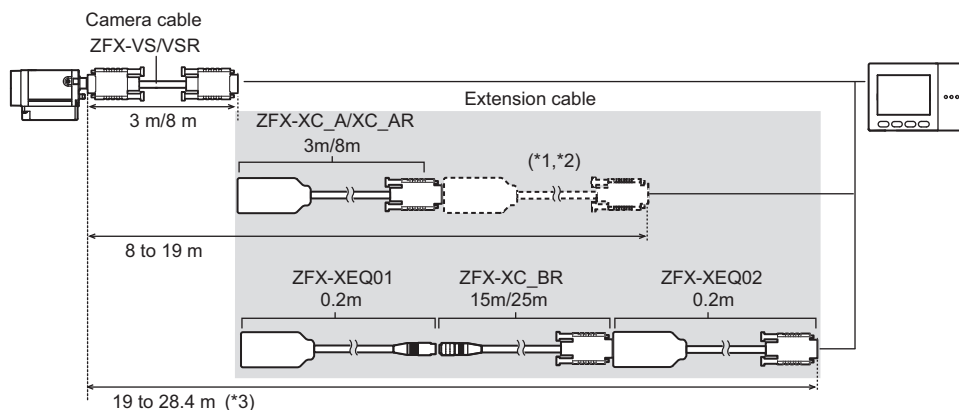

\*1: Up to two ZFX-XC\_A/XC-AR can be connected between the camera cable and the Controller.

\*2: Up to two ZEX-XC\_A/XC-AR can be connected to the camera cable as long as the total cable length between the Controller and the camera does not exceed 19 m.

\*3: The total cable length between the Controller and the camera cannot exceed 28.4 m including camera cables. The ZFX-XC\_A/XC-AR cannot be used in this combination.

### Optional lighting


The following optional lighting can be connected to ZFX-SC50\_/SC90\_.

- Bar lighting ZFV-LTL01
- Bar double-lighting ZFV-LTL02
- Bar low-angle lighting ZFV-LTL04
- Light Source for Through-beam Lighting ZFV-LTF01

# Part Names and Functions


## Cameras

### Cameras with lighting

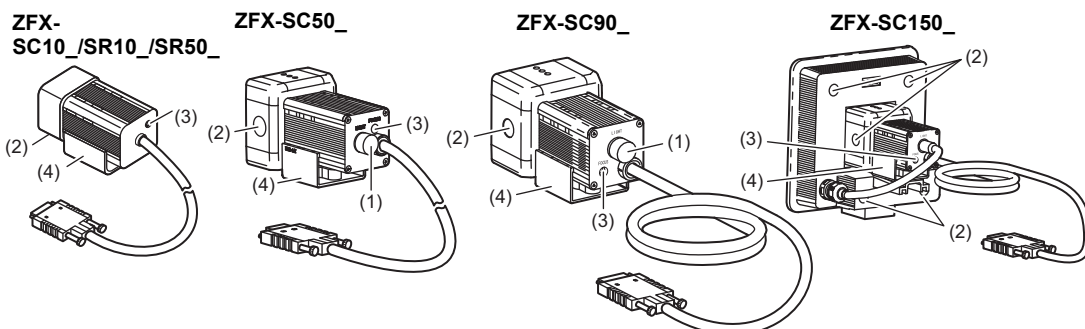


### Camera only (C-mount type)

#### ZFX-S/SC

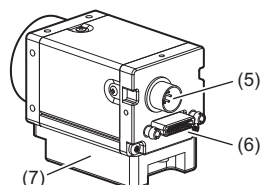

Name.	Description
(1) Optional lighting connector	<p>This connector is used to connect an optional lighting. (ZFX-SC50_/SC90_)</p> <p><b>Important</b></p> <p>When no optional lighting is used, make sure that the connector is covered with the cap. If not, water-resistant performance will be deteriorated.</p>
(2) Ventilation film	<p>This film prevents the front panel from condensation.</p> <p><b>Important</b></p> <ul style="list-style-type: none"> <li>Do not peel off or probe the ventilation film with a sharp-pointed object. If you do that the protective structure rating may no longer be satisfied.</li> <li>Do not cover the ventilation film rating. Doing so might cause the front panel to be condensed.</li> </ul>
(3) Focus adjustment control	This control is used for adjusting the focus of the image.
(4) Mounting fixture	This mounting fixture is used for fastening the camera when installing it. The mounting fixture can be installed on all of the four mounting surfaces.
(5) Lighting connector	This connector is used to connect external lighting (Strobe Controller: 3Z4S-LT MLEK-C100E1TSX). Note, however, that the Strobe Controller cannot be connected when the right angle camera cable is used.
(6) Camera cable connector	This connector is used for connecting to the Controller via a camera cable (ZFX-VS__/_VSR__).
(7) Camera mounting base	This camera mounting base is fastened with screws to hold the camera in place. The camera mounting base can be installed on all of the four mounting surfaces.

## Controller

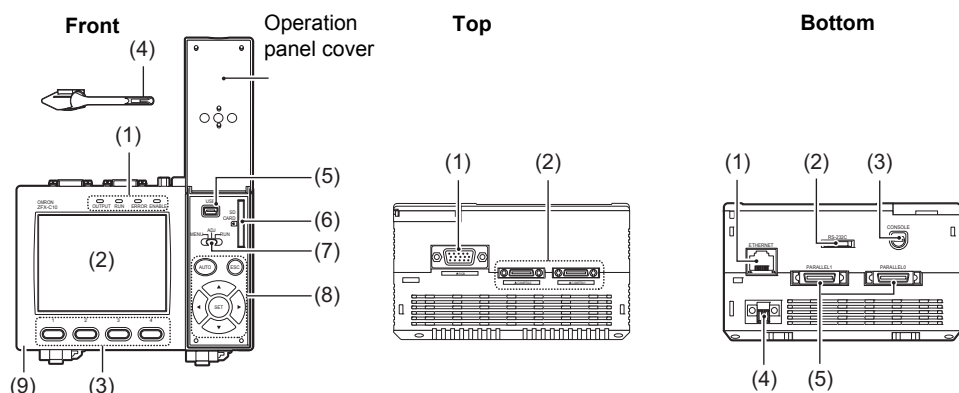

### Front





Name	Function
(1) Indicator	<p>"Measuring" indicator (RUN): Lights in green when in the RUN mode.</p> <p>Error indicator (ERROR): Lights in red when an error occurs.</p> <p>Judgment indicator (OUTPUT): Lights in orange when the judgment result is OK or NG according to the setting. (Note)</p> <p>Trigger indicator (ENABLE): Lights in blue when the ZFX-C is ready for the measurement trigger input.</p>
(2) LCD monitor/touch panel	The LCD monitor displays setup menus and images captured from the cameras. Various settings can be made on the touch panel by tapping menu buttons in the LCD monitor using the touch pen.
(3) Function keys	Specific functions are allocated to the Function keys.
(4) Touch pen	The touch pen is used to operate the touch panel. This pen can be attached to the Controller by tying its strap to the strap holder for the touch pen.
(5) USB port	This port is for connecting to a personal computer via a USB cable.
(6) SD card slot	<p>This slot is for inserting the SD Card.</p> <p>When the SD Card is inserted, the SD mark is displayed at the top right of the screen.</p> <p>Blue SD mark: The SD card is inserted but not being accessed.</p> <p>Red SD mark: The SD card is being accessed.</p>
(7) Mode switch	<p>This switch selects the operation mode.</p> <p>MENU: Select this mode when setting measurement conditions.</p> <p>ADJ: Select this mode when adjusting setting parameters as necessary referencing the image and values displayed on the LCD monitor during continuous test measurement (measurement without measurement data output to external devices).</p> <p>RUN: Select this mode when performing measurement.</p>
(8) Control keys	These keys are used to perform operations without the use of the touch pen.
(9) Strap holder for touch pen	This holder is for attaching the touch pen.

Note: The judgment result is output to the OR signal via the parallel interface.

## Top

Name	Function
(1) Monitor connector	This connector is for connecting to the LCD monitor (option) via a monitor cable.
(2) Camera connector	This connector is for connecting to a camera.

## Bottom

Name	Function
(1) Ethernet port	This port is for connecting to a personal computer via a 100Base-TX/10Base-T cable.
(2) RS-232C/422 connector	This connector is for connecting to a PLC via an RS-232C or an RS-422 cable.  p.14
(3) Console connector	This port is for connecting to the Console.  p.14
(4) Power connector	This connector is for connecting to the DC power supply.  p.28
(5) Parallel port	This port is for connecting to devices such as a PLC using the parallel cable.  p.14, p.160

### Important


- Attach the connector caps to connectors that are not in use to prevent dust or dirt from getting inside the connectors and to prevent the Controller from static electricity.

# Mounting and Connecting Devices

## Installing Cameras


### Camera with Lighting

#### Optical chart

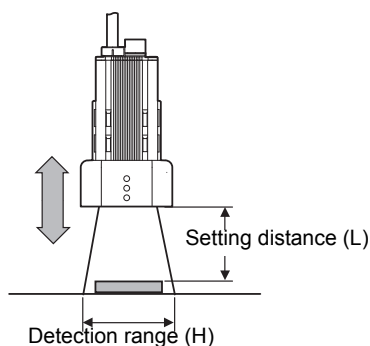


#### ► ZFX-SC10\_/SR10\_

Setting distance L (mm)

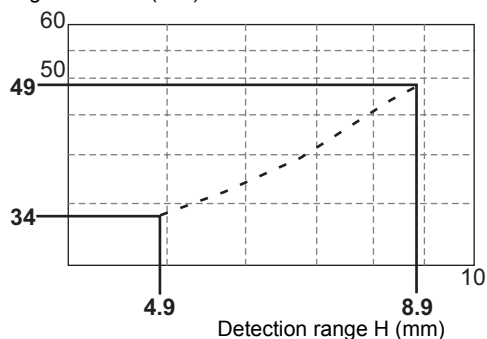


#### ► ZFX-SR50\_

Setting distance L (mm)

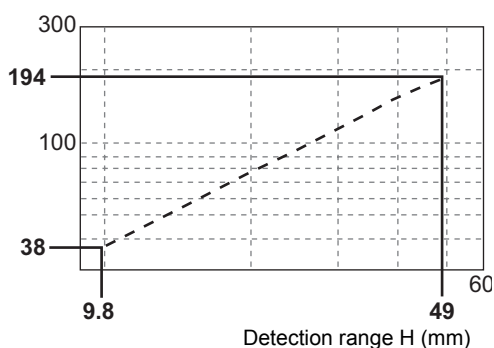


#### ► ZFX-SC50\_

Setting distance L (mm)

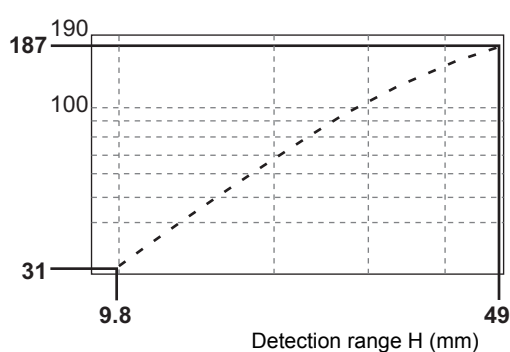


#### ► ZFX-SC90\_

Setting distance L (mm)

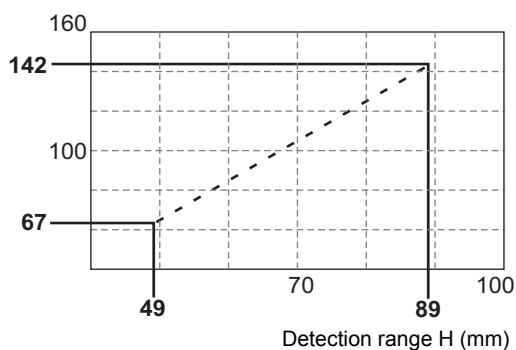

#### ► ZFX-SC150\_

Setting distance L (mm)

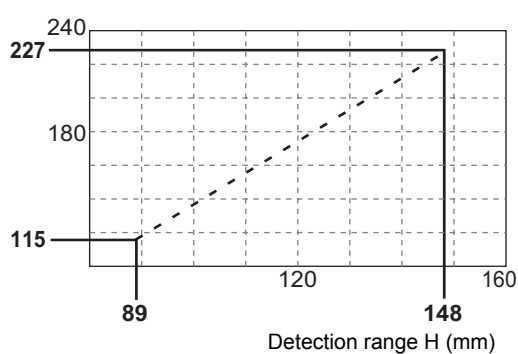

#### Note

- The lens has a fixed focal point. The actual detection range and focal point vary from lens to lens, so adjust the distance to the measurement target after replacing the lens or camera.
- The camera mounting distance listed in the following tables is an approximate value. Mount the Camera so that the distance to the measurement target can be adjusted easily.
- If the object size and detection range are incompatible, use a combination of a camera (without lighting), standard CCTV lens and light source.




Camera Only p.22

## Installing the mounting fixture

The mounting fixture can be installed on all of the four mounting surfaces.

### ZFX-SR10R/SR50R/SC10R/SC50R/SC90R (robot cable type)

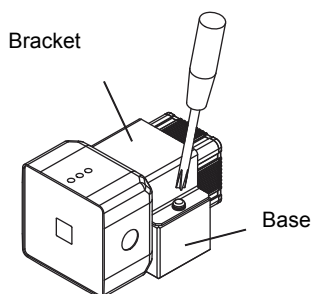

**1** Install the mounting fixture with the protrusion on its base (black) aligned with the groove on the camera body.

**2** Install the mounting fixture on the camera body with the bracket (silver) aligned with the base.

**3** Tighten the base and the bracket with the provided screws (M3 x 6).

Tightening torque: 0.54 N · m


**4** Fasten the base at the mounting position with screws.

Tightening torque

M4: 1.2 N · m

1/4"-20UNC: 2.6 N · m

### Except ZFX-SR10R/SR50R/SC10R/SC50R/SC90R (normal cable type)

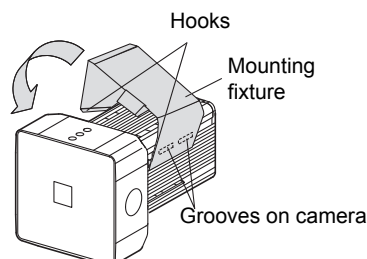

**1** Align the two hooks on one side of the mounting fixture with the two grooves on the camera body.

**2** Push the other hook down until it is snapped into place.

Make sure that the mounting fixture is firmly fixed on the camera.


### 3 Fasten the mounting fixture at the mounting location with screws.

Tightening torque

M4: 1.2 N•m


1/4"-20 UNC: 2.6 N•m

#### ► Removal procedure

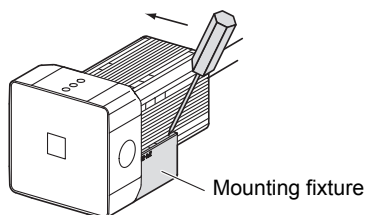

- 1 Insert a screwdriver into the gap (one of the two gaps) between the mounting fixture and the camera case, and remove the mounting fixture.


## Adjusting the camera focus

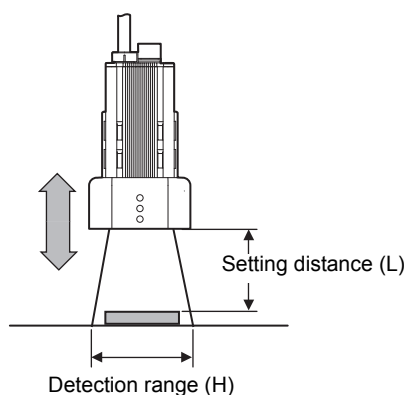

- 1 Adjust the distance between the camera and the measurement target and fasten the camera.

Refer to the optical chart and set the camera in a position so that the area to be checked is within the detection area (LCD monitor).

Optical chart p.19

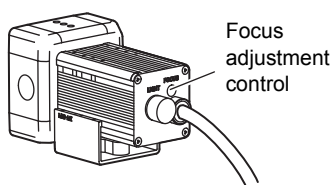

- 2 Turn the focus adjustment control to the left and right to adjust the focus.

#### Note


First turn the focus adjustment control slightly to the left and right, to make sure that the Focus adjustment control is not at the upper or lower limit positions. Do not exert unnecessary force to turn the control at the upper or lower limit positions as this might damage the control.

(For ZFX-SC90\_/SC150\_, the control stops turning at the nearest position. It turns free at the farthest position.)

## Camera Only

### Optical chart


The values in the following chart are approximations, and the Camera must be adjusted after it is mounted.

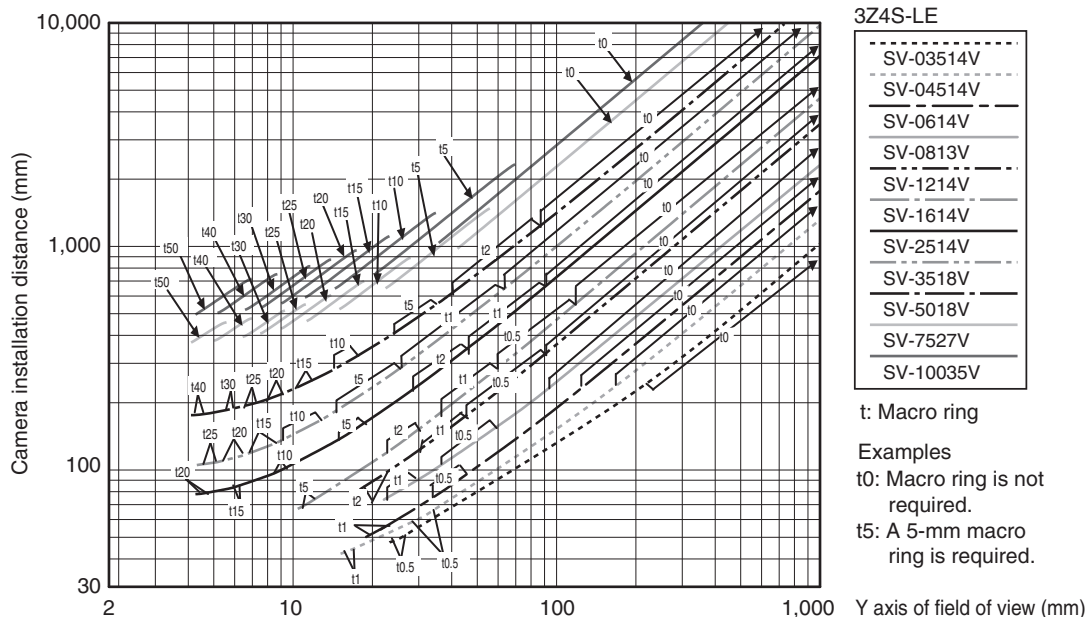

The X axis of the optical chart shows detection range L (mm), and the Y axis shows the camera distance A (mm). The curves on the optical chart show the relationship between the detection range and camera distance for each CCTV lens. The values are significantly different for each lens, so double-check the model of the lens before using the graph. The "t" values indicate the lengths of the Extension Tubes. The value "t0" shows the case where an Extension Tube is not required and the value "t5.0" shows the case where a 5-mm Extension Tube is used.


#### ► Example

When a 3Z4S-LE SV-2514V CCTV Lens is being used and a detection range of 40 mm is required at the measurement target, a camera distance of 300 mm and 2 mm Extension Tube are required.

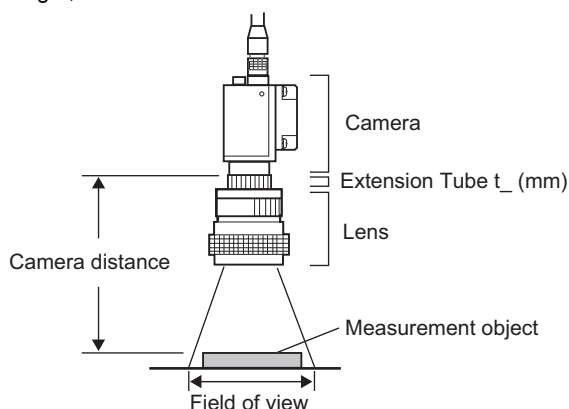




## Lenses and lens diameters

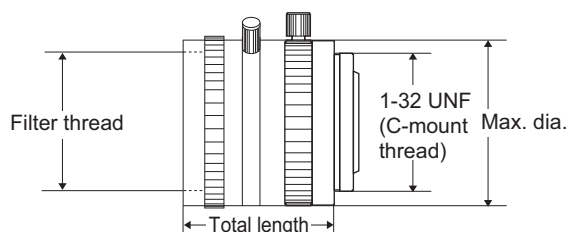


Lens model	Focal length	Brightness	Maximum outside diameter	Total length	Filter size
3Z4S-LE SV-03514V	3.5mm	F1.4	29.5mm	30.4mm	---
3Z4S-LE SV-04514V	4.5mm	F1.4	29.5mm	29.5mm	---
3Z4S-LE SV-0614V	6.20 mm	F1.4	29 mm	30.0 mm	M27 P0.5
3Z4S-LE SV-0813V	8.05 mm	F1.3	28 mm	34.0 mm	M25.5 P0.5
3Z4S-LE SV-1214V	12.43 mm	F1.4	29 mm	29.5 mm	M27 P0.5
3Z4S-LE SV-1614V	16.34 mm	F1.4	29 mm	24.0 mm	M27 P0.5
3Z4S-LE SV-2514V	25.17 mm	F1.4	29 mm	24.5 mm	M27 P0.5
3Z4S-LE SV-3518V	34.75 mm	F1.8	29 mm	33.5 mm (WD: $\infty$ ) to 37.5 mm (WD: 300 mm)	M27 P0.5
3Z4S-LE SV-5018V	47.97 mm	F1.8	32 mm	37.0 mm (WD: $\infty$ ) to 39.4 mm (WD: 1000 mm)	M30.5 P0.5
3Z4S-LE SV-7527V	76.71 mm	F2.7	32 mm	42.0 mm (WD: $\infty$ ) to 44.4 mm (WD: 1000 mm)	M30.5 P0.5
3Z4S-LE SV-10035V	95.4 mm	F3.5	32 mm	43.9 mm (WD: $\infty$ ) to 46.3 mm (WD: 1000 mm)	M30.5 P0.5

## Extension Tubes

One or more Extension Tubes can be inserted between the lens and the Camera to focus the Camera image. Use a combination of one or more of the seven tubes to achieve the required length.

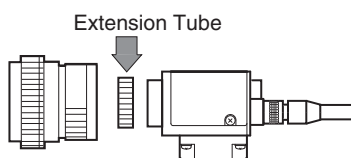


Model	Maximum outer diameter	Length
3Z4S-LE SV-EXR	31 dia.	Set of 7 tubes Length: 40 mm    20 mm    10 mm    5 mm    2 mm    1 mm    0.5 mm 

### Important

- Do not use the 0.5-mm, 1.0-mm and 2.0-mm Extension Tubes attached to each other. Since these Extension Tubes are placed over the threaded section of the Lens or other Extension Tube, the connection may loosen when more than one 0.5-mm, 1.0-mm or 2.0-mm Extension Tube are used together.
- Reinforcement may be required for combinations of Extension Tubes exceeding 30 mm if the Camera is subject to vibration.

## Installing the Camera Mounting Base

The camera mounting base mounted on the bottom of the camera can be installed on all of the four mounting surfaces. To change the mounting surface, remove the three mounting screws (M2 x 6) from the camera.

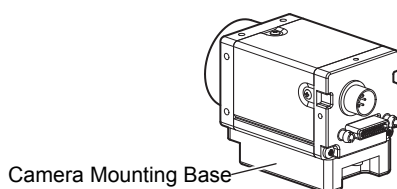


- Tightening torque when fastening the camera mounting base at the mounting location  
 M4: 1.2 N•m  
 1/4"-20 UNC: 2.6 N•m

# Installing the Controller
 
## Installation Precautions


To improve heat radiation, install the Controller only in the orientation show below.

**Right**




Do not install the Controller in the following orientations.

**Wrong**

 


**Wrong**

 


### Important

- Install the Controller so that the distance between the Controller and other devices is at least the dimensions shown in the figure below to improve the ventilation.

 When installing Controller only:




When installing the Controller With the Exhaust Unit attached:

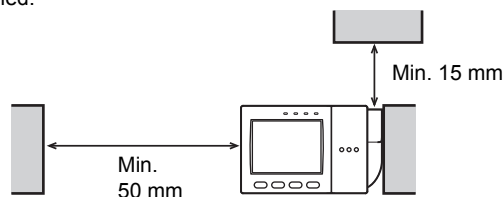


- Keep the ambient temperature less than 50 °C. If the ambient temperature is higher than 50 °C, install a fan forced cooling system or an air conditioner to keep the temperature lower than 50 °C.
- Avoid mounting on a panel, in which high-voltage emitting devices are installed to prevent ZFX-C operation from being affected by noise.
- Allow at least 10 m between the Controller and power lines to keep noise at a low level in the operating environment.


## Installing on the DIN Track

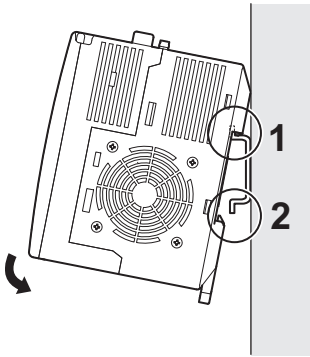


- 1** Hook the Controller's upper hook onto the DIN track.
- 2** Push the Controller down onto the DIN track until its lower hook is snapped into place.

### Important

- Attach the End Plate (sold separately) to both sides of the Controller on the DIN track.
- Attach the Exhaust Unit (supplied) to the Controller when installing other devices adjacently on the same DIN track as the Controller.  p.30

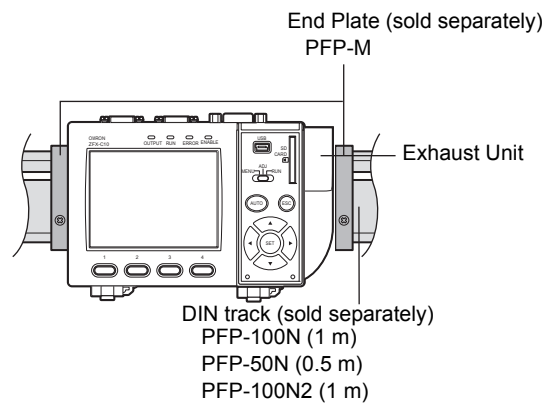


## Removing procedure

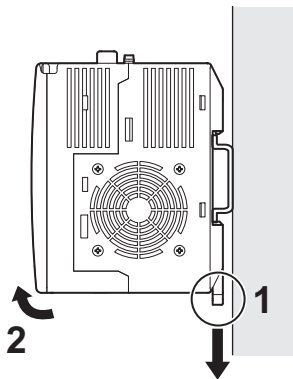


- 1** Pull the Controller's lower hook downwards.
- 2** Lift up the Controller from its bottom to remove it from the DIN track.

## Mounting on a Panel

1 BEFORE USE

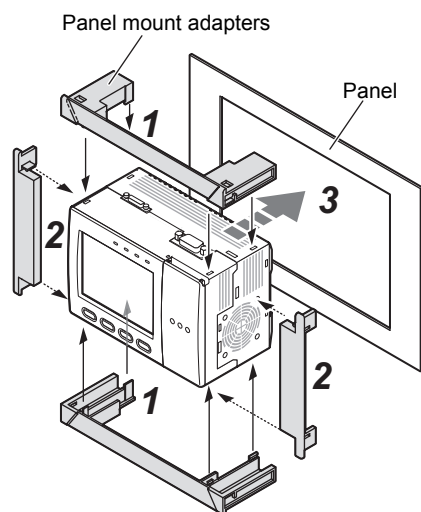

- 1** Install the long Panel Mount Adapters on the four holes on the Controller.
- 2** Install the short Panel Mount Adapters on the two holes on the long Panel Mount Adapter.
- 3** Install the Controller with Mount Adapters attached onto the panel from the front.

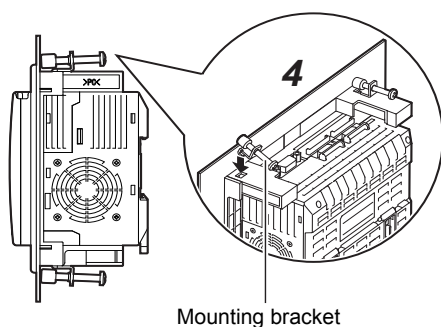

- 4** Hook the hooks of the mounting bracket onto the two holes (two each at top and bottom) of the longer Mount Adapters and tighten the screws.  
Tightening torque: 1.2 N·m.
- 5** Make sure that the Controller is firmly fixed on the panel.

# Connecting Devices


## Connecting the Controller to the Power Supply

Use a power supply that meets the following specifications.

Item	Specification
Power supply voltage	Approx. 24 VDC (21.6 to 26.4 VDC)
Output current	1.5 A min.
Recommended power supply	S8VS-06024 (24 VDC, 2.5 A)
Recommended electric wire size	0.14 to 1.5 mm <sup>2</sup> (max. 1 m)

### Important



Use a DC power supply with countermeasures against high voltages (safe extra low-voltage circuits on the secondary side). If the system must meet UL standards, use a UL class II power supply.

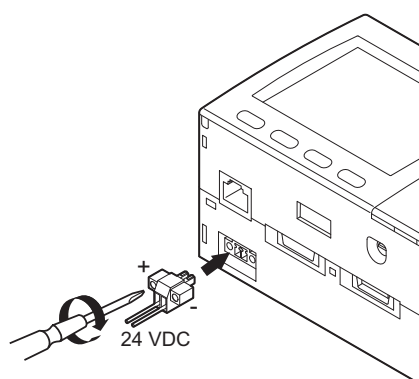

- 1** Loosen the two screws on the top of the Power connector (male) using a flat-blade screwdriver.
- 2** Insert the DC power terminal (wire) into the Power connector (male) and tighten the two screws on the top of the Power connector to fasten the power terminal with the screwdriver.  
Tightening torque: 0.22 to 0.25 N•m.
- 3** Plug the Power connector (male) into the Controller's Power connector (female).
- 4** Tighten the two screws on the left and right of the Power connector (male) with the screwdriver to fasten it.  
Tightening torque: 0.22 to 0.25 N•m.


## Attaching Ferrite Cores

 Attach ferrite cores (supplied) to both ends of the camera's cable and the Controller's power cable, respectively.

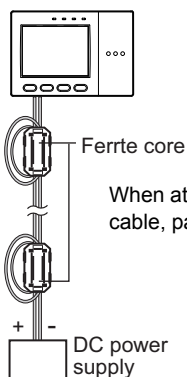

When attaching ferrite cores to the Controller's power cable, pass the cable once through each ferrite core.

## Connecting the Camera to the Controller

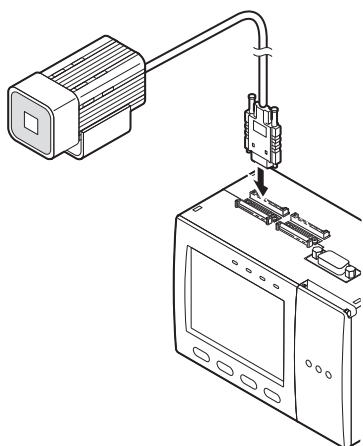

**1** Insert the camera's connector into the Controller's Camera connector.

**2** Tighten the two fastening screws of the Controller's Camera connector.

Tightening torque: 0.15 N•m.

In a camera only connection, the tightening torque on the camera side is 0.15 N•m.

### Important

- Do not touch the terminals inside the connector.
- Fasten the connector while making sure that it is not subjected to vibration or shock.
- Do not mount the Controller in such a way that a load is steadily applied on the connector, for example, with tension applied to the cables.



To extend the installation distance between cameras and the Controller, see p.15

## Disconnection procedure


Loosen the fastening screws (two locations) to unlock the camera's cable, and then pull the camera's cable connector straight out.

### Important

- Be sure to hold the connector of the camera to disconnect it. Failure to do so may damage the camera's cable.
- Do not touch the terminals inside the connector.


## Connecting the Optional Lighting to the Camera

The optional lighting can be mounted to the rear connector of the camera (ZFX-SC50\_/SC90\_) with a single motion. Since the power is supplied from the camera side, no power supply is required for the optional lighting.

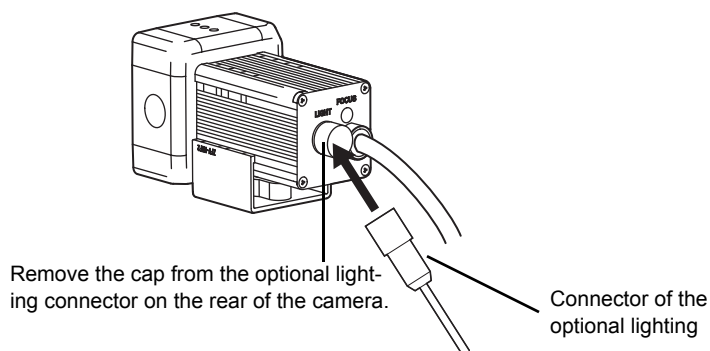

## Attaching the Exhaust Unit to the Controller

Attach the Exhaust Unit (supplied) to the Controller when installing other devices next to the Controller on the same DIN track. The Exhaust Unit also serves as the Touch Pen Holder

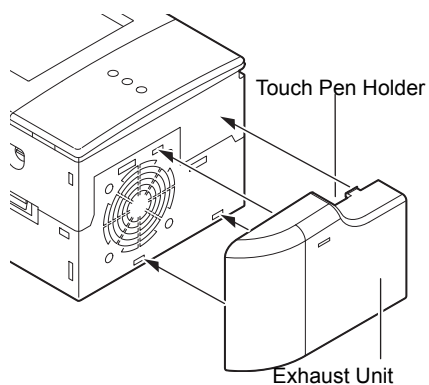


- 1 Attach the Exhaust Unit to the four mounting holes on the Controller.**



# Overview of Settings and Measurement

## Operation Modes

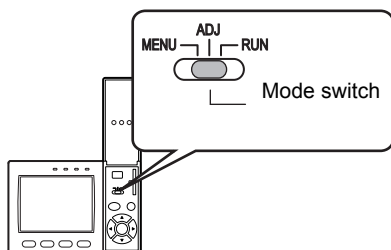

The ZFX-C has the following three modes. Switch to the desired mode before you start operation. To switch the operation mode, use the mode switch.


1 BEFORE USE

Mode	Description	
MENU mode	This mode is for setting the measurement conditions. The easy-to-follow icon-based display allows operations to be performed intuitively.	<p>Top Screen</p>
ADJ mode	This mode is for checking the measurement status and adjusting conditions. Measurement results are only displayed on the monitor and are not output.	<p>Top Screen</p>
RUN mode	This mode is used for performing actual measurement. Measurement results are displayed on the monitor and output.	<p>Top Screen</p>

# Outline of MENU mode

The MENU mode is broadly divided into three levels. The icons used for basic setup are displayed in the center.


Use icons other than those in the center whenever required.

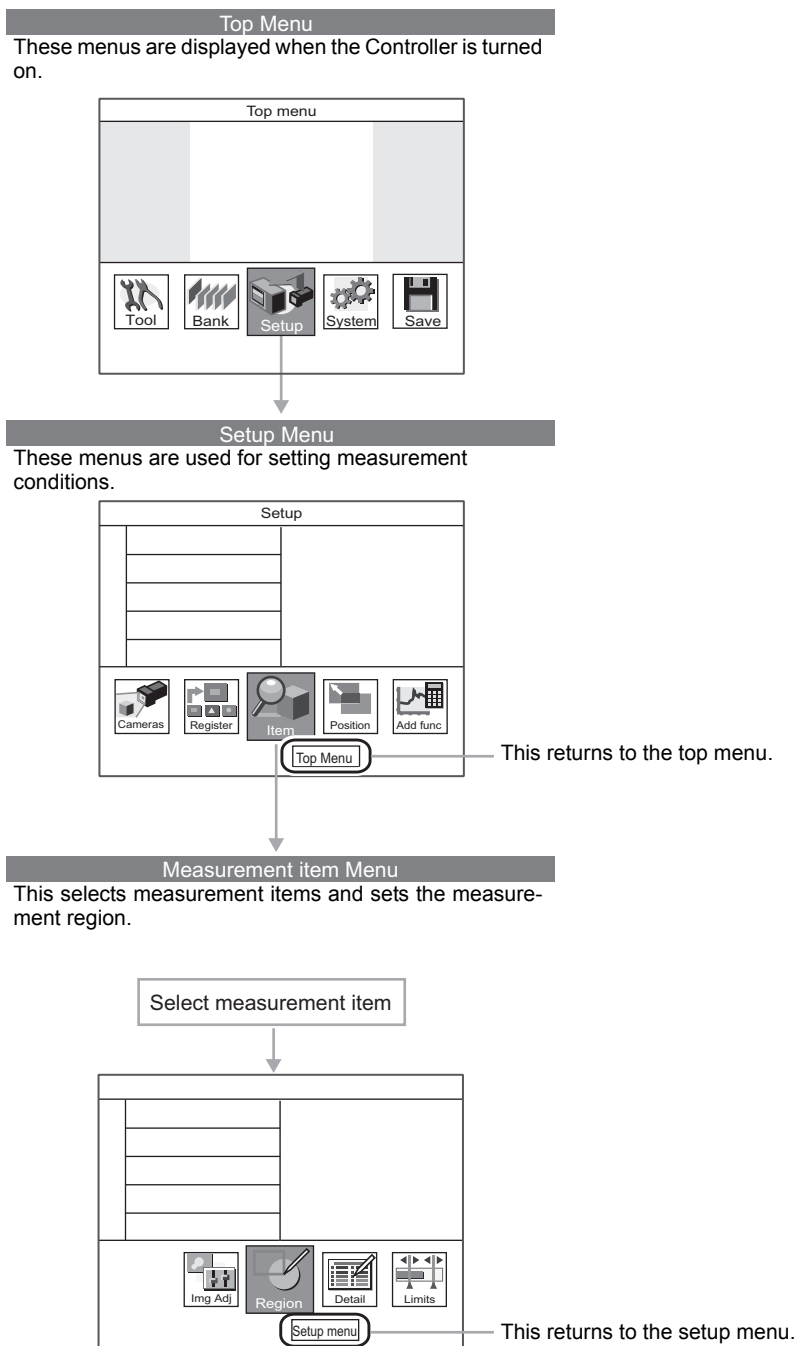

# Measurement Items and Banks

## Measuring Multiple Locations

Up to 128 locations in a single measurement image can be measured. A measurement type is called an "item," and desired measurement types are assigned to items 0 to 127.

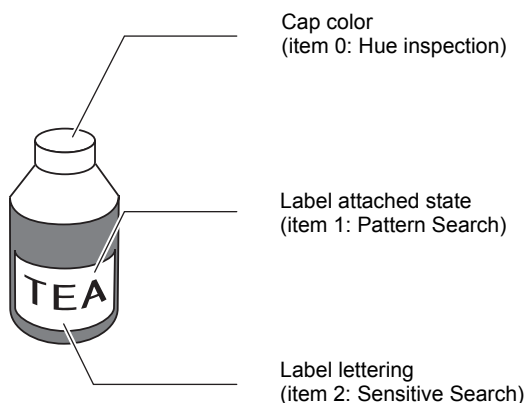


### Note

In the case of the ZFX-C10/C15, up to 32 locations (items 0 to 31) can be measured.


## Data for Change of Device Setup

If you register bank data for each individual product, you can reduce the time required for changing the device setup as all you need to do is to select different bank data to change the measurement conditions.

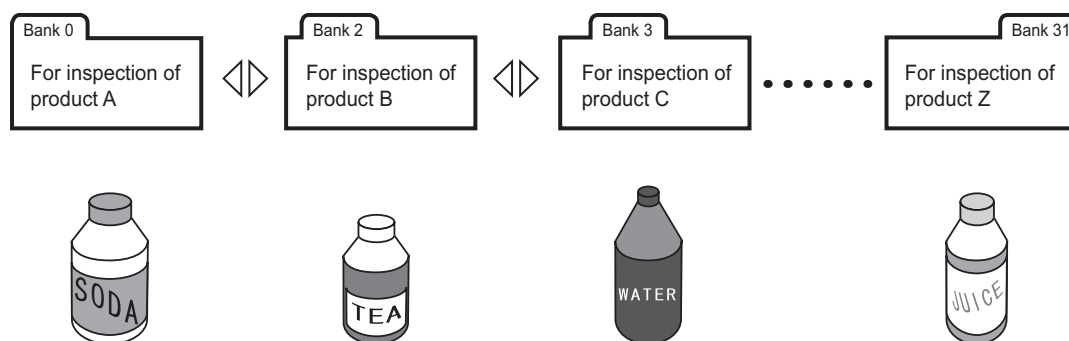

## Relationship between Items and Bank Data

Up to 128 items can be registered to a single bank data. Up to 32 bank data can be set to and saved on the ZFX.

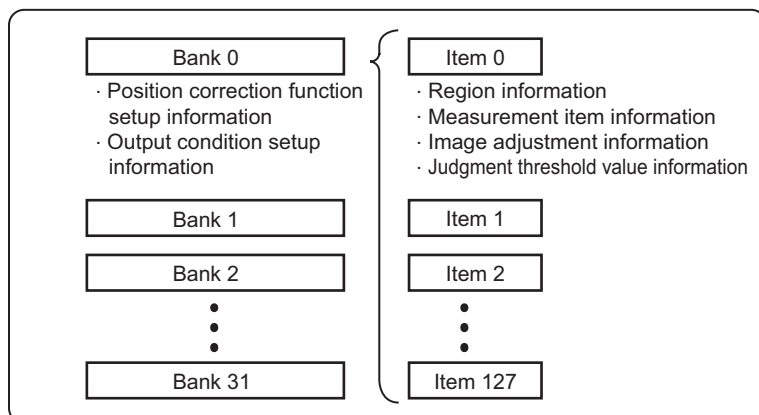

### Note

- In the case of the ZFX-C10/C15, up to 32 items (items 0 to 31) can be registered to a single bank data.
- If you use the bank group function, you can set up to 1024 banks.



Bank Settings p.136


- Bank and items can be given any name up to 16 characters.


Bank and item names make it easier to recognize which measurement is being performed when multiple items and banks have been set.

# Initializing Controller Settings


## Important

The settings of all banks and system settings (excluding the display language setting) are initialized regardless of the currently selected bank No. To save the settings, back them up to a SD card before performing initialization.


 Saving/Loading Data p.153

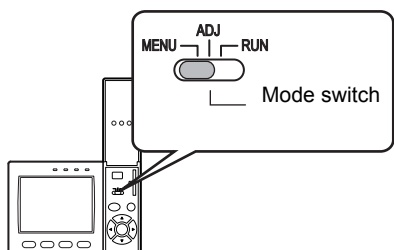

- 1** Switch to the [MENU] mode.  
The top screen is displayed.

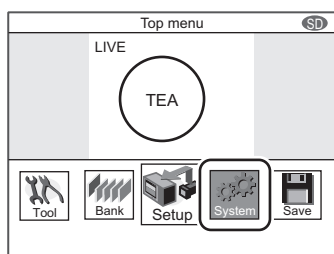

- 2** Select the [System] icon.

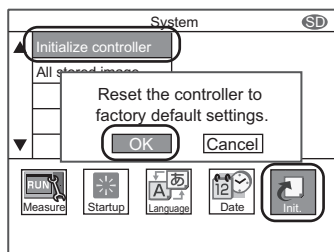


- 3** Select the [Init.] icon.
- 4** Select [Initialize controller].
- 5** Select [OK].

# Saving Setup Data


After you have set the measurement conditions, be sure to save the setup data.

## Important


All settings will be deleted if you turn the power OFF without saving the data.

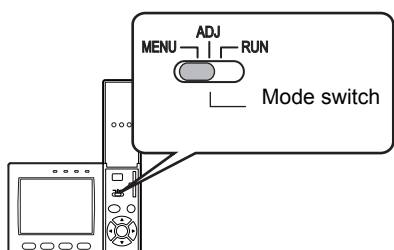

- 1** Switch to the [MENU] mode.  
The top screen is displayed.

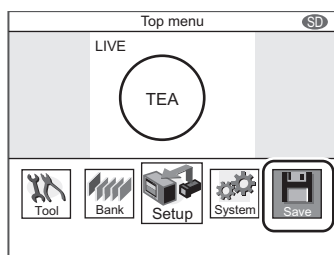

- 2** Select the [Save] icon.

 

- 3** Select [OK].

## Note

### Data Saved on the Controller

Bank settings and system settings are saved internally on the Controller. Image data is not saved on the Controller. Save image data on the SD card.

### When Using the Bank Group Function



Bank data that is set to bank group 0 is saved internally on the Controller. When the bank data of bank groups 1 to 31 is saved, the bank data on the SD card is overwritten with the bank data of bank groups 1 to 31.

# BASIC OPERATIONS

<b>Inspection Setup and Measurement</b>	<b>38</b>
Setting Measurement Conditions - MENU Mode	38
Checking the Measurement Status - ADJ Mode	42
Starting Measurement - RUN Mode	42
<b>Troubleshooting</b>	<b>43</b>
Clear Images Cannot be Obtained	43
Measurement Target Cannot be Measured Accurately Due to Movement	43
To Output Measurement Values to a PC or PLC	44
To Output Position Information of Measurement Targets as Actual Coordinates	44

# Inspection Setup and Measurement

The following describes the flow of basic setup using, as an example, inspection of whether different types of objects are mixed in.

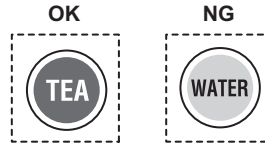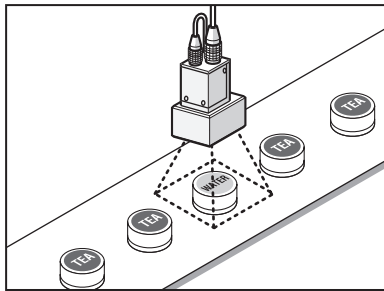


## Setting Measurement Conditions - MENU Mode

On the ZFX, a 3-step operation completes basic inspection setup.

### step1

Selecting measurement items

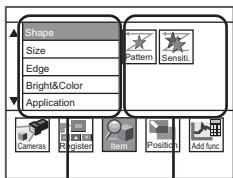


Measurement type group

Measurement items

### step2


Setting measurement regions

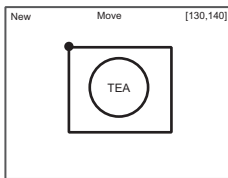

Enclose the desired measurement area.

### step3


Executing automatic setting

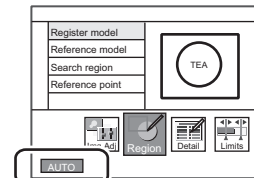


The optimum measurement conditions are automatically set just by selecting [AUTO]. Measurement conditions can also be checked and changed.




## step 1 Selecting measurement items

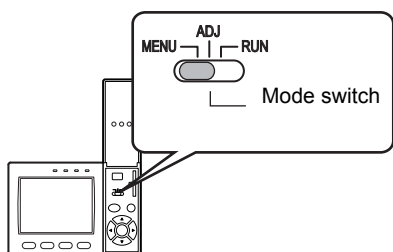

- 1** Switch to the **MENU** mode.  
The top screen is displayed.

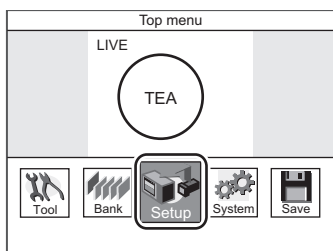

- 2** Select the **[Setup]** icon.

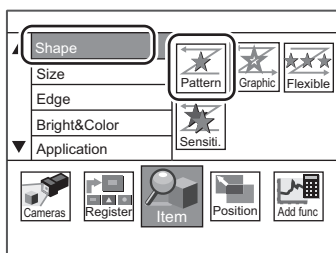


- 3** Select **[Shape]**.

- 4** Select the **[Pattern]** icon.


### Note

For details on types of measurement items, see "Setting Measurement Conditions" in Chapter 3.


## step 2 Setting measurement regions

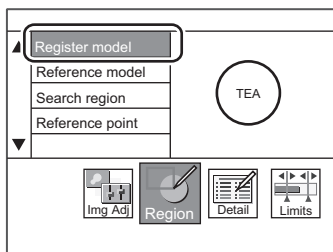

**1** Select [Register model].

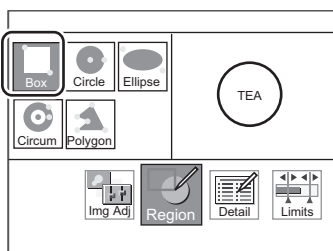

**2** Select [Box].

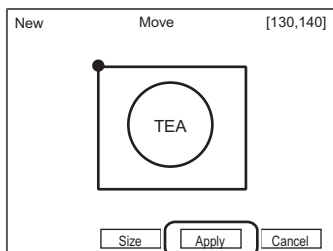

**3** Enclose the desired measurement area.

First, move the region. Next, select [Size] and apply the size.


### Note

The location of the region can be changed or the region resized by the amount of drag movement if you drag anywhere on screen. (The drag start position need not be the line of the region.) To set a region on top of [Cancel] or other buttons at the bottom of the screen, drag somewhere else on screen.

Setting the Region p.215

**4** Select [Apply].

## step 3 Executing automatic setting

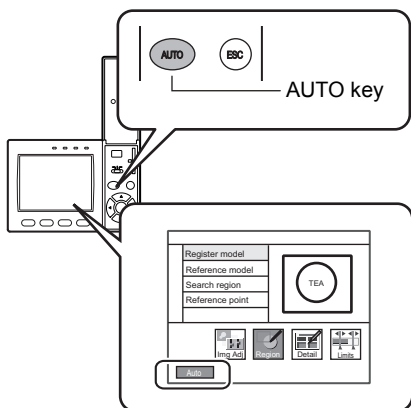

**1** Either press the **AUTO** key on the Controller or select **[AUTO]** on screen.

### Note

When the automatic setting is executed, the following parameters are set to their optimum values.


 
- Img Adj (filter setup)
- Limits (Differs according to measurement item.)
- Detail (Differs according to measurement item.)

Automatically made settings can be checked in each of the setup screens.

AUTO Setting p.182

# Checking the Measurement Status - ADJ Mode

Check whether or not measurement can be performed accurately under the conditions you have set, and adjust threshold values. Measurement results are only displayed on screen and are not output to external devices.

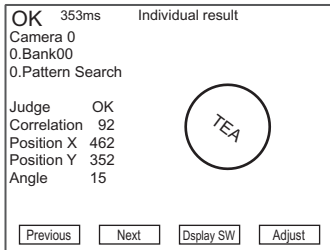

## 1 Select the ADJ mode.

The results of continuous measurement are displayed on screen. Make sure that measurement can be performed accurately and stably.

### Note Startup Adjustment

 
Up to 100 images can be saved while you are temporarily running the Controller in the RUN mode. Switch to the ADJ mode and read the saved images. Parameters matched to variation, etc. of the measurement object can be adjusted in this state as they are.



- Using a Saved Image to Perform Re-measurement p.131
- Adjusting Measurement Conditions p.132

# Starting Measurement - RUN Mode

When you have checked the measurement conditions you have set, use the RUN mode to perform measurement. In the RUN mode, measurement results are also output to external devices.



## 1 Select the RUN mode.

## 2 Input the trigger.

Measurement is executed.

Input the trigger using the SET and UP keys.

### Note Switching display content

In the RUN mode, you can switch the display content to check various information.



- Displaying Measurement Information p.126

### Important

After you have set the measurement conditions, be sure to save the setup data. All settings will be deleted if you turn the power OFF without saving the data.



- Saving Setup Data p.36

# Troubleshooting

## Clear Images Cannot be Obtained

Measurement sometimes cannot be performed successfully (e.g. measurement image is dark or contrast is low) depending on the characteristics of the measurement target. Sharp images can be obtained by applying filtering, or performing correction and adjustment to remedy the trouble.


Trouble	Remedy	Reference
Poor lighting	The recipe method light control settings can be used. You can set the lighting just by selecting the image that meets your specific requirements from the thumbnails of images automatically taken under different lighting patterns.	p.108
Low contrast	You can apply filters, such as "Sharpen", to the image to enhance the boundaries between shadow and highlight areas.	p.103
Uneven image	<ul style="list-style-type: none"> <li>You can apply filters, such as "Smooth", to the image to smooth out unevenness in the image.</li> <li>White parts of the image can be corrected to be reproduced appropriately by adjusting the white balance.</li> </ul>	p.103, p.138
Dark image	You can raise the camera's sensitivity or lengthen the shutter time to make the image brighter.	p.106, p.108

## Measurement Target Cannot be Measured Accurately Due to Movement

When the measurement target is moving (e.g. its position or orientation are not fixed), it moves out of the preset measurement region, which prevents accurate measurement. The ZFX-C is provided with a "position shift correction function" that corrects the position shift of measurement regions such as this before performing measurement. The position shift correction function enables measurement targets whose position or orientation is not fixed to be measured accurately.


 Position Correction p.115

When setting the measurement region (reference image)

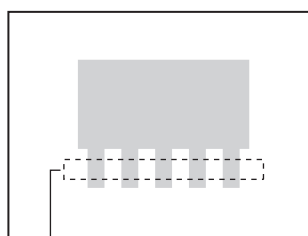


Measurement region

When the measurement target moves out of position

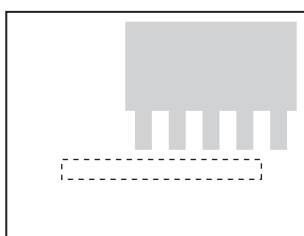

The position of the measurement target is measured after the measurement region is shifted by the amount of position shift.

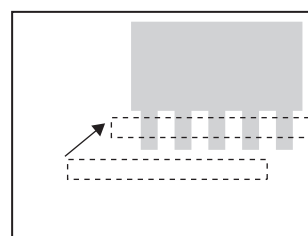

## To Output Measurement Values to a PC or PLC

Measurement values and judgment results can be output to a personal computer, PLC or other external device. Set the items to output and the output destination.

The following data can be output.

Output Item	Output Destination
Data (measurement values)	Serial interface (RS-232C/RS-422, USB)
	Parallel interface
	SD card
Judgment	Parallel interface



- Setting Output Content p.142
- Assigning the Data Output Destination p.143

## To Output Position Information of Measurement Targets as Actual Coordinates

As the Controller default, measurement values are output in pixel units and camera coordinates. You can convert measurement results in pixels to actual dimensions ( $\mu\text{m}$  or  $\text{mm}$ ) or actual coordinates for output by enabling the calibration function.



Calibration p.109

# SETTING THE MEASUREMENT CONDITIONS

<b>Setting Measurement Items</b>	<b>46</b>
Shape Inspection	46
Pattern Search	46
Graphic Search	51
Flexible Search	56
Sensitive Search	59
Size Inspection	63
Area	63
Labeling	67
Multi Colors	71
Edge Inspection	73
Position	73
Width	78
Count	82
Angle	85
Bright/Color Inspection	89
Bright	89
HUE	91
Inspection by Individual Application	94
Grouping	94
Defect	97
Image Adjustment	101
<b>Cameras/Lighting</b>	<b>106</b>
Shutter Speed	106
Gain Setting	106
Partial Function Settings	107
Image Rate	107
Light Control (Recipe Functions)	108
Calibration	109
<b>Registering Images</b>	<b>114</b>
<b>Position Correction</b>	<b>115</b>
<b>Additional Functions</b>	<b>117</b>
Calculation	117
Setting Reflection of Individual Results	121
Logging Monitor	122


# Setting Measurement Items

## Shape Inspection

### Pattern Search


Register an image pattern in beforehand as a model, and search for parts that most resemble an already registered model. The correlation indicating how much parts resemble each other, the position of the measurement target, and their angle can be output. Use this function to check for whether different-type products are mixed in, or to calculate the position of the measurement target.

#### Setup

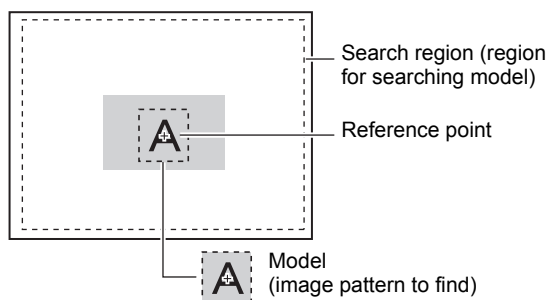

#### Measurement


Parts resembling the model are searched for.

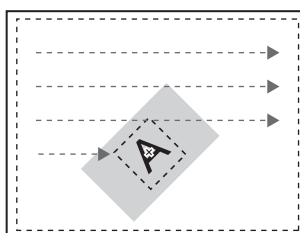

### Region settings

This function sets the region to be registered as the model and the region to search for the model.

#### ► MENU mode - [Setup] - [Item] - [Region]


Item	Description
Register model	This function registers the image pattern to find as the model.  Setting the Region p.215
Reference model	The image that is registered as the model can be referenced.
Search region	Set the region in which to search for the model.
Reference point	Set the coordinates of which part of the model are to be output. The default is the center position of the model.



## Threshold

This function sets the judgment conditions.


### ► MENU mode - [Setup] - [Item] - [Limits]

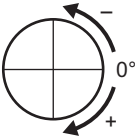Setup Item	Description
Correlation	Sets the range of the correlation to be judged as OK. Range: 0 to 100
Position XY	Sets the range of movement in the X- and Y- axes of the measurement target to be judged as OK. Range: -9999.999 to 9999.999 (When calibration is OFF, the range of movement for positions X and Y are 0 to 640 and 0 to 480, respectively.)
Angle	Sets the range of rotation angle to be judged as OK. Range: -180 to 180  
Count (enabled only when Verification is set to [ON])	Sets the number of search candidates to be judged as OK. Range: 0 to 99

## Image adjustment (if necessary)

The following items can be changed and set to the image of the measurement target.

### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select camera	 For details, see "Image Adjustment". p.101
Color filter	
Filtering	
BGS* level	

\*BGS: Background Suppression

## Detailed settings (if necessary)

When measurement is not stable, adjust the detailed conditions.

### ► MENU mode - [Setup] - [Item] - [Detail]


Setup Item	Setting value	Description
Search mode	Hi-speed	The search is performed at high speed.
	Normal (default value)	The search is performed in the normal mode for both speed and precision.
	Precision	The position is calculated at high precision in sub-pixel units (units smaller than pixels).
Rotation range	0 to 180° (default value: 0)	Sets in which angle range the model (rotated in degree units) is to be created. The smaller the skipping angle that is set, the higher the precision becomes, however, the longer the processing time becomes.
Skipping angle	1, 2, 3, 5, 10, 15, 20, 30° (default value: 10°)	<div>Important</div> <p>When the rotation range and skipping angle have been changed, register the model again.</p>
Interpolation	OFF (default value)	Calculates the angle in skipping angle units.
	ON	The angle is calculated as a numerical value down to three digits past the decimal point based on the value obtained in skipping angle units. Note, however, that the processing time increases. This function is enabled only when the search mode is the normal mode or the precision mode.
Verification	OFF (default value)	The search is performed in detail near a candidate point having the highest correlation value.
	ON	The search is performed in detail near all candidate points. Select [ON] when the model cannot be searched for stably.
Candidate level	0 to 100 (default value: 60)	Sets the level at which the model is searched for during a rough search. Images having a correlation value at the candidate level or more are taken to the candidate points in the Verification. Set a lower level when the model cannot be searched for stably.
Calibration	OFF (default value)	Measurement results are output using the camera's coordinate values.
	ON	Measurement results are output using the coordinate value converted by the calibration function.
Coordinates mode	Normal (default value)	The position information of the input image coordinate system itself is output.
	Pos. correction	When position shift correction is set, the position information is output using the coordinate system corrected to the original state when the coordinate system was registered.

 Coordinates mode p.77


# Note

## Verification and Candidate level

A rough search is performed inside the search region to find the candidate point.

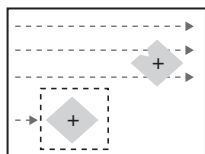


### Verification ON

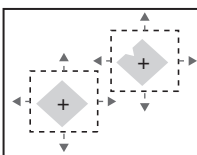

A detailed search is performed at images near all candidate points.

### Verification OFF

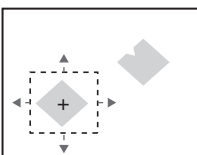


A detailed search is performed at images near the candidate point having the highest correlation.

## Search Rotation Range

Models in the range set by Rotation range are created based on the registered model.

Example: When Rotation range is 15° and Skipping angle is 5°


Registered model

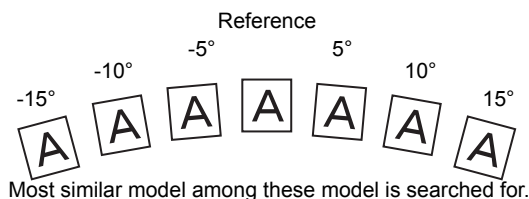

Most similar model among these model is searched for.

## Setting the Candidate level

The candidate level can be set while checking which part is to be detected as the candidate point. The search takes longer when there are many candidate points. Adjust the candidate level, if necessary.

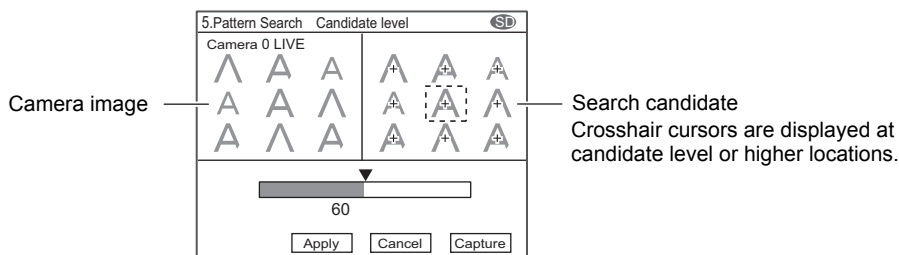

## Possible output results


The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0:OK, -1:NG, -2: not measured)	Judge (JG)
Correlation	The degree of match between the measurement image and model image are output as a correlation value. (0 to 100)	Correlation (CR)
Measurement position	The X, Y coordinates of the position where the model was found are output. (-9999.999 to 9999.999)	Position X, Y (X, Y)
Measurement angle	The rotation angle of the model that was found is output. (-180 to 180)	Angle (TH)
Search number	The number of searches that have a correlation value at the correlation lower limit value or above is output. (0 to 99)	Search count (N)
Reference position	The X, Y coordinates when the model was registered are output. (-9999.999 to 9999.999)	Reference X, Y (SX, SY)
Reference angle	The angle when the model was registered is output. (-180 to 180)	Ref. angle (ST)
Position difference	The position difference obtained by "measurement position - reference position" is output. (-9999.999 to 9999.999)	Position dif. X, Y (DX, DY)
Angle difference	The angle difference obtained by "measurement position - reference position" is output. (-180 to 180)	Angle dif. (DT)


### Note

#### Reference position/angle, position difference/angle difference

Reference position = position of model when model is registered  
 Reference angle = angle of model when model is registered

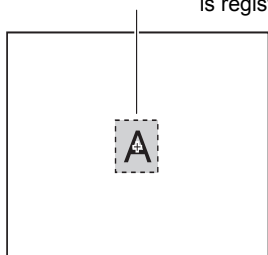

Measurement position = position of model found by measurement  
 Measurement angle = angle of model found by measurement

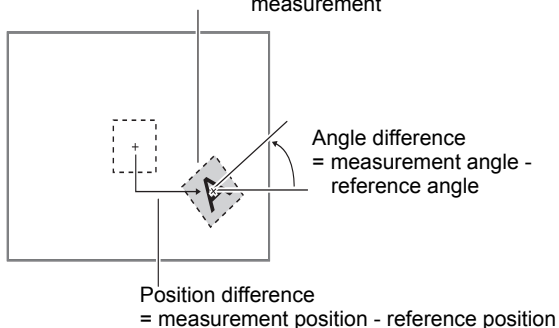


## Graphic Search

Use this item when it is difficult to search for a model from partially clipped images or low-contrast images. The degree of match indicating how much parts resemble each other and the position of the measurement object can be output.

### Note

This item is not provided for the ZFX-C10/C15.


#### Setup

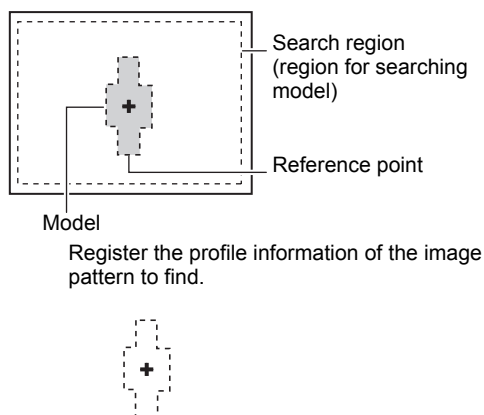


#### Measurement

Parts resembling the model are searched for stably even in the following environments.


##### Lots of noise

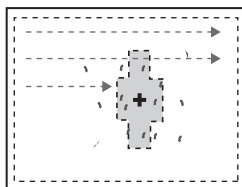


##### Partially clipped

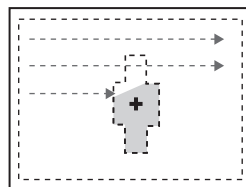

##### Low contrast

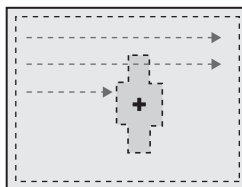

##### Inclined

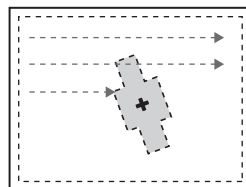

### Note

#### Comparison with Pattern Search

In a pattern search, a model of the image pattern is used with priority given to contrast information. However, in a graphic search, a model with priority given to profile information is used.

## Region settings

This function sets the region to be registered as the model and the region to search for the model.


### ► MENU mode - [Setup] - [Item] - [Region]

Item	Description
Register model	This function registers the image pattern to find as the model.
Reference model	The image that is registered as the model can be referenced.
Search region	Set the region in which to search for the model.
Reference point	Set the coordinates of which part of the model are to be output. The default is the center position of the model.


**Note****Model registration procedure**

Registration of Graphic Search models differs from registration of Pattern Search models in that the model profile is registered.


In model registration, the profile of the target image can be traced automatically. Also, the various tools can be used to adjust how much of the profile is picked up, perform free drawing, and interpolate and delete profile lines.

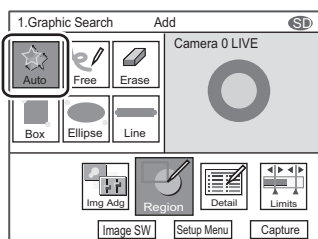

- 1** Select [Auto] and enclose the area in which the profile is to be traced.

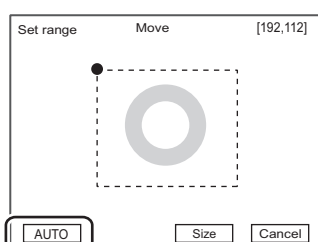

- 2** Select [Auto] displayed on the lower left of the screen for region settings.  
The profile is traced.

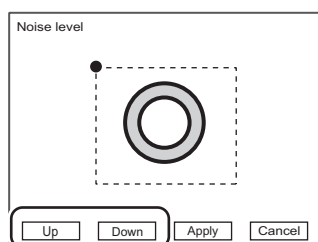


- 3** Adjust the profile lines.

How much of the profile is picked up can be adjusted by selecting [Up] or [Down] after the profile is traced.

[Up]: Selecting this setting multiple times makes noise (only low-contrast noise) more difficult to pick up. This setting is effective when lots of noise is picked up.  
Delete high-contrast noise with the [Erase] tool.

[Down]: Selecting this setting multiple times makes the profile easier to pick up. This setting is effective when the profile to be detected is not picked up.

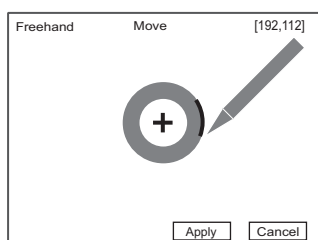


- 4** If the profile is partially clipped, trace by [Free], [Box], [Ellipse] or [Line].

When [Free] is selected, the profile can be drawn with the touch pen. The profile of automatically picked up images can be traced and interpolated as desired with the touch pen.

## Threshold

This function sets the judgment conditions.


### ► MENU mode - [Setup] - [Item] - [Limits]

Setup Item	Description
Correlation	Sets the range of the correlation to be judged as OK. Range: 0 to 100
Position XY	Sets the range of movement in the X- and Y-axes of the measurement target to be judged as OK. Range: -9999.999 to 9999.999 (When calibration is OFF, the range of movement for positions X and Y are 0 to 640 and 0 to 480, respectively.)
Angle	Sets the range of rotation angle to be judged as OK. Range: -180 to 180  +/- direction of angle p.47

## Image adjustment (if necessary)

The following items can be changed and set to the image of the measurement target.

### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select camera	 For details, see "Image Adjustment". p.101
Color filter	
Filtering	
BGS level	

## Detailed settings (if necessary)

When measurement is not stable, adjust the detailed conditions.

### ► MENU mode - [Setup] - [Item] - [Detail]

Setup Item	Setting value	Description
Search mode	Hi-speed	The search is performed at high speed.
	Normal (default value)	The search is performed in the normal mode.
	Precision	The position is calculated at high precision in sub-pixel units (units smaller than pixels).
Rotation range	0 to 180° (default value: 0)	Sets in which angle range the model (rotated in degree units) is to be created. The smaller the skipping angle that is set, the higher the precision becomes, however, the longer the processing time becomes.
Skipping angle	1, 2, 3, 5, 10, 15, 20, 30° (default value: 10°)	<p><b>Important</b></p> <p>When the rotation range and skipping angle have been changed, register the model again.</p>
Interpolation	OFF (default value)	Calculates the angle in skipping angle units.
	ON	The angle is calculated as a numerical value down to three digits past the decimal point based on the value obtained in skipping angle units. Note, however, that the processing time increases. This function is enabled only when the search mode is the normal mode or the precision mode.
Candidate level	0 to 100 (default value: 60)	Sets the level at which the model is searched for during a rough search. Images having a value of the degree of match at the candidate level or more are taken to the candidate points in the Verification. Set a lower level when the model cannot be searched for stably.
Noise level	0 to 255 (default value: 8)	<p>Sets the level at which profile information is searched during measurement.</p> <p>Profile information is obtained from the change in light intensity. Locations having a light intensity at the noise level or higher are picked up as the profile. Locations having a lower light intensity are judged as noise components.</p> <p>Adjusting this level has the following effect.</p> <div style="text-align: center;"> </div>
Calibration	OFF (default value)	Measurement results are output using the camera's coordinate values.
	ON	Measurement results are output using the coordinate value converted by the calibration function.
Coordinates mode	Normal (default value)	The position information of the input image coordinate system itself is output.
	Pos. correction	When position shift correction is set, the position information is output using the coordinate system corrected to the original state when the coordinate system was registered.




- Verification and Candidate level p.49
- Search Rotation Range p.49
- Setting the Candidate level p.49
- Coordinates mode p.77



**Note****Noise level adjustment screen**

Both the camera image and profile image are displayed. Adjust the noise level while checking whether or not the part to be measured is picked up as the profile.

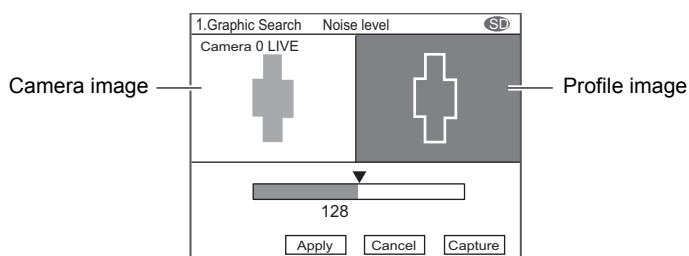**Possible output results**

The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0:OK, -1:NG, -2: not measured)	Judge (JG)
Correlation	The degree of match between the measurement image and model image are output. (0 to 100)	Correlation (CR)
Measurement position	The X, Y coordinates of the position where the model was found are output. (-9999.999 to 9999.999)	Position X, Y (X, Y)
Measurement angle	The rotation angle of the model that was found is output. (-180 to 180)	Angle (TH)
Search number	The number of searches that have a degree of match at the match lower limit value or above is output. (0 to 99)	Search count (N)
Reference position	The X, Y coordinates when the model was registered are output. (-9999.999 to 9999.999)	Reference X, Y (SX, SY)
Reference angle	The angle when the model was registered is output. (-180 to 180)	Ref. angle (ST)
Position difference	The position difference obtained by "measurement position - reference position" is output. (-9999.999 to 9999.999)	Position dif. X, Y (DX, DY)
Angle difference	The angle difference obtained by "measurement position - reference position" is output. (-180 to 180)	Angle dif. (DT)



Reference position/angle, position difference/angle difference p.50

## Flexible Search


This item is used to treat slight differences as same types. Register up to 36 image patterns to be set as same types beforehand as models. This reduces the misjudgment which judges good products as non-good products.

The correlation indicating how much parts resemble each other and the position of the measurement object can be output.

### Note


This item is not provided for the ZFX-C10/C15.

### Setup

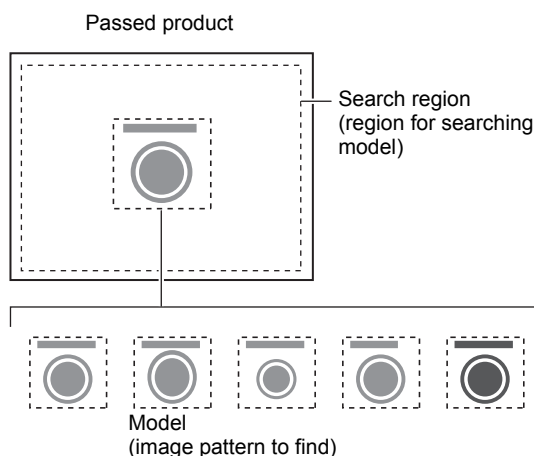

### Measurement

Parts resembling one or some of the multiple registered models are searched for, and the results of the model having the highest degree of match of all of the registered models are acquired.

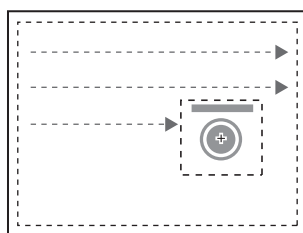

## Region settings

This function sets the region to be registered as the model and the region to search for the model.

### ► MENU mode - [Setup] - [Item] - [Region]

Item	Description
Register model	This function registers the image pattern to find as the model. Setting the Region p.215
Reference model	The image that is registered as the model can be referenced.
Search region	Set the region in which to search for the model.

### Note

With Flexible Search, multiple image patterns can be set as models.

When auto setting is executed, a new model is registered in an unregistered number. For example, if auto setting is executed with models nos. 0 and 1 already registered, a new model will be registered in model no. 2. If model nos. 0 to 35 are already registered, NG will result.

Each time auto setting is executed, the optimum color filter is automatically selected.

AUTO Setting p.182

## Threshold

This function sets the judgment conditions.


### ► MENU mode - [Setup] - [Item] - [Limits]

Setup Item	Description
Correlation	Sets the range of the correlation to be judged as OK. Range: 0 to 100
Position XY	Sets the range of movement in the X- and Y- axes of the measurement target to be judged as OK. Range: -9999.999 to 9999.999 (When calibration is OFF, the range of movement for positions X and Y are 0 to 640 and 0 to 480, respectively.)
Model No.	Sets the range of model Nos. to be judged as OK. Range: 0 to 35

## Image adjustment (if necessary)

The following items can be changed and set to the image of the measurement target.

### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select camera	 For details, see "Image Adjustment". p.101
Color filter	
Filtering	
BGS level	

## Detailed settings (if necessary)

When measurement is not stable, adjust the detailed conditions.

### ► MENU mode - [Setup] - [Item] - [Detail]

Setup Item	Setting value	Description
Search mode	Hi-speed	The search is performed at high speed.
	Normal (default value)	The search is performed in the normal mode for both speed and precision.
	Precision	The position is calculated at high precision in sub-pixel units (units smaller than pixels).
Verification	OFF (default value)	The search is performed in detail near a candidate point having the highest correlation value.
	ON	The search is performed in detail near all candidate points. Select [ON] when the model cannot be searched for stably.
Candidate level	0 to 100 (default value: 60)	Sets the level at which the model is searched for during a rough search. Images having a correlation value at the candidate level or more are taken to the candidate points in the Verification. Set a lower level when the model cannot be searched for stably.
Calibration	OFF (default value)	Measurement results are output using the camera's coordinate values.
	ON	Measurement results are output using the coordinate value converted by the calibration function.
Coordinates mode	Normal (default value)	The position information of the input image coordinate system itself is output.
	Pos. correction	When position shift correction is set, the position information is output using the coordinate system corrected to the original state when the coordinate system was registered.



- Verification and Candidate level p.49
- Setting the Candidate level p.49
- Coordinates mode p.77

## Possible output results


The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0:OK, -1:NG, -2: not measured)	Judge (JG)
Correlation	The degree of match between the measurement image and model image are output as a correlation value. (0 to 100)	Correlation (CR)
Measurement position	The X, Y coordinates of the position where the model was found are output. (-9999.999 to 9999.999)	Position X, Y (X, Y)
Model No. (NO)	Outputs the No. of the model having the highest correlation. (0 to 35)	Model No. (NO)

## Sensitive Search


Use this item to detect minute differences. Models are automatically subdivided to check the degree of match in detail. The correlation indicating how much parts resemble each other and the position of the measurement target can be output. The correlation and position information of the model having the lowest degree of match of the subdivided models is output.

### Setup

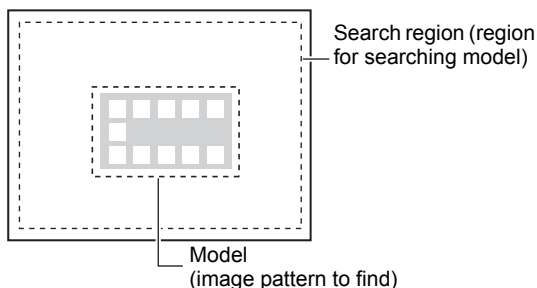

### Measurement

Parts resembling the model are searched, and the degree of match is checked in detail by subdivided models. When subdivided models are a solid color, the solid color rate also can be inspected.

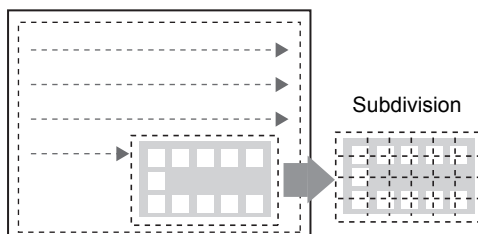

### Note

#### Comparison with pattern search

Example: Passed product



Different type




Reversed



#### < Distribution of Measurement Results >

In a pattern search, a difference in correlation values does not appear, making correlation values difficult to distinguish as there are small differences.


In a Sensitive search, even small differences can be distinguished.

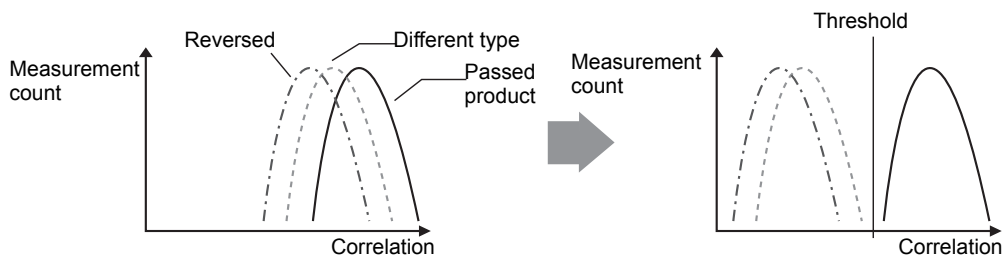

## Region settings

This function sets the region to be registered as the model and the region to search for the model.


### ► MENU mode - [Setup] - [Item] - [Region]

Item	Description
Register model	This function registers the image pattern to find as the model.  Setting the Region p.215
Reference model	The image that is registered as the model can be referenced.
Search region	Sets the region in which to search for the model.

## Threshold

This function sets the judgment conditions.


### ► MENU mode - [Setup] - [Item] - [Limits]

Setup Item	Description
Correlation	Sets the range of the correlation to be judged as OK. Range: 0 to 100
Position XY	Sets the range of movement in the X- and Y- axes of the measurement target to be judged as OK. Range: -9999.999 to 9999.999 (When calibration is OFF, the range of movement for positions X and Y are 0 to 640 and 0 to 480, respectively.)
Solid color rate	Sets the range of solid color to be judged as OK. Range: 0 to 100
Angle	Sets the range of rotation angle to be judged as OK. Range: -180 to 180  +/- direction of angle p.47

## Image adjustment (if necessary)

The following items can be changed and set to the image of the measurement target.

### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select camera	 For details, see "Image Adjustment". p.101
Color filter	
Filtering	
BGS level	

## Detailed settings (if necessary)

When measurement is not stable, adjust the detailed conditions.

### ► MENU mode - [Setup] - [Item] - [Detail]

Setup Item	Setting value	Description
Search mode	Hi-speed	Matching is performed at high speed. Use this mode to shorten the processing time.
	Normal	The search is performed in the normal mode for both speed and precision. Use this mode to measure large text or roughly drawn pictures.
	Precision (default value)	Positioning is performed at high precision followed by matching. Use this mode to measure fine text or detailed patterns.
Sensitivity	Low	The model is subdivided into nine models of up to three divisions in each of the horizontal and vertical directions and then measured.
	Middle (default value)	The model is subdivided into 25 models of up to five divisions in each of the horizontal and vertical directions and then measured.
	High	The model is subdivided into 100 models of up to ten divisions in each of the horizontal and vertical directions and then measured.
Rotation range	0 to 180° (default value: 0)	Sets in which angle range the model (rotated in degree units) is to be created. The smaller the skipping angle that is set, the higher the precision becomes, however, the longer the processing time becomes.
Skipping angle	1, 2, 3, 5, 10, 15, 20, 30° (default value: 10°)	
Interpolation	OFF (default value)	Calculates the angle in skipping angle units.
	ON	The angle is calculated as a numerical value down to three digits past the decimal point based on the value obtained in skipping angle units. Note, however, that the processing time increases. This function is enabled only when the search mode is the normal mode or the precision mode.
Verification	OFF (default value)	The search is performed in detail near a candidate point having the highest correlation value.
	ON	The search is performed in detail near all candidate points. Select [ON] when the model cannot be searched for stably.
Candidate level	0 to 100 (default value: 60)	Sets the level at which the model is searched for during a rough search. Images having a correlation value at the candidate level or more are taken to the candidate points in the Verification. Set a lower level when the model cannot be searched for stably.
Solid color check	OFF (default value)	Select [ON] when inspecting sections of solid color on subdivided models.
	ON	
Output position	Most dissimilar part (default value)	The center coordinates of the subdivided model having the lowest correlation are output.
	Center position	The center coordinates of the model that was found are output.
Calibration	OFF (default value)	Measurement results are output using the camera's coordinate values.
	ON	Measurement results are output using the coordinate value converted by the calibration function.
Coordinates mode	Normal (default value)	The position information of the input image coordinate system itself is output.
	Pos. correction	When position shift correction is set, the position information is output using the coordinate system corrected to the original state when the coordinate system was registered.



- Verification and Candidate level p.49
- Search Rotation Range p.49
- Setting the Candidate level p.49
- Coordinates mode p.77

**Note**

The minimum size of subdivided models is 32 x 32 pixels.

**Important**

When the sensitivity, rotation range, and skipping angle have been changed, register the model again.

**Possible output results**

The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0:OK, -1:NG, -2: not measured)	Judge (JG)
Correlation	The degree of match between the measurement image and model image are output as a correlation value. The correlation and position information of the model having the lowest degree of match of the subdivided models is output. (0 to 100)	Correlation (CR)
Measurement position	When [Difference position] is selected at [Output position]: The X, Y coordinates of the location having the lowest correlation value, as a result of having calculated the correlation value in detail by subdivided models, are output. (-9999.999 to 9999.999) When [Center position] is selected at [Output position]: The center coordinates of the model that was found are output. (-9999.999 to 9999.999)	Position X, Y (X, Y)
Solid color rate	The rate that the model is a solid color is output. The higher the solid color rate, the higher the value increases. (0 to 100)	Solid color rate (SC)
Measurement angle	The rotation angle of the model that was found is output. (-180 to 180)	Angle (TH)




# Size Inspection

## Area


The area, gravity and angle of the desired color can be measured. This allows you to inspect the size of the measurement target, and detect positions and inclination.

### Setup

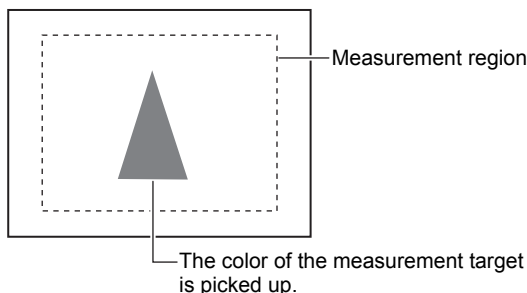

### Measurement

Only the picked up color is judged to be the measurement target.

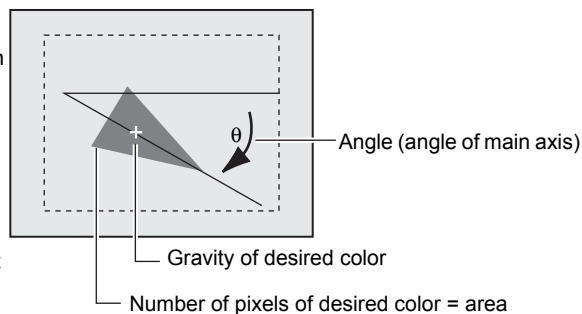

### Note


When a color camera is connected, up to four colors can be specified as the color to be measured.

When a monochrome camera is connected to the Controller, black-and-white images are binarized. White pixels are targeted in measurement.

## Image adjustment

This function picks up the color to be measured.


### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select camera	 For details, see "Image Adjustment". p.101 (Filtering, BGS level, Brightness Control can be used only when a monochrome camera is connected.)
Color Pickup/Binary	
Filtering	
BGS level	
Brightness Control	

## Region settings

This function sets the measurement region.


### ► MENU mode - [Setup] - [Item] - [Region]

Item	Description
Measurement region	<p>This function sets the region to be measured.</p> <p> Setting the Region p.215</p>
Reference registration	<p>When the measurement region is set, measurement is executed on the display image, and the result of execution is registered as the reference value. To re-register only reference values, you can use this function to re-register only reference values based on the image currently on screen.</p>

## Threshold

This function sets the judgment conditions.




### ► MENU mode - [Setup] - [Item] - [Limits]

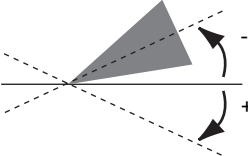
Setup Item	Description
Area	<p>Sets the range of the area to be judged as OK.</p> <p>Range: 0 to 9999999.999</p> <p>(When calibration is OFF, the range becomes 0 to 307200.)</p>
Gravity XY	<p>Sets the range of movement in the X- and Y- axes of the measurement target to be judged as OK.</p> <p>Range: -9999.999 to 9999.999</p> <p>(When calibration is OFF, the range of movement for positions X and Y are 0 to 608 and 0 to 464, respectively.)</p>
Axis angle	<p>Sets the rotating range of the measurement target to be judged as OK.</p> <p>Range: -90.0 to 90.0</p> 

## Detailed settings (if necessary)

When measurement is not stable, adjust the detailed conditions.

### ► MENU mode - [Setup] - [Item] - [Detail]

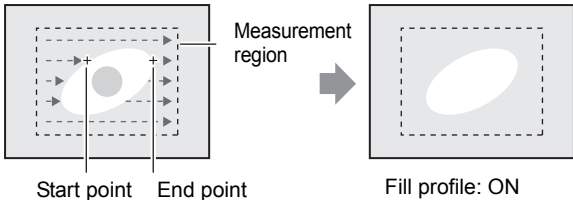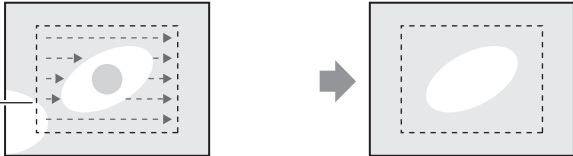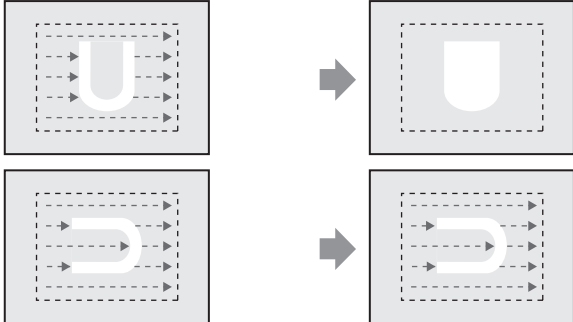Setup Item	Setting value	Description
Measure axis angle	OFF (default value)	Sets whether or not to measure the axis angle. When [ON] is selected, the processing time increases proportionately to the time it takes to measure the axis angle.
	ON	
Fill profile	OFF (default value)	To measure the outer periphery of the measurement target, set this item to [ON]. When this item is set to [ON], measurement is performed with all of the area between the start point (colors outside of measurement target → measurement target color) and the end point (measurement target color → colors outside of measurement target) inside the measurement region judged to the measurement target color. <div><p>Start point    End point    Measurement region    Fill profile: ON</p><p><b>When the measurement target color overlaps the measurement region</b></p><p>Input image (Fill profile: OFF)    Fill profile: ON</p><p>Pixels that are measurement target color are not recognized as the start point as pixels that are colors outside of measurement target are next scanned.</p><p><b>When measuring the measurement target with unevenness</b></p><p>The measurement result changes according to the direction in which the measurement target is fed.</p><p>Input image (Fill profile: OFF)    Fill profile: ON</p></div>
	ON	
Calibration	OFF (default value)	Measurement results are output using the camera's coordinate values.
	ON	Measurement results are output using the coordinate value converted by the calibration function.
Coordinates mode	Normal (default value)	The position information of the input image coordinate system itself is output.
	Pos. correction	When position shift correction is set, the position information is output using the coordinate system corrected to the original state when the coordinate system was registered.

 Coordinates mode p.77

## Possible output results

The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0:OK, -1:NG, -2: not measured)	Judge (JG)
Area	The area of the measurement target color is output. (0 to 9999999.999)	Area (AR)
Gravity position	The X, Y coordinates of the gravity of the measurement target color are output. (-9999.999 to 9999.999)	Gravity X, Y (X, Y)
Axis angle	The angle of the measurement target color is output. (-90.0 to 90.0)	Axis angle (TH)
Reference area	The area when the measurement region is set is output. (0 to 9999999.999)	Ref. area (SA)
Reference position	The X, Y coordinates of the gravity when the measurement region is set are output. (-9999.999 to 9999.999)	Reference X, Y (SX, SY)
Reference axis angle	The angle when the measurement region is set is output. (-90.0 to 90.0)	Ref. axis angle (ST)
Area difference	The area difference obtained by "measurement value - reference value" is output. (-9999999.999 to 9999999.999)	Area dif. (DA)
Position difference	The position difference obtained by "gravity position - reference position" is output. (-9999.999 to 9999.999)	Position dif. X, Y (DX, DY)
Axis angle difference	The axis angle difference obtained by "measurement value - reference value" is output. (-180.0 to 180.0)	Axis angle dif. (DT)



For details on reference position, Position difference p.50


## Labeling

A group of colors to be measured is counted as a "label." Label Nos. are assigned to each label after being arranged in order of position and size. The total number of labels and the size/position of any label can be output.

### Note

This item is not provided for the ZFX-C10/C15.


#### Setup

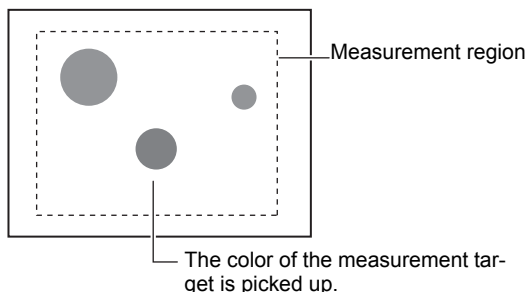

#### Measurement

A group of picked up colors is detected as a label.

Number of picked up labels: 3

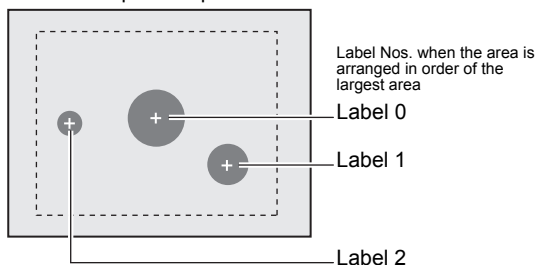

### Note

When a color camera is connected, up to four colors can be specified as the color to be measured. When a monochrome camera is connected to the Controller, black-and-white images are binarized. White pixels are targeted in measurement.

## Image adjustment

This function picks up the color to be measured.

### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select camera	For details, see "Image Adjustment". p.101 (Filtering, BGS level, Brightness Control can be used only when a monochrome camera is connected.)
Color Pickup/Binary	
Filtering	
BGS level	
Brightness Control	

## Region settings

This function sets the measurement region.

### ► MENU mode - [Setup] - [Item] - [Region]

Item	Description
Measurement region	This function sets the region to be measured.  Setting the Region p.215
Reference registration	When the measurement region is set, measurement is executed on the display image, and the result of execution is registered as the reference value. To re-register only reference values, you can use this function to re-register only reference values based on the image currently on screen.


## Threshold

This function sets the judgment conditions. Judgment is performed on corresponding label Nos.

### Note

When no label is found, the setup items will be judged as OK except the Number of labels, regardless of the threshold value. Set one or more for the minimum number of label for the measurement to be judged as NG when no label is found.

### ► MENU mode - [Setup] - [Item] - [Limits]



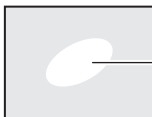
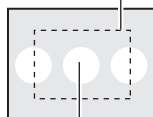
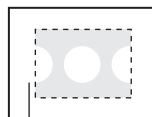
Setup Item	Description
Area	Sets the range of the area to be judged as OK. Range: 0 to 9999999.999 (When calibration is OFF, the range of the area becomes 0 to 307200.)
Gravity XY	Sets the range of movement in the X- and Y-axes of the measurement target to be judged as OK. Range: -9999.999 to 9999.999 (When calibration is OFF, the range of movement for positions X and Y are 0 to 640 and 0 to 480, respectively.)
Number of labels	Sets the number of labels of the measurement target to be judged as OK. Range: 0 to 65535
Axis angle	Sets the rotating range of the measurement target to be judged as OK. Range: -90.0 to 90.0  +/- direction of angle p.64
Perimeter	Sets the perimeter of the measurement target to be judged as OK. Range: 0 to 9999999.999 (When calibration is OFF, the range of the perimeter becomes 0 to 200000.)
Length XY	Sets the X and Y lengths of the box circumscribing the measurement target to be judged as OK. Range: -9999.999 to 9999.999 (When calibration is OFF, the range of movement for positions X and Y are 0 to 640 and 0 to 480, respectively.)
Roundness	Sets the roundness of the measurement target to be judged as OK. Range: 0 to 1.0

### Detailed settings (if necessary)

When measurement is not stable, adjust the detailed conditions.

### ► MENU mode - [Setup] - [Item] - [Detail]

Setup Item	Setting value	Description
Labeling mode	Precision	The image is measured without being compressed.
	Normal (default value)	The image is measured at high speed after being compressed to 1/2 size in both the horizontal and vertical directions.
Sort mode	Area descending order (default value)	Re-assigns label Nos. in order of the largest area.
	Area ascending order	Re-assigns label Nos. in order of the smallest area.
	X gravity descending order	Re-assigns label Nos. in order of the largest X gravity coordinate.
	X gravity ascending order	Re-assigns label Nos. in order of the smallest X gravity coordinate.
	Y gravity descending order	Re-assigns label Nos. in order of the largest Y gravity coordinate.
	Y gravity ascending order	Re-assigns label Nos. in order of the smallest Y gravity coordinate.

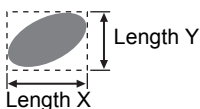
Setup Item	Setting value	Description
Label No.	0 to 2499 (default value: 0)	Sets the label No. whose data is to be output.
Measure axis angle	OFF (default value) ON	When set to "ON", the axis angle is calculated.
Measure perimeter	OFF (default value) ON	When "ON", the following parameters are calculated: <ul style="list-style-type: none"> <li>• Length X</li> <li>• Length Y</li> <li>• Perimeter</li> </ul> 
Measure roundness	OFF (default value) ON	Sets whether or not to calculate roundness. Roundness = $(4\pi \times \text{area}) / (\text{perimeter} \times \text{perimeter})$
Filling up holes	OFF (default value) ON	Selects how to process parts other than the target color that are enclosed by the target color to be measured, such as a doughnut. When "ON" is set, parts are processed as the target color to be measured. <div> <div>Input image</div>  <div>Filling up holes: ON</div>  <div>Measurement target</div> </div>
Outside trimming	OFF (default value) ON	Set this function when the measurement region contains colors other than the measurement color that are not required in measurement. When "ON" is set, the entire region outside of the measurement region is measured as the color to be measured. <div> <div>Input image</div>  <div>Measurement region</div> <div>Outside trimming: ON</div>  <div>To calculate the position and area of this label</div> <div>The region outside of the measurement region is taken to be the color to be measured. Sort mode: Area descending order When "Label No." is set to "1", the label position and area in the center are calculated.</div> </div>
Area judgment	0 to 9999999.999 (default value: lower limit 0, upper limit 307200)	Sets the minimum and maximum area values to be counted as a label. Adjust the setting value when noise is counted as a label by mistake.
Calibration	OFF (default value) ON	Measurement results are output using the camera's coordinate values. Measurement results are output using the coordinate value converted by the calibration function.
Coordinates mode	Normal (default value) Pos. correction	The position information of the input image coordinate system itself is output. When position shift correction is set, the position information is output using the coordinate system corrected to the original state when the coordinate system was registered.



Coordinates mode p.77

**Note****Area judgment screen**

Crosshair cursors are displayed at locations in the labeling image area recognized as valid labels. Adjust the area judgment value while checking whether or not the part to be measured is recognized correctly.

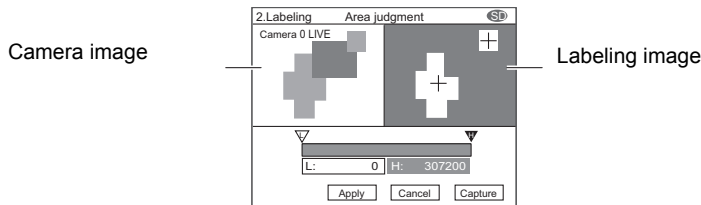**Possible output results**

The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0: OK, -1: NG, -2: not measured)	Judge (JG)
Area	The area of the corresponding label is output. (0 to 9999999.999)	Area (AR)
Gravity position	The X, Y coordinates of the gravity of the corresponding label are output. (-9999.999 to 9999.999)	Gravity X, Y (X, Y)
Number of labels	The total number of labels is output. (0 to 65535)	Number of labels (N)
Axis angle	The angle of the corresponding label is output. (-90.0 to 90.0)	Axis angle (TH)
Perimeter	The perimeter of the corresponding label is output. (0 to 9999999.999)	Perimeter (L)
Length XY	The X and Y lengths of the box circumscribing the corresponding label are output. (0 to 9999.999)	Length X, Y (LX, LY)
Roundness	The roundness of the corresponding label is output. (0 to 1.0)	Roundness (CL)
Reference area	The area of the corresponding label when the measurement region is set is output. (0 to 9999999.999)	Ref. area (SA)
Reference position	The X, Y coordinates of the gravity of the corresponding label when the measurement region is set are output. (-9999.999 to 9999.999)	Reference X, Y (SX, SY)
Reference axis angle	The angle of the corresponding label when the measurement region is set are output. (-90.0 to 90.0)	Ref. axis angle (ST)
Reference perimeter	The perimeter of the corresponding label when the measurement region is set is output. (0 to 9999999.999)	Ref. perimeter (SL)
Reference length XY	The X and Y lengths of the box circumscribing the corresponding label when the measurement region is set are output. (0 to 9999.999)	Ref. length X, Y (SLX, SLY)
Reference roundness	The roundness of the corresponding label when the measurement region is set is output. (0 to 1.0)	Ref. roundness (SC)
Area difference	The area difference obtained by "measurement value - reference value" is output. (-9999999.999 to 9999999.999)	Diff. area (DA)
Position difference	The position difference obtained by "gravity position - reference position" is output. (-9999.999 to 9999.999)	Displacement X, Y (DX, DY)
Axis angle difference	The axis angle difference obtained by "measurement value - reference value" is output. (-180.0 to 180.0)	Diff. axis angle (DT)
Perimeter difference	The perimeter difference obtained by "measurement value - reference value" is output. (-9999999.999 to 9999999.999)	Diff. perimeter (DL)
Length XY difference	The length difference obtained by "measurement value - reference value" is output. (-9999.999 to 9999.999)	Diff. length X, Y (DLX, DLY)
Roundness difference	The roundness difference obtained by "measurement value - reference value" is output. (-1.0 to 1.0)	Diff. roundness (DC)



Reference position and position difference p.50



## Multi Colors


This function measures the areas of up to four colors simultaneously, which enables to measure the difference of color pattern. Each of the area values and differences with reference values can be output.

### Important

This function cannot be used when a monochrome camera is connected.


#### Setup

Measurement region and up to four reference colors can be registered.

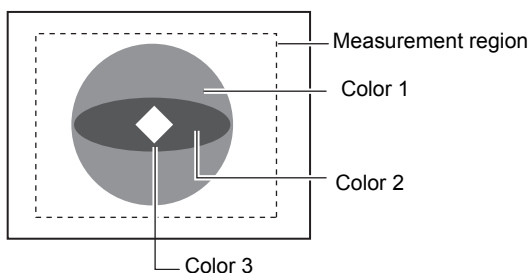

#### Measurement


The area of each color is measured, and if even one of the area values is judged as NG, the overall judgment result is NG.

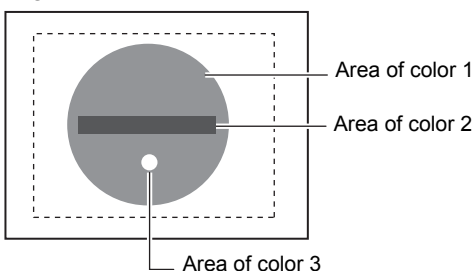

## Image adjustment

This function picks up the color to be measured.

### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select Camera	 For details, refer to "Image Adjustment " p.101.
Color pickup	

## Region settings

This function sets the measurement region.

### ► MENU mode - [Setup] - [Item] - [Region]

Item	Description
Measurement region	Sets the region to be measured.
Reference registration	When the measurement region is set, measurement is executed on the display image, and the result of execution is registered as the reference value. To re-register only reference values, you can use this function to re-register only reference values based on the image currently on screen.

## Threshold

This function sets the judgment conditions.


### ► MENU mode - [Setup] - [Item] - [Limits]

Setup Item	Description
Area 1 to 4	Sets the range of the area to be judged as OK. Range: 0 to 9999999.999 (When calibration is OFF, the range becomes 0 to 307200.)

## Detailed settings (if necessary)

Adjust the detailed conditions, if necessary.

### ► MENU mode - [Setup] - [Item] - [Detail]

Setup Item	Setting Value	Description
Fill profile	OFF (default value)	To measure the outer periphery of the measurement target, set this item to [ON].
	ON	When this item is set to [ON], measurement is performed with all of the area between the start point (colors outside of measurement target → measurement target color) and the end point (measurement target color → colors outside of measurement target) inside the measurement region judged to the measurement target color.  For details, refer to the "Fill profile " p.65.
Calibration	OFF (default value)	Measurement results are output using the camera's coordinate values.
	ON	Measurement results are output using the coordinate value converted by the calibration function.
Auto THset +/-	0 to 9999999.999	When AUTO setting is executed, the value obtained by incrementing/decrementing this value on the measured value is set as the thresholds.
Area judgment	0 to 9999999.999	Sets the area value to be judged as the effective color. When AUTO setting is executed, only up to four colors having an area within these upper and lower limit values are automatically registered.

## Possible output results

The following values can be output when expressions are set.

Item	Description
Judgment result (JG)	The judgment result is output. (0: OK, -1: NG, -2: not measured)
Area 1 to 4 (AR1 to 4)	The area of the measurement color is output. (0 to 9999999.999)
Ref. area 1 to 4 (SA1 to 4)	The area when the measurement region is set is output. (0 to 9999999.999)
Diff. area 1 to 4 (DA1 to 4)	The area difference obtained by "measurement value - reference value" is output. (9999999.999 to 9999999.999)


# Edge Inspection

## Position

This item uses the changes in brightness in a region to detect edge(s). Use this item to calculate the coordinates of the edge(s) of a measurement target.


### Setup

To acquire the X coordinate of the edge

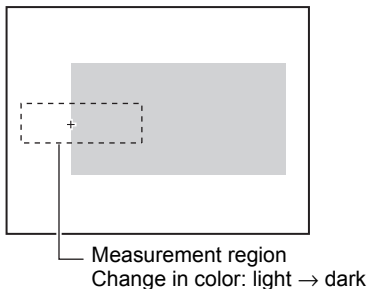

### Measurement


The edge is searched in the region according to the preset direction and change in color.

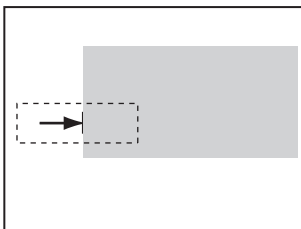

## Region settings

This function sets the measurement region.


### ► MENU mode - [Setup] - [Item] - [Region]

Item	Description
Measurement region	This function sets the region to be measured.  Setting the Region p.215
Reference registration	When the measurement region is set, measurement is executed on the display image, and the result of execution is registered as the reference value. To re-register only reference values, you can use this function to re-register only reference values based on the image currently on screen.

#### Note

#### Edge search direction

The edge is searched from the start point towards the end point of the region.

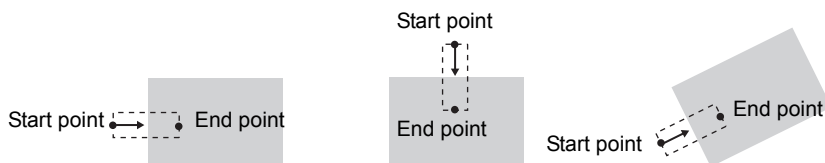

## Threshold

This function sets the judgment conditions.


### ► MENU mode - [Setup] - [Item] - [Limits]

Setup Item	Description
Position XY	Sets the range of movement in the X- and Y- axes of the measurement target to be judged as OK. Range: -9999.999 to 9999.999 (When calibration is OFF, the range of movement for positions X and Y are 0 to 640 and 0 to 480, respectively.)

## Image adjustment (if necessary)

The following items can be changed and set to the image of the measurement target.

### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select camera	 For details, see "Image Adjustment". p.101  Selects which of Color filter or Color Pickup is to be used at [Detail] - [Color mode]. The default is use of Color filter.
Color filter	
Color Pickup/Binary	
Filtering	
BGS level	

## Detailed settings (if necessary)

When measurement is not stable, adjust the detailed conditions. By the automatic setting, the edge search color is automatically set.

### ► MENU mode - [Setup] - [Item] - [Detail]


Setup Item	Setting value	Description
Measurement mode	Average (default value)	Sets the method for calculating the position of the edge(s).
	Peak	
	Bottom	
Color mode	Filter mode (default value)	Color filter processing improves the contrast of images so that edges are detected.
	Pickup mode	Specify the color to measure to find the edge of that color.
Split size	1 to 99 (default value: 1)	Sets the calculation width when the peak/bottom positions are to be calculated. The peak or bottom is calculated after the measurement region is split up by the calculation width to find the edge(s).
Color	Light → Dark (default value)	Selects the density change direction of the edge(s) to be detected.
	Dark → Light	
Edge level	1 to 99 (default value: 50)	Sets the level of density change to be judged as an edge.
Noise level	0 to 255 (default value: 20)	Sets the level to be judged as noise. When the difference between the minimum and maximum density values in the density region is at the noise level or lower, it is judged that there are no edges. Set a higher value when noise causes an edge to be detected by mistake.
Noise width	0 to 255 (default value: 0)	Sets the width to be judged as noise. Set a higher value when noise causes an edge to be detected by mistake.
Calibration	OFF (default value)	Measurement results are output using the camera's coordinate values.
	ON	Measurement results are output using the coordinate value converted by the calibration function.
Coordinates mode	Normal (default value)	The position information of the input image coordinate system itself is output.
	Pos. correction	When position shift correction is set, the position information is output using the coordinate system corrected to the original state when the coordinate system was registered.

## Note

### Measurement mode


Sets the method for calculating the position of the edge(s).

The side far from the start point of the measurement region is the peak, and the side near the start point is the bottom.

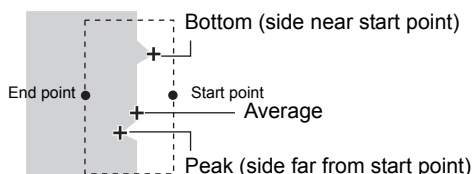

### Split size


The inside of the measurement region is divided into smaller areas to search for the edge(s), and the peak/bottom/average are calculated. This calculated width is then set.

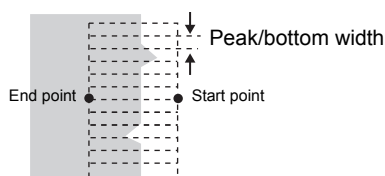

### Edge level

Edges are detected as follows:

1. The density distribution of the entire measurement region is calculated.
2. The maximum value is taken to 100% from the minimum density value.
3. Places where the density of the edge level changes are detected as edges.

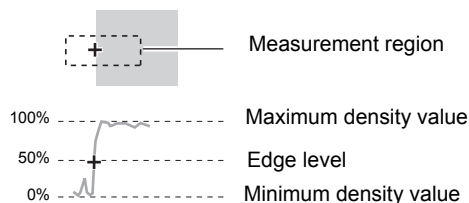


### Noise level

The minimum and maximum density values in the edge detection region are calculated, and it is judged that there are no edges when the difference between these values is at the noise level or lower. Normally, this setting may be left at its default value of 20. However, set a higher value when noise causes an edge to be detected by mistake. (in region)


Maximum density value - minimum density value < noise level → Judged as "no edge" → Measurement result NG

Maximum density value - minimum density value ≥ Noise level → Judged as "edge" → Taken to be measurement target

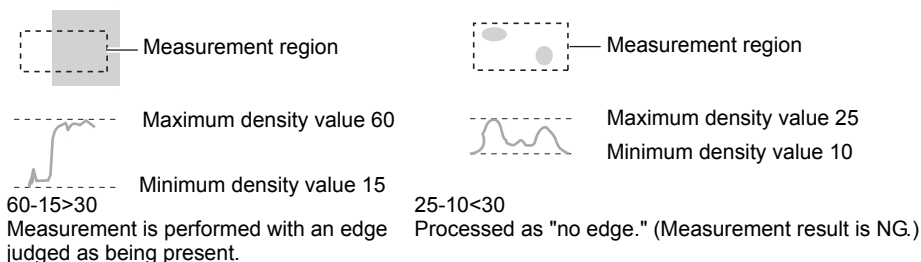


### Noise width

When the density distribution reaches or falls below the edge level again within the range of the noise width from the initial edge detection position, the detected point is regarded as noise. Normally, this setting may be left at its default value of 0. However, set a higher value when noise causes an edge to be detected by mistake.

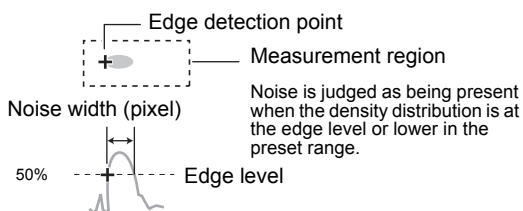

**Note****Coordinates mode**

Sets correction of the output coordinate system at output of the position information to ON/OFF.

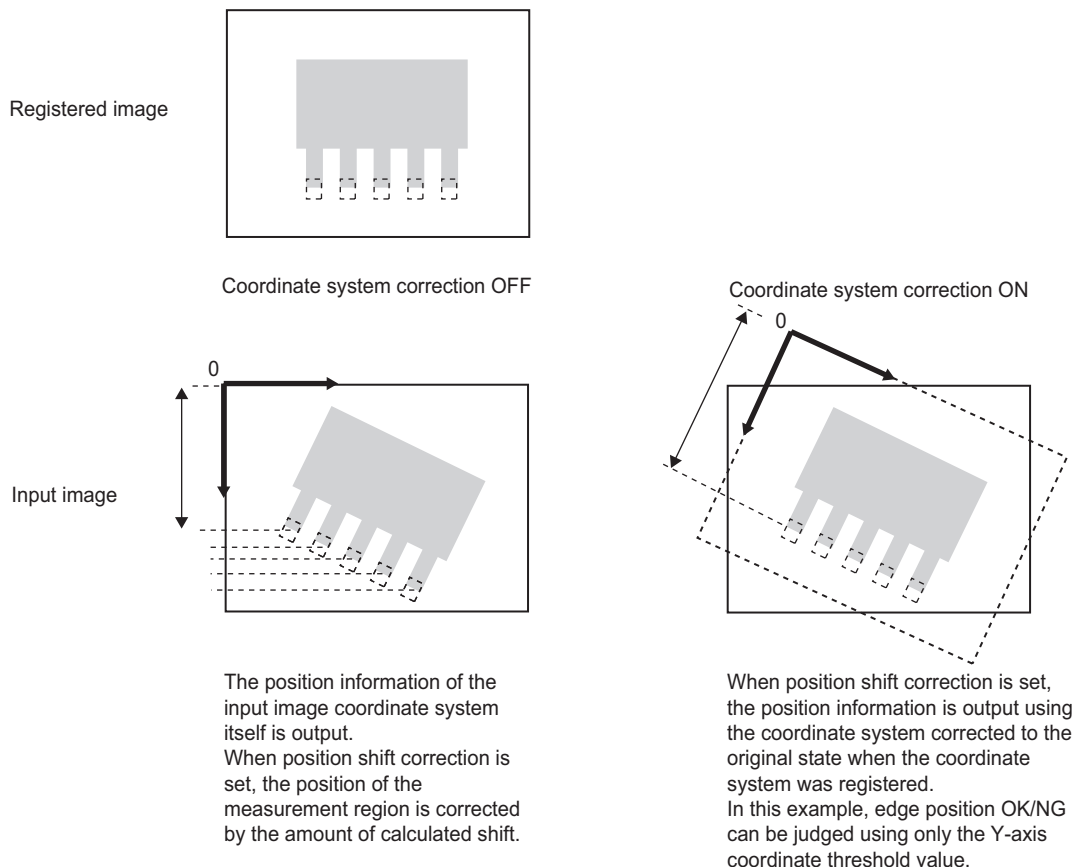**Possible output results**

The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0:OK, -1:NG, -2: not measured)	Judge (JG)
Edge position	The X, Y coordinates of the edge position are output. (-9999.999 to 9999.999)	Position X, Y (X, Y)
Reference position	The X, Y coordinates of the edge position when the measurement region is set are output. (-9999.999 to 9999.999)	Reference X, Y (SX, SY)
Position difference	The difference obtained by "measurement position - reference position" is output. (-9999.999 to 9999.999)	Position dif. X, Y (DX, DY)




For details on reference position, position difference p.50

## Width

This item uses the changes in brightness in a region to detect edge(s). Two edges are found in a single measurement region, and the distance between these edges is output as a dimension.


### Setup

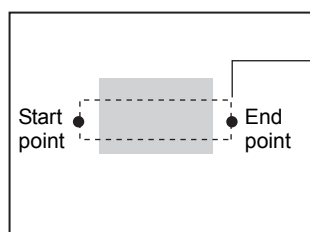

### Measurement

Two edges are searched in the region.


Edge 1 is searched from the start point towards the end point. Edge 2 is searched from the end point towards the start point.

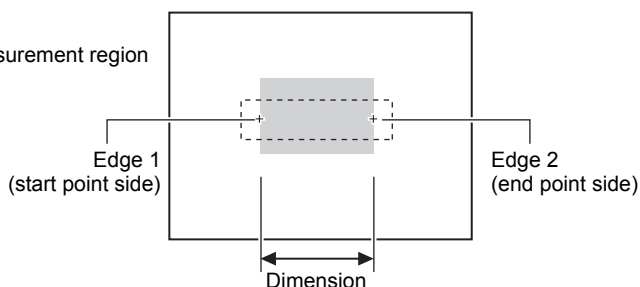

## Region settings

This function sets the measurement region.

### ► MENU mode - [Setup] - [Item] - [Region]

Item	Description
Measurement region	This function sets the region to be measured.  Setting the Region p.215
Reference registration	When the measurement region is set, measurement is executed on the display image, and the result of execution is registered as the reference value. To re-register only reference values, you can use this function to re-register only reference values based on the image currently on screen.

## Threshold

This function sets the judgment conditions.

### ► MENU mode - [Setup] - [Item] - [Limits]


Setup Item	Description
Width	Sets the range of the edge width to be judged as OK. Range: 0 to 9999.999 (When calibration is OFF, the range becomes 0 to 800.)
Position X1, Y1 Position X2, Y2	Sets the range of movement in the X- and Y- axes to be judged as OK. Range: -9999.999 to 9999.999 (When calibration is OFF, the range of movement for positions X and Y are 0 to 640 and 0 to 480, respectively.)



## Image adjustment (if necessary)

The following items can be changed and set to the image of the measurement target.

### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select camera	 For details, see "Image Adjustment". p.101 Selects which of Color filter or Color Pickup is to be used at [Detail] - [Color mode]. The default is use of Color filter.
Color filter	
Color Pickup/Binary	
Filtering	
BGS level	

## Detailed settings (if necessary)

When measurement is not stable, adjust the detailed conditions. By the automatic setting, the edge search color is automatically set.

### ► MENU mode - [Setup] - [Item] - [Detail]

Setup Item	Setting value	Description
Measurement mode	Average (default value)	Sets the method for calculating the edge width.
	Maximum	
	Minimum	
Color mode	Filter mode (default value)	Color filter processing improves the contrast of images so that edges are detected.
	Pickup mode	Specify the color to measure to find the edge of that color.
Split size	1 to 99 (default value: 1)	Sets the calculation width when the Maximum/Minimum widths are to be calculated. The Maximum or Minimum is calculated after the measurement region is split up by the calculation width to find the edge(s).
Color 1/2	Light → Dark (default value)	Selects the density change direction of the edge(s) to be detected.
	Dark → Light	
Edge level 1/2	1 to 99 (default value: 50)	Sets the level of density change to be judged as an edge.
Noise level 1/2	0 to 255 (default value: 20)	Sets the level to be judged as noise. When the difference between the minimum and maximum density values in the density region is at the noise level or lower, it is judged that there are no edges. Set a higher value when noise causes an edge to be detected by mistake.
Noise width 1/2	0 to 255 (default value: 0)	Sets the width to be judged as noise. Set a higher value when noise causes an edge to be detected by mistake.
Calibration	OFF (default value)	Measurement results are output using the camera's coordinate values.
	ON	Measurement results are output using the coordinate value converted by the calibration function.


Setup Item	Setting value	Description
Coordinates mode	Normal (default value)	The position information of the input image coordinate system itself is output.
	Pos. correction	When position shift correction is set, the position information is output using the coordinate system corrected to the original state when the coordinate system was registered.

- Split size, Edge level, Noise level, Noise width p.76  
• Coordinates mode p.77

#### Note

#### Measurement mode

When Maximum and Minimum are selected, the measurement region is split up into small regions by Split size to calculate the edge width. The maximum value or the minimum value is output. When Average is selected, the average of the entire measurement region is calculated.

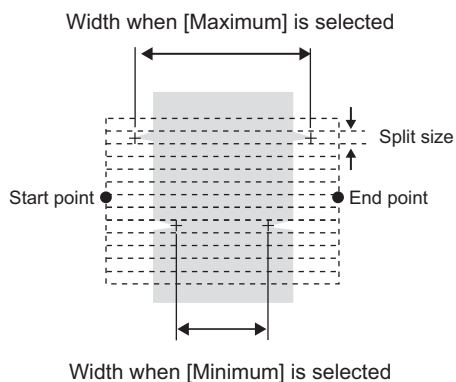

## Possible output results

The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0:OK, -1:NG, -2: not measured)	Judge (JG)
Edge width	The measured edge width is output. (0 to 9999.999)	Width (WD)
Edge position 1/2	<p>The X, Y coordinates of the edge position are output. (-9999.999 to 9999.999)</p> <p><b>Important</b></p> <p>The start point side of the region becomes Position X1/Y1, and the end point side becomes Position X2/Y2.</p>	<p>Position</p> <p>X1, Y1, X2, Y2 (X1, Y1, X2, Y2)</p>
Reference edge width	The edge width when the measurement region is set is output. (0 to 9999.999)	Reference width (SW)
Reference edge position 1/2	The X, Y coordinates of the edge position when the measurement region is set are output. (-9999.999 to 9999.999)	<p>Reference</p> <p>X1, Y1, X2, Y2 (SX1, SY1, SX2, SY2)</p>
Width difference	The width difference obtained by "measurement value - reference value" is output. (-9999.999 to 9999.999)	Width dif. (DW)
Position difference 1/2	The difference obtained by "measurement position - reference position" is output. (-9999.999 to 9999.999)	<p>Position dif.</p> <p>X1, Y1, X2, Y2 (DX1, DY1, DX2, DY2)</p>




Position Difference p.50


## Count

This item uses the changes in brightness in a region to detect edge(s). This item finds the edges of a specified color (dark/light) in a single measurement region, and outputs the number, width and pitch of the edges.

### Setup

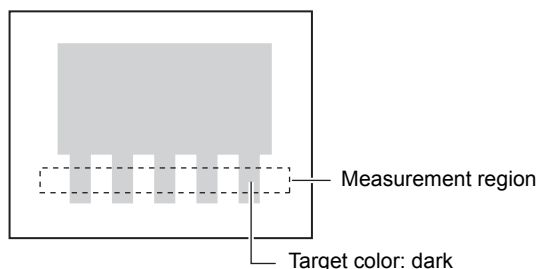


### Measurement

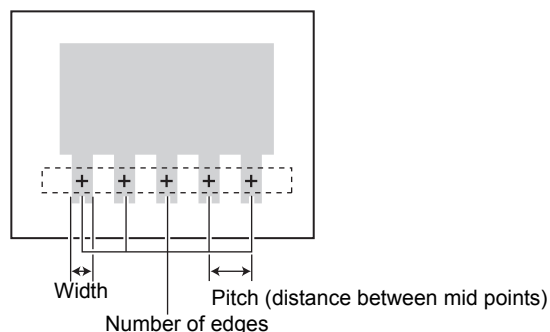

## Region settings

This function sets the measurement region.

### ► MENU mode - [Setup] - [Item] - [Region]

Item	Description
Measurement region	This function sets the region to be measured.  Setting the Region p.215
Reference registration	When the measurement region is set, measurement is executed on the display image, and the result of execution is registered as the reference value. To re-register only reference values, you can use this function to re-register only reference values based on the image currently on screen.

## Threshold

This function sets the judgment conditions.


### ► MENU mode - [Setup] - [Item] - [Limits]

Setup Item	Description
Number of edges	Sets the range of the number of edges to be judged as OK. Range: 0 to 255
Average pitch	Sets the range of the edge pitch to be judged as OK. Range: 0 to 9999.999 (When calibration is OFF, the range becomes 0 to 640.)
Average width	Sets the range of the edge width to be judged as OK. Range: 0 to 9999.999 (When calibration is OFF, the range becomes 0 to 640.)

## Image adjustment (if necessary)

The following items can be changed and set to the image of the measurement target.

### ► MENU mode - [Setup] - [Item] - [Img Adj]


Item	Description
Select camera	 For details, see "Image Adjustment". p.101 Selects which of Color filter or Color Pickup is to be used at [Detail] - [Color mode]. The default is use of Color filter.
Color filter	
Color Pickup/Binary	
Filtering	
BGS level	

## Detailed settings (if necessary)


When measurement is not stable, adjust the detailed conditions.

### ► MENU mode - [Setup] - [Item] - [Detail]

Setup Item	Setting value	Description
Measurement mode	Normal (default value)	Selects this item in the case of measurement targets whose pin width and pitch are at least two pixels.
	Fine	Selects this item to stably measure widths narrower than normal and the number of gaps.
Color mode	Filter mode (default value)	Color filter processing improves the contrast of images so that edges are detected.
	Pickup mode	Specify the color to measure to find the edge of that color.
Target color	Light (default value)	Selects the target color to be counted as the number of edges. When a color camera is in use, the picked-up color is targeted for counting when this setting is set to [Light].
	Dark	
Edge level	1 to 99 (default value: 50)	Sets the level of density change to be judged as an edge.
Noise level	0 to 255 (default value: 20)	Sets the level to be judged as noise. When the difference between the minimum and maximum density values in the density region is at the noise level or lower, it is judged that there are no edges. Set a higher value when noise causes an edge to be detected by mistake.
Noise width	0 to 255 (default value: 0)	Sets the width to be judged as noise. Set a higher value when noise causes an edge to be detected by mistake.
Calibration	OFF (default value)	Measurement results are output using the camera's coordinate values.
	ON	Measurement results are output using the coordinate value converted by the calibration function.

 Noise level, Noise width p.76

## Note

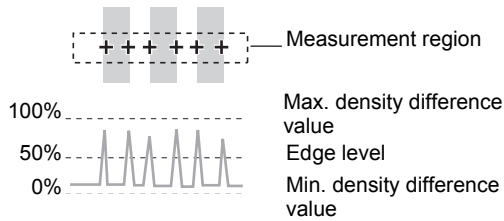

### Edge level

With the count function, the edge is detected by derivative distribution.

1. The amount of change in directions light→dark and dark→light is calculated.

2. The place where the amount of change exceeds the edge level is detected as the edge.

## Possible output results


The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0:OK, -1:NG, -2: not measured)	Judge (JG)
Number of edges	The number of detected edges is output. (0 to 255)	Number of edges (N)
Average pitch	The average detected pitch is output. (0 to 9999.999)	Average pitch (P)
Minimum pitch	The minimum detected pitch is output. (0 to 9999.999)	Min. pitch (PL)
Maximum pitch	The maximum detected pitch is output. (0 to 9999.999)	Max. pitch (PH)
Average width	The average detected edge width is output. (0 to 9999.999)	Average width (W)
Minimum width	The minimum detected edge width is output. (0 to 9999.999)	Min. width (WL)
Maximum width	The maximum detected edge width is output. (0 to 9999.999)	Max. width (WH)

## Angle

This item uses the changes in brightness in a region to detect edge(s). This item finds the edges of a specified color (black/white) in two measurement regions, and outputs the angle between 2 points.


### Setup

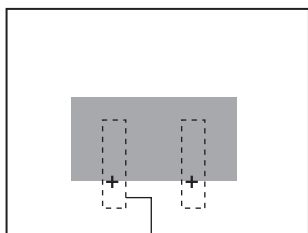

Measurement region  
Change in color: light → dark

### Measurement


The edge is searched in the region according the preset direction and change in color. The inclination of the straight line made by joining 2 points is calculated.

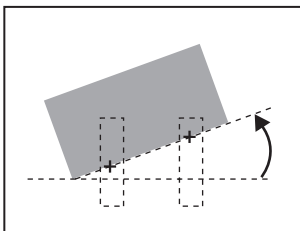


## Region settings

This function sets the measurement region.

### ► MENU mode - [Setup] - [Item] - [Region]


Item	Description
Measurement region	<p>This function sets the region to be measured. With edge angle, set 2 measurement regions since 2 edges are calculated.</p> <p> Setting the Region p.215</p>
Reference registration	<p>When the measurement region is set, measurement is executed on the display image, and the result of execution is registered as the reference value. To re-register only reference values, you can use this function to re-register only reference values based on the image currently on screen.</p>

 Edge search direction p.73

## Threshold

This function sets the judgment conditions.


### ► MENU mode - [Setup] - [Item] - [Limits]

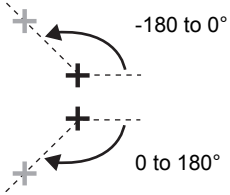Setup Item	Description
Angle	<p>Sets the angle range of the measurement target to be judged as OK.            Range: -180.00 to 180.00            The angle calculated by edge angle is calculated as follows according to the positional relationship between the 2 edge positions.</p> <p>⊕ : Edge position 1    ⊕ : Edge position 2</p> 
Position 1XY	<p>Sets the range of movement in the X- and Y- axes of measurement region 1 of the measurement target to be judged as OK.            Range: -9999.999 to 9999.999            (When calibration is OFF, the range of movement for positions X and Y are 0 to 640 and 0 to 480, respectively.)</p>
Position 2XY	<p>Sets the range of movement in the X- and Y- axes of measurement region 2 of the measurement target to be judged as OK.            Range: -9999.999 to 9999.999            (When calibration is OFF, the range of movement for positions X and Y are 0 to 640 and 0 to 480, respectively.)</p>

## Image adjustment (if necessary)

The following items can be changed and set to the image of the measurement target.

### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select Camera	 For details, see "Image Adjustment." p.101
Color filter	
Color Pickup/Binary	
Filtering	
BGS level	



## Detailed settings (if necessary)

When measurement is not stable, adjust the detailed conditions. By the automatic setting, the edge search color is automatically set.

### ► MENU mode - [Setup] - [Item] - [Detail]

Setup Item	Setting value	Description
Color mode	Color filter (default value)	Color filter processing improves the contrast of images so that edges are detected.
	Color pickup	Specify the color to be measured to find the edge of that color.
Measurement mode 1/2	Average (default value)	Sets the edge position calculation method.
	Peak	
	Bottom	
Split size 1/2	1 to 99 (default value: 1)	Sets the calculation width when the peak/bottom positions are to be calculated. The peak or bottom is calculated after the measurement region is split up by the calculation width to find the edge(s).
Color 1/2	Light → Dark (default value)	Selects the density change direction of the edge(s) to be detected.
	Dark → Light	
Edge level 1/2	1 to 99 (default value: 50)	Sets the level of density change to be judged as an edge.
Noise level 1/2	0 to 255 (default value: 20)	Sets the level to be judged as noise. When the difference between the minimum and maximum density values in the density region is at the noise level or lower, it is judged that there are no edges. Set a higher value when noise causes an edge to be detected by mistake.
Noise width 1/2	0 to 255 (default value: 0)	Sets the width to be judged as noise. Set a higher value when noise causes an edge to be detected by mistake.
Calibration	OFF (default value)	Measurement results are output using the camera's coordinate values.
	ON	Measurement results are output using the coordinate value converted by the calibration function.
Coordinates mode	Normal (default value)	The position information of the input image coordinate system itself is output.
	Pos. correction	When position shift correction is set, the position information is output using the coordinate system corrected to the original state when the coordinate system was registered.



- Measurement mode, Split size, Edge level, Noise level, Noise width p.76
- Coordinates mode p.77

## Possible output results

The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0: OK, -1: NG, -2: not measured)	Judge (JG)
Edge angle	The measured angle is output. (-180 to 180)	Angle (TH)
Edge position	The X, Y coordinates of the edge position are output. (-9999.999 to 9999.999)	Position X, Y (X, Y)
Reference angle	The angle when the measurement region is set is output. (-180 to 180)	Ref. angle (ST)
Reference position	The X, Y coordinates of the edge position when the measurement region is set are output. (-9999.999 to 9999.999)	Reference X, Y (SX, SY)
Angle difference	The difference obtained by "measurement angle - reference angle " is output. (-360 to 360)	Angle dif. (DT)
Position difference	The difference obtained by "measurement position - reference position" is output. (-9999.999 to 9999.999)	Position dif. X, Y (DX, DY)




For details on reference position, position difference p.50

# Bright/Color Inspection

## Bright


Use this item to measure the brightness of measurement targets. The density average and density deviation (brightness fluctuations) are output. Change in brightness can be used to inspect whether or not parts are present.

Setup

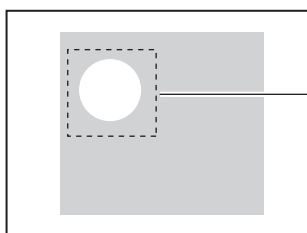

Measurement region

Measurement

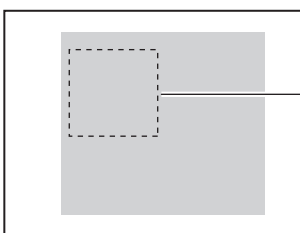


Density average,  
density deviation

## Region settings

This function sets the measurement region.

### ► MENU mode - [Setup] - [Item] - [Region]

Setup Item	Description
Measurement region	This function sets the region to be measured.  Setting the Region p.215
Reference registration	When the measurement region is set, measurement is executed on the display image, and the result of execution is registered as the reference value. To re-register only reference values, you can use this function to re-register only reference values based on the image currently on screen.

## Threshold

This function sets the judgment conditions.


### ► MENU mode - [Setup] - [Item] - [Limits]

Setup Item	Description
Density average	Sets the range of the density average to be judged as OK. Range: 0 to 255.0
Density deviation	Sets the range of the density deviation to be judged as OK. Range: 0 to 127.0

## Image adjustment (if necessary)

The following items can be changed and set to the image of the measurement target.

### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select camera	 For details, see "Image Adjustment". p.101
Color filter	
Filtering	
BGS level	

## Possible output results

The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0:OK, -1:NG, -2: not measured)	Judge (JG)
Density average	The average of the density inside the measurement region is output. (0 to 255.0)	Density average (AV)
Density deviation	The brightness fluctuations in the measurement region are output. (0 to 127.0)	Density deviation (DV)
Reference density average	The density average when the measurement region is set is output. (0 to 255.0)	Ref. average (SA)
Reference density deviation	The density deviation when the measurement region is set is output. (0 to 127.0)	Ref. deviation (SD)
Density average difference	The difference obtained by "measurement value - reference value" is output. (0 to 255.0)	Average dif. (DA)
Density deviation difference	The difference obtained by "measurement value - reference value" is output. (0 to 127.0)	Deviation dif. (DD)


## HUE

Use this item to measure the color of measurement targets. This item can be used to measure whether or not different-colored products are mixed in, for example. Average hue, saturation and brightness value, and respective deviations (fluctuations) can be output.

### Important


This function cannot be used when a monochrome camera is connected.

Setup

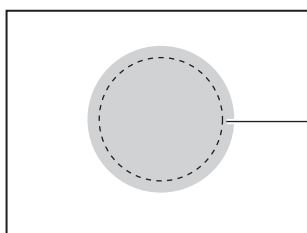

Measurement region

Measurement

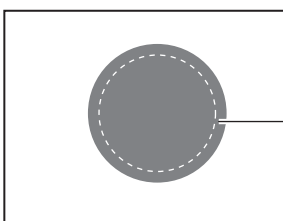


Hue, saturation,  
brightness value

## Region settings

This function sets the measurement region.

### ► MENU mode - [Setup] - [Item] - [Region]

Setup Item	Description
Measurement region	<p>This function sets the region to be measured.</p> <p> Setting the Region p.215</p>
Reference registration	<p>When the measurement region is set, measurement is executed on the display image, and the result of execution is registered as the reference value. To re-register only reference values, you can use this function to re-register only reference values based on the image currently on screen.</p>

## Threshold

This function sets the judgment conditions.

### Note

- The color can be distinguished more precisely as threshold values can be set to each of hue, saturation and value. Alternatively, if you set wide allowable saturation and value ranges, color can be distinguished more stably by hue without being influenced by fluctuating lighting conditions.

### ► MENU mode - [Setup] - [Item] - [Limits]

Setup Item	Description
Hue average	Sets the range of hues to be judged as OK. Range: 0 to 360.0
Saturation average	Sets the range of saturations to be judged as OK. Range: 0 to 100.0
Value average	Sets the range of values to be judged as OK. Range: 0 to 100.0
Hue deviation	Sets the range of hue fluctuation to be judged as OK. Range: 0 to 180.0
Saturation deviation	Sets the range of saturation fluctuation to be judged as OK. Range: 0 to 50.0
Value deviation	Sets the range of value fluctuation to be judged as OK. Range: 0 to 50.0

## Image adjustment (if necessary)

The following items can be changed and set to the image of the measurement target.

### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select camera	Selects the camera to be used by this item.

## Detailed settings (if necessary)

When measurement is not stable, adjust the detailed conditions.

### ► MENU mode - [Setup] - [Item] - [Detail]

Setup Item	Setting value	Description
Deviation	OFF	Selects whether or not the deviation values of hue, saturation and value are to be calculated.
	ON (default value)	

## Possible output results

The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0:OK, -1:NG, -2: not measured)	Judge (JG)
Hue	The hue average is output. (0 to 360.0)	H average (H)
Saturation	The saturation average is output. (0 to 100.0)	S average (S)
Value	The value average is output. (0 to 100.0)	V average (V)
Hue deviation	The hue fluctuation is output. (0 to 180.0)	H deviation (HD)
Saturation deviation	The saturation fluctuation is output. (0 to 50.0)	S deviation (SD)
Value deviation	The value fluctuation is output. (0 to 50.0)	V deviation (VD)
Reference hue	The hue when the measurement region is set is output. (0 to 360.0)	Ref. H average (SH)
Reference saturation	The saturation when the measurement region is set is output. (0 to 100.0)	Ref. S average (SS)
Reference value	The value when the measurement region is set is output. (0 to 100.0)	Ref. V average (SV)
Hue difference	The hue difference obtained by "measurement value - reference value" is output. (-360.0 to 360.0)	H average dif. (DH)
Saturation difference	The saturation difference obtained by "measurement value - reference value" is output. (-100.0 to 100.0)	S average dif. (DS)
Value difference	The value difference obtained by "measurement value - reference value" is output. (-100.0 to 100.0)	V average dif. (DV)
Reference hue deviation	The hue fluctuation when the measurement region is set is output. (0 to 180.0)	Ref. H deviation (SHD)
Reference saturation deviation	The saturation fluctuation when the measurement region is set is output. (0 to 50.0)	Ref. S deviation (SSD)
Reference value deviation	The value fluctuation when the measurement region is set is output. (0 to 50.0)	Ref. V deviation (SVD)
Hue deviation difference	The hue deviation difference obtained by "measurement value - reference value" is output. (-180.0 to 180.0)	H deviation dif. (DH)
Saturation deviation difference	The saturation deviation difference obtained by "measurement value - reference value" is output. (-50.0 to 50.0)	S deviation dif. (DSD)
Value deviation difference	The value deviation difference obtained by "measurement value - reference value" is output. (-50.0 to 50.0)	V deviation dif. (DVD)
Hue maximum/minimum	The hue maximum/minimum values are output. (0 to 360.0)	Max. H/Min. H (HH, LH)
Saturation maximum/minimum	The saturation maximum/minimum values are output. (0 to 100.0)	Max. S/Min. S (HS, LS)
Value maximum/minimum	The value maximum/minimum values are output. (0 to 100.0)	Max. V/Min. V (HV, LV)



Nos. indicating hue, saturation and value p.230


# Inspection by Individual Application

## Grouping

Use this item to group products, for example, on lines where many types of products are conveyed. Register the image pattern to be used as the reference for grouping products as a model beforehand. Up to 64 models can be registered. The No. of the model that resembles the input image the most, the correlation indicating how much parts resemble each other and the position of the measurement object can be output.

**Note**


This item is not provided for the ZFX-C10/C15.

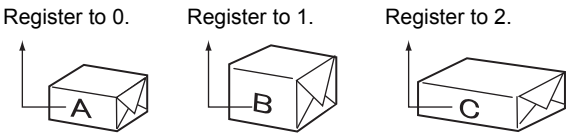

**Setup**


Index (0 to 63)	Model (register up to 4)
0	A A A A
1	B B B B
2	C C
⋮	
63	Q Q

**Measurement**  
The index No. of the most similar model is output.

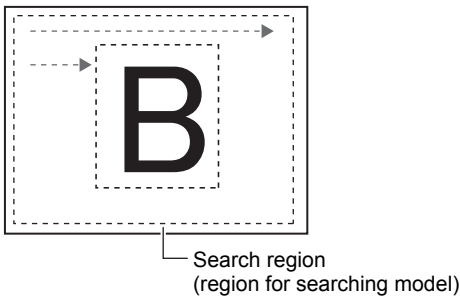

**Note**

- With the grouping function, registration of models is not executed even if automatic setting is performed. When a color camera is connected, only automatic setting of color filters is performed.
- Functions equivalent to grouping can also be achieved by the "IMAX" and "IMIN" functions in expressions.

 Calculation p.117

Example: Measure the area of desired colors.

- Area 0 ... Calculate the area of the color red.
- Area 1 ... Calculate the area of the color yellow.
- Area 2 ... Calculate the area of the color blue.


Set the measurement results of the areas to the expression.  
Index Nos. having the largest values can be obtained, enabling grouping by color.  
IMAX (area 0 area value, area 1 area value, area 2 area value)



## Region settings

This function sets the region to be registered as the model and the region to search for the model.

### ► MENU mode - [Setup] - [Item] - [Region]

Item	Description
Register model	This function registers the image pattern to find as the model.  Setting the Region p.215
Reference model	The image that is registered as the model can be referenced.
Search region	Set the region in which to search for the model.

## Threshold

This function sets the judgment conditions.


### ► MENU mode - [Setup] - [Item] - [Limits]

Setup Item	Description
Correlation	Sets the range of the correlation to be judged as OK. Range: 0 to 100
Position XY	Sets the range of movement in the X- and Y- axes of the measurement target to be judged as OK. Range: -9999.999 to 9999.999 (When calibration is OFF, the range of movement for positions X and Y are 0 to 640 and 0 to 480, respectively.)
Index No.	Sets the range of index Nos. to be judged as OK. Range: 0 to 63

## Image adjustment (if necessary)

The following items can be changed and set to the image of the measurement target.

### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select camera	 For details, see "Image Adjustment". p.101
Color filter	
Filtering	
BGS level	

## Detailed settings (if necessary)

When measurement is not stable, adjust the detailed conditions.

### ► MENU mode - [Setup] - [Item] - [Detail]

Setup Item	Setting value	Description
Search mode	Hi-speed	The search is performed at high speed.
	Normal (default value)	The search is performed in the normal mode for both speed and precision.
	Precision	The position is calculated at high precision in sub-pixel units (units smaller than pixels).
Verification	OFF (default value)	The search is performed in detail near a candidate point having the highest correlation value.
	ON	The search is performed in detail near all candidate points. Select [ON] when the model cannot be searched for stably.
Candidate level	0 to 100 (default value: 60)	Sets the level at which the model is searched for during a rough search. Images having a correlation value at the candidate level or more are taken to the candidate points in the Verification. Set a lower level when the model cannot be searched for stably.
Calibration	OFF (default value)	Measurement results are output using the camera's coordinate values.
	ON	Measurement results are output using the coordinate value converted by the calibration function.
Coordinates mode	Normal (default value)	The position information of the input image coordinate system itself is output.
	Pos. correction	When position shift correction is set, the position information is output using the coordinate system corrected to the original state when the coordinate system was registered.



- Verification and Candidate level p.49
- Setting the Candidate level p.49
- Coordinates mode p.77

## Possible output results


The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0:OK, -1:NG, -2: not measured)	Judge (JG)
Correlation	The degree of match between the measurement image and model image are output as a correlation value. (0 to 100)	Correlation (CR)
Measurement position	The X, Y coordinates of the position where the model was found are output. (-9999.999 to 9999.999)	Position X, Y (X, Y)
Index No.	Outputs the No. of the model having the highest correlation. (0 to 63)	Index No. (IN)

## Defect

Use this item to detect dirt, scratching, chipping, burrs, and other defects on plain measurement targets. The extent of the defects at locations having the highest number of defects and their positions are output. The number of locations where the extent of defects equals or exceeds the noise level also are output.


### Setup

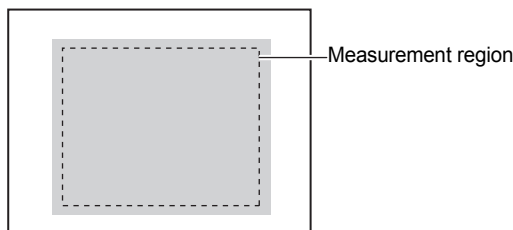

Measurement region

### Measurement


The measurement region is automatically subdivided into smaller sections to detect for changes in their respective brightness (density). The density difference with the surrounding area is collected, parts having a large difference are judged to be a defect, and the position information and extent of the defects of the locations having the highest number of defects are output.

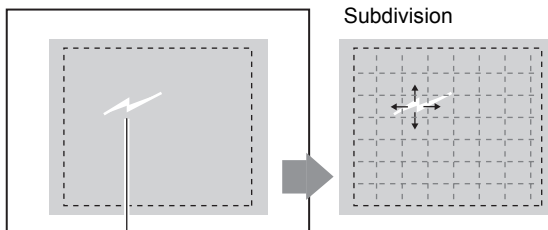

Subdivision

Scratch

Chipping and burrs on the outer periphery also can be detected.

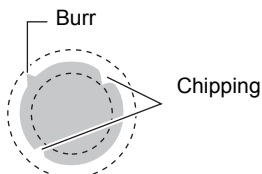


Burr

Chipping

### Note

### Number of Defects

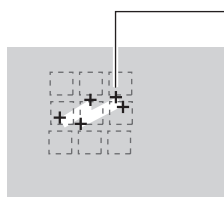
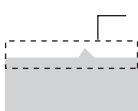

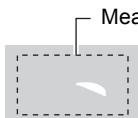


The extent of the defects is calculated in subdivided regions, and regions at or exceeding the defect threshold are output as the number of defects.

## Region settings

Set the measurement region.

### ► MENU mode - [Setup] - [Item] - [Region]

Item	Description
Measurement Region	<p>This function sets the region to be measured.</p> <p> Setting the Region p.215</p> <p>Inspection is classified into the following four inspections for each region setup.</p> <ul style="list-style-type: none"> <li>• Line Select this item to inspect measurement targets for chipping, burrs and other defects. The shape that can be drawn is one straight line.</li> </ul> <p> Measurement Region</p> <ul style="list-style-type: none"> <li>• Circum/Arc Select this item to inspect round measurement targets for chipping, burrs and other defects. The shape that can be drawn is one circumference or arc.</li> </ul> <p> Measurement region</p> <ul style="list-style-type: none"> <li>• Area Select this item to inspect the entire measurement target for scratches and dirt. A combination of up to five shapes (rectangles, ellipses, circles, polygons).</li> </ul> <p> Measurement region</p>
Reference registration	<p>When the measurement region is set, measurement is executed on the display image, and the result of execution is registered as the reference value. To re-register only reference values, you can use this function to re-register only reference values based on the image currently on screen.</p>

## Threshold

This function sets the judgment conditions.


### ► MENU mode - [Setup] - [Item] - [Limits]

Setup Item	Description
Defect	Sets the defect judgment value to be judged as OK. Range: 0 to 255
Density	Sets the density range to be judged as OK. Range: 0 to 255
Number of defects	Sets the range of number of defects to be judged as OK. Range: 0 to 255

## Image adjustment (if necessary)

The following items can be changed and set to the image of the measurement target.


### ► MENU mode - [Setup] - [Item] - [Img Adj]

Item	Description
Select camera	 For details, see "Image Adjustment". p.101
Color filter	
Filtering	
BGS level	

## Detailed settings (if necessary)

When measurement is not stable, adjust the detailed conditions.

### ► MENU mode - [Setup] - [Item] - [Detail]

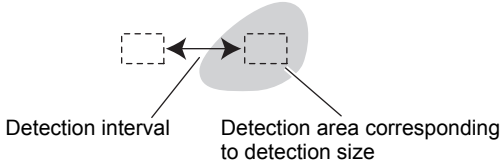Setup Item	Setting value	Description
Detection size	4 to 64 (default value: 8)	Creates a small detection area corresponding to the detection size inside the measurement region.
Detection interval	4 to 64 (default value: 8)	<p>The average density is calculated for each detection area. The average density of the detection area is then compared with the surrounding average density, and the defect position is detected by how much the average density differs with the surrounding area. The difference with the average density that was the largest is output as the defect value.</p>  <p>Detection interval      Detection area corresponding to detection size</p>
Noise level	0 to 255 (default value: 60)	Places having a defect value lower than the noise level are removed as the noise component, while places having a defect value higher than the noise level are counted as defect positions.
Calibration	OFF (default value)	Measurement results are output using the camera's coordinate values.
	ON	Measurement results are output using the coordinate value converted by the calibration function.
Coordinates mode	Normal (default value)	The position information of the input image coordinate system itself is output.
	Pos. correction	When position shift correction is set, the position information is output using the coordinate system corrected to the original state when the coordinate system was registered.


 Coordinates mode p.77

**Note** Guidelines for setting detection size and detection interval

• Detection size

Determine the detection size roughly according to the size of the defect to be detected.

Setting a smaller detection size results in stronger detection sensitivity, while setting a larger detection size results in weaker detection sensitivity.

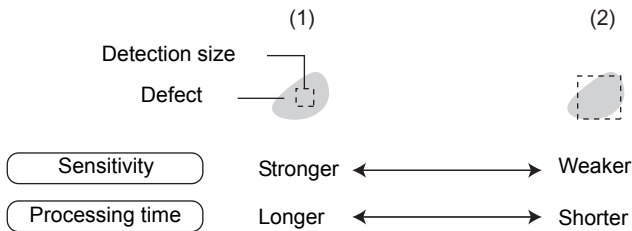

When a larger detection size is set, the difference with elements that are not defects decreases as the density of elements other than defects also is included in the calculation at (2). In other words, the more background that is included in the detection area, the weaker the detection sensitivity becomes.

• Detection interval

Determine the detection interval roughly according to the size of the defect and the detection size.

 
The larger the detection interval that is set, the shorter the processing time becomes.

When the detection area is greater than the defect, set a smaller detection interval.



When the defect is greater than the detection area, set a slightly larger detection interval.

When a small detection interval is set, elements overlapping the edge of the defect also are included in the comparison, and so the defect value decreases, which results in less stable detection of the defect.



## Possible output results

The following values can be output when expressions are set.

Item	Description	Message
Judgment result	The judgment result is output. (0:OK, -1:NG, -2: not measured)	Judge (JG)
Defect	Measured extent of defects is output. (0 to 255)	Defect (F)
Maximum density	The maximum density value inside the measurement region is output. (0 to 255)	Max. density (GH)
Minimum density	The minimum density value inside the measurement region is output. (0 to 255)	Min. density (GL)
Number of defects	The number of defects having an extent of defects at or exceeding the judgment condition is output. (0 to 255)	Number of defects (N)
Defect position	The X, Y coordinates of the defect position are output. (-9999.999 to 9999.999)	Position X, Y (X, Y)
Reference position	The X, Y coordinates of the defect position when the measurement region is drawn are output. (-9999.999 to 9999.999)	Reference X, Y (SX, SY)
Position difference	The difference obtained by "measurement position - reference position" is output. (-9999.999 to 9999.999)	Position dif. X, Y (DX, DY)

For details on reference position, position difference p.50

# Image Adjustment

This section describes the functions for apply filters, etc. to process images captured from the camera so that they can be easier-to-measure. Items that can be set differ according to the measurement item and type of camera. Only available items are displayed.

## Select Camera

Select camera 0 or camera 1 as the camera to be used in this measurement item.

► **MENU mode - [Setup] - [Item] - [Img Adj]-[Select camera]**

## Color Filter

The contrast of images can be improved by passing images through color filters. This function can be set only when a color camera is connected to the Controller. When a color filter setting is changed, a new image processed by the color filter is displayed on the right side of the monitor. Set the color filter while monitoring the image on screen.

### Note AUTO Setting

When AUTO is set for measurement items that support use of color filters, the optimum color filter is automatically set.

 Color Filter p.226

► **MENU mode - [Setup] - [Item] - [Img Adj] - [Select camera] - [Color filter]**

Item	Description
Select filter	The color filter can be selected as desired. (Red, Blue, Green, Yellow, Cyan, Magenta, Gray, Custom) When [Custom filter] is selected, any color in the color bar can be set to the filter.
Auto function	Sets whether or not to perform automatic selection of color filter processing when the automatic setting is executed. On: The current image is analyzed to automatically select the optimum color filter each time that the automatic setting is executed. Off: The currently selected color filter is fixed, and is not cleared and held even if the automatic setting is executed.

## Color Pickup/Binary

This function picks up the color to be measured.

### When a color camera is connected to the Controller

#### ► MENU mode - [Setup] - [Item] - [Img Adj] - [Select camera] - [Color Pickup]

Item	Description
Region	When an area containing a color to be measured is specified, and [AUTO] is selected, up to four colors are automatically picked up in order of the color having the largest area.
Pickup Color	If the appropriate image is not obtained by automatic color pick up, the three parameters hue, saturation and brightness can be fine-adjusted for each candidate color. When [Auto function] is set to [OFF], the color pick up is not updated when the automatic setting is next executed. To exclude a specific color from the measurement target, set [Enable/Disable] to [Disable].



Color Pickup, p.228

### When a monochrome camera is connected to the Controller

#### ► MENU mode - [Setup] - [Item] - [Img Adj] - [Select camera] - [Binary]

Item	Description
Binary level	Sets the level for converting contone images made up of 256 tones captured from a camera to binarized images. As white pixels are targeted in measurement, the binary level is adjusted so that the measurement target is transformed into white pixels.
Reverse	Reverses the black and white of binary images. After the image is inverted, the area converted to white pixels is the measurement target.



## Pre-processing

This function processes images captured from the camera so that they can be easier-to-measure. Eight filtering options are available so that you can set filtering different for each of position correction and actual measurement.

When you move the cursor, a filtered image of the image at the cursor position is displayed on the right side of the monitor. Set the filter while monitoring the image on screen.

### ► MENU mode - [Setup] - [Item] - [Img Adj] - [Select camera] - [Filtering]

Filtering	Target Image	Description of Filtering
OFF (default value)	-	-
Smooth	Measurement targets containing slightly unevenness	Creates a cloudy effect to soften the unevenness.
Erosion	Black measurement targets containing white noise	Reduces the white component to eliminate the noise.
Dilation	White measurement targets containing black noise	Spreads the white component to eliminate the black noise.
Median	Measurement targets containing slightly unevenness	Softens the unevenness while keeping the image contour intact.
Sharpen	Measurement targets containing fuzzy areas (fluctuating lighting, etc.)	Enhances the border lines between light and dark areas in the image.
V Edge	Images that are difficult to pick up due to poor contrast	Picks up the vertical border lines (contrast) in the image.
H Edge	Images that are difficult to pick up due to poor contrast	Picks up the horizontal border lines (contrast) in the image.
All Edge	Images that are difficult to pick up due to poor contrast	Picks up all border lines (contrast) in the image.

#### Note Filter Strength


The filter strength can be selected when applying the filtering options to images. Each selection of the [5x5 filter]/[3x3 filter] in the filtering setup screen toggles the filter strength.

## Background Suppression

This function removes unwanted background from the images to exclude them from the measurement target. Setting the BGS level converts images at the lower limit value or below to density 0 and images at the upper limit or above to density 255 so that only an image of density within the range lower limit value to upper limit value is extended and turned into a measurement target having 0 to 255 tones. When you move the cursor, an image of the image at the cursor position is displayed at the cursor position with unwanted background removed. Set the BGS level while monitoring the image on screen.

Example: Set the lower limit value to 100 and upper limit value to 220

Image before background is removed    Image with background removed

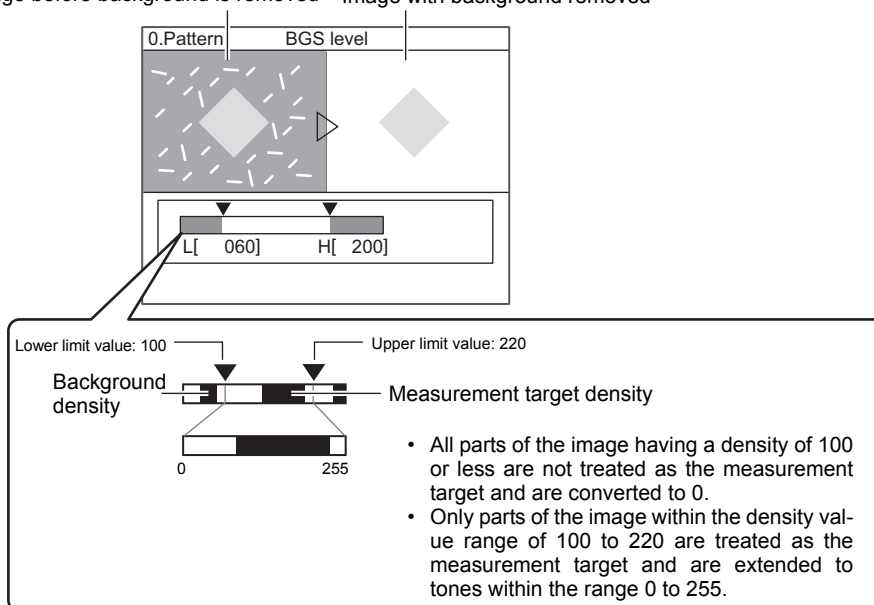

► MENU mode - [Setup] - [Item] - [Img Adj] - [Select camera] - [BGS level]


## Brightness Control

Digitally corrects contrast in the image according to the input image. This setting is effective only when a monochrome camera is connected to the Controller.

Brightness control processing is executed after filtering and BGS level processing.

Brightness control automatically corrects the brightness of the input image to the pre-registered reference value during measurement.

Example: Input value (brightness of the input image): 23, Reference value (registered value of brightness): 92

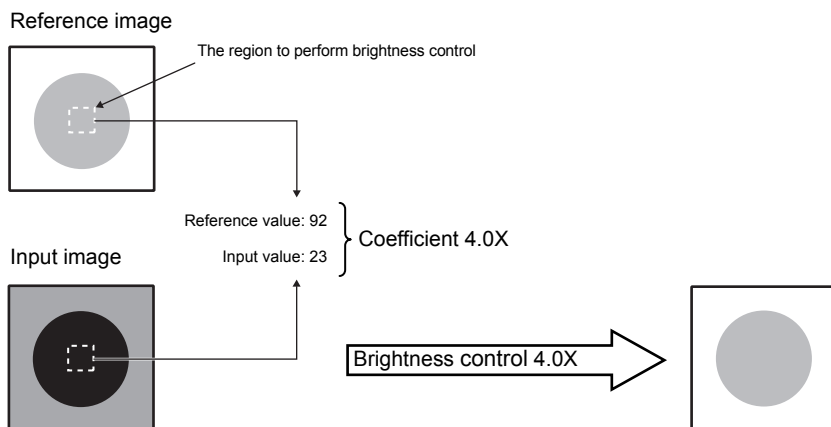

### ► MENU mode - [Setup] - [Item] - [Img Adj] - [Select camera] - [Brightness control]

Item	Description
ON	Performs brightness control.
OFF (default value)	Does not perform brightness control.


Configure the following options when brightness control is set to ON.

Item	Description
Control region	Sets the region in which the reference value is calculated.
Reference registration	When the [AUTO] button is pressed, the current brightness in the control region is registered as the reference value.
AUTO function	When [Auto function] is set to [OFF], the reference value is not updated when the AUTO function is next executed.

#### Note

#### Reference registration

In the [Reference registration] screen, you can adjust the reference value while comparing the images on the left and the right.

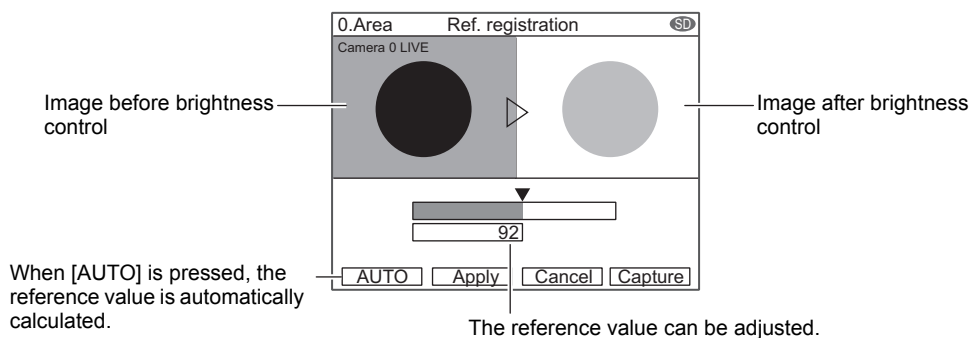

# Cameras/Lighting

Set the camera and lighting operating conditions for capturing images and measuring measurement targets in an optimum state.

## Shutter Speed

Set the shutter speed to match the speed of movement of the measurement target and the lighting environment.

The type of camera that is connected is automatically recognized, and only shutter speeds that can be set are displayed.

 List of Available Functions for Each Camera p.181

### ► MENU mode - [Setup] - [Cameras] - [Camera 0/1] - [Shutter Speed]

Setting value	Description
1/170 to 1/20000 s	Fixes the shutter speed to the desired value. Only available candidate shutter speeds are displayed. The candidates differ with the camera that is connected and setup conditions.

#### **Note** Guidelines for setting shutter speed

Shutter speed characteristics are as follows. Select the appropriate shutter speed to suit your inspection requirements.

Shutter Speed	Speed of Movement of Measurement Target
1/170 s	Slow
•	•
1/20000 s	Fast

## Gain Setting

The sensor's gain (sensitivity) can be adjusted if bright images cannot be obtained just by the Shutter Speed and Light Control settings.

### ► MENU mode - [Setup] - [Cameras] - [Camera 0/1] - [Gain]

Setting value	Description
x 1.0, x 1.5, x 2.0	Sets the gain factor. x 1.0: The gain factor is not changed. (default value) x 1.5: The gain factor is set to 1.5X. x 2.0: The gain factor is set to 2.0X.

#### **Note** Guidelines for setting gain

Increasing the gains results in a brighter image, however, the noise component contained in the image also becomes more conspicuous. Select the appropriate gain factor to suit your inspection requirements.

Gain	Image	Image Quality
x 1.0	Dark	Good (little noise)
•	↑ ↓	↑ ↓
x 2.0	Bright	Coarse (conspicuous noise)

## Partial Function Settings

Set the image capture area. Limiting the image capture area in this way speeds up processing.

The items that can be selected by this function change according to the camera connected to the Controller and shutter speed conditions.

 List of Available Functions for Each Camera p.181

### Important

When the partial function setting is changed, the size of the input image also changes. When the partial function setting has been changed, set the measurement conditions including the model conditions of measurement items and position shift compensation again.

#### ► MENU mode - [Setup] - [Cameras] - [Camera 0/1] - [Partial Function]


Each selection of [Size] switches the image capture area in the following order:



### Note

#### Adjustment of Image Capture Area

When 1/2 display or 1/4 display is displayed, the capture area can be adjusted up and down.

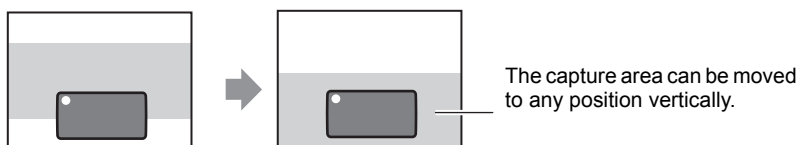

## Image Rate

Set the Image Rate mode for capturing images. Setting a faster image rate increases the processing speed, though precision becomes worse.


The items that can be selected by this function change according to the camera connected to the Controller and shutter speed conditions.

 List of Available Functions for Each Camera p.181

### Important

When the Image Rate mode is changed, the size of the input image also changes. When the partial function setting has been changed, set the measurement conditions including the model conditions of measurement items and position shift compensation again.


#### ► MENU mode - [Setup] - [Cameras] - [Camera 0/1] - [Image Rate]

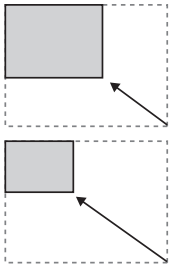Setting value	Description
Fine	The image is captured at normal size. (default value)
Normal, High speed	<p>The image is captured and then compressed.</p> <div style="display: flex; align-items: center;">  <div style="margin-left: 20px;"> <p>Normal: 2 pixels each in the horizontal and vertical directions are compressed to 1 pixel when they are captured.</p> <p>High speed: 4 pixels each in the horizontal and vertical directions are compressed to 1 pixel when they are captured.</p> </div> </div>

# Light Control (Recipe Functions)

This recipe type function enables you to determine the lighting just by selecting the image that meets your specific requirements from the thumbnails of images automatically captured under different illumination patterns. This allows the number of man-hours taken to finalize the lighting conditions to be greatly reduced. The amount of emitted light can also be fine-adjusted after the illumination pattern is selected from the recipe.

This item is displayed only when a camera that supports this function is connected to the Controller.


 List of Available Functions for Each Camera p.181

## Note

When adjusting optional lighting connected to the ZFX-SR\_\_/\_SC\_\_ or adjusting the lighting intensity of the ZFX-SC150, only ON/OFF control is available. The recipe function and intensity cannot be adjusted.

Place the camera with lighting at the specified distance, adjust the focus and perform the following.

### ► MENU mode - [Setup] - [Cameras] - [Camera 0/1] - [Light Control]

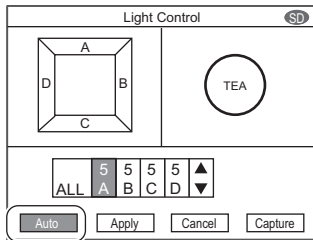


## 1 Select the [AUTO] button.


An image obtained by altering the illumination pattern is captured.

## Note

The amount of emitted light of each block (A onwards) is adjusted as the illumination pattern. The shutter speed is not changed.

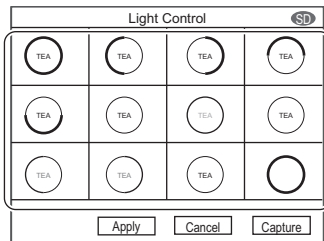

## 2 Select the image that meets your specific requirements from the thumbnails displayed on screen.

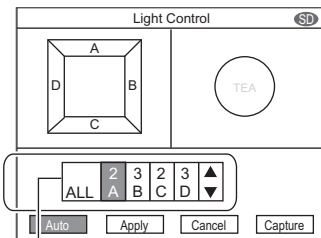


Amount of emitted light

## 3 The lighting conditions of the selected image are displayed. Fine-adjust these conditions as required.

## Note

### How blocks are displayed

Example: When the ZFX-SR\_\_/\_SC\_\_ is connected

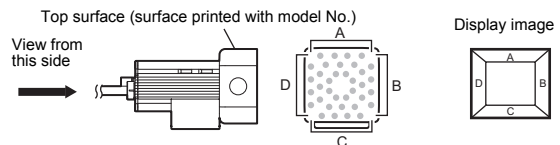

- The number of division blocks differs according to the camera.
- The larger the number for the amount of emitted light, the brighter the image becomes. 0 indicates that illumination is off.


# Calibration

This function converts measurement values from pixels to actual dimensions for output. By setting the relationship between camera coordinates and actual coordinates, measurement results expressed in pixels can be converted to actual dimensions and output.


## Note

To enable the calibration function, set [Calibration] in the Detail setup screen for each measurement item to [ON]. When [Calibration] is still [OFF] (default value), measurement values are output using camera coordinates and not the actual dimensions.

Pixel units can be converted to actual dimensions and output.

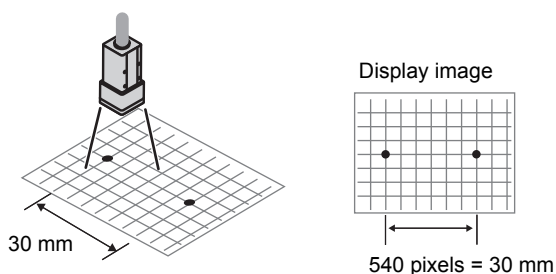


Both the origin and the coordinate system can be corrected.

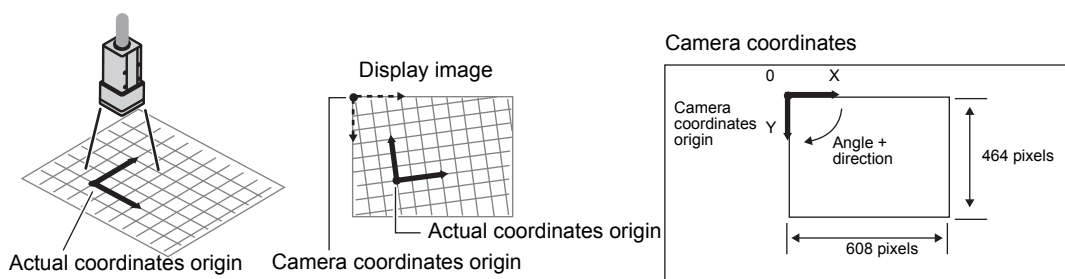

Three calibration setup options are available: "Sampling input", "Specifying point" and "Parameter Input".

## Setting Calibration by Sampling Input

With this method, calibration is set based on the measurement results. First, a pre-registered model is measured to find its position (in sub-pixel units). When the actual coordinates of the position that was found is input, the calibration data is automatically calculated.

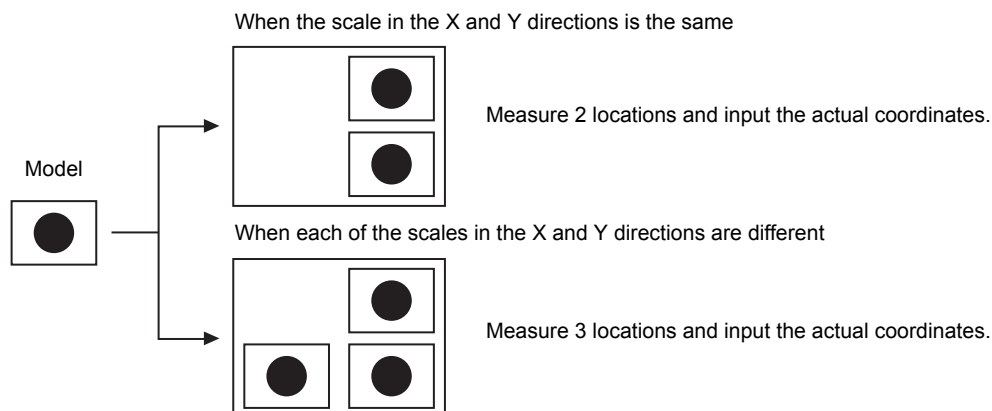


## Setup method

### Image adjustment

The image adjustment function can be set for calibration measurement.

#### ► MENU mode - [Setup] - [Cameras] - [Camera 0/1] - [Calibration] - [Sampling input] - [Img Adj]

Item	Description
Color filter	 For details, see "Image Adjustment". p.101
Filtering	
BGS level	

### Registering the model

Register the model to be used for calibration.

#### ► MENU mode - [Setup] - [Cameras] - [Camera 0/1] - [Calibration] - [Sampling input] - [Region]

Item	Description
Region	Registers the model to be used for calibration.
Search region	Sets the region in which to search for the model.




## Executing a search


Perform an actual search, and input the actual coordinates of the location where the model was found.

Before performing an actual search, register the model to be used in the search at [Region].

► MENU mode - [Setup] - [Cameras] - [Camera 0/1] - [Calibration] - [Sampling input] - [Sampling]

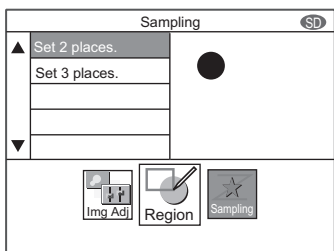


**1** Select either [Set 2 places.] or [Set 3 places.].

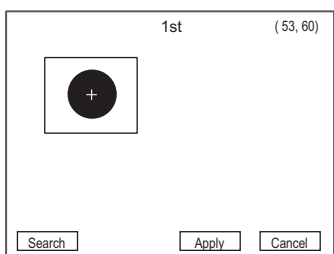


**2** Place the measurement target and select [search].

The search is executed, and a frame and crosshair cursor are displayed at the location where the model was found.

**3** Select [Apply].

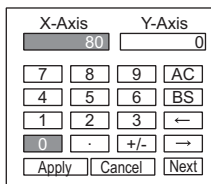

**4** Input the actual coordinates of the 1st point.

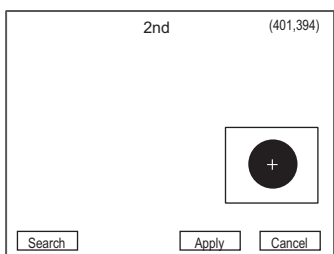

**5** Move the measurement target to the 2nd point and select [Search].

**6** Select [Apply].

**7** Input the actual coordinates of the 2nd point.  
When sampling 3 points, repeat steps 4 to 6.

## Setting Calibration by Specifying Points

With this method, calibration is set by specifying desired points (in pixel units). When the actual coordinates of a specified position are input, the calibration data is automatically calculated.

When the scale in the X and Y directions is the same



Specify 2 locations and input the actual coordinates.


When each of the scales in the X and Y directions are different




Specify 3 locations and input the actual coordinates.

### Setup method


► MENU mode - [Setup] - [Cameras] - [Camera 0/1] - [Calibration] - [Specifying point]

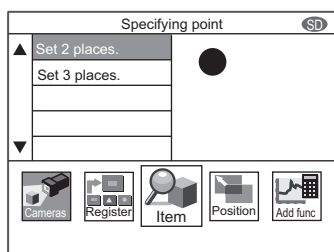


**1** Place the measurement target at the 1st point, and select either [Set 2 places.] or [Set 3 places.].

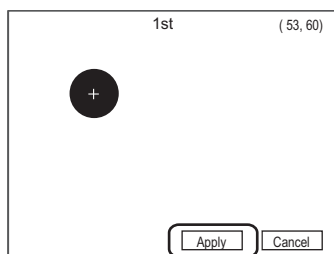

**2** Move the crosshair cursor to the 1st point, and select [Apply].

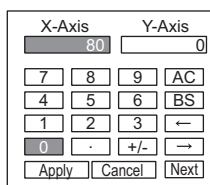

**3** Input the actual coordinates of the 1st point.

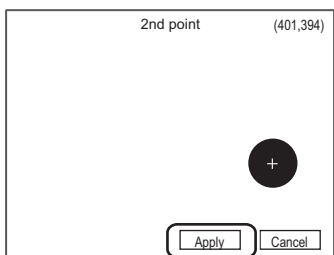

**4** Move the crosshair cursor to the 2nd point, and select [Apply].

**5** Input the actual coordinates of the 2nd point.

When specifying 3 points, repeat steps 4 to 5.

## Setting Calibration by Parameter Input


With this method, calibration is set based by directly inputting numerical values. When the origin and coordinate system of the actual coordinates, and pixel magnification are input, the calibration data is calculated.

► MENU mode - [Setup] - [Cameras] - [Camera 0/1] - [Calibration] - [Parameter Input]

Setting value	Description
Origin	Specify where the origin of the actual coordinates is to be set.  
Magnification	Sets how much of the actual dimensions one pixel is to be equivalent to. (0.010 to 9.999)

### Note

The coordinate system used for expressing the actual coordinates is the left-handed coordinate system. The plus direction of the angle is as follows depending on the origin setting.

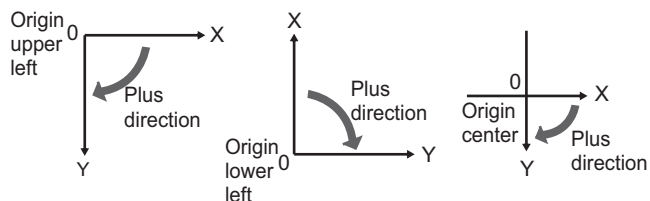

# Registering Images

This function is for making a series of settings using the same image. Two images can be registered in the Controller's internal memory, and called up so that they can be used for use in setup.

The following three types of images can be registered:

- Live images from a camera connected to the Controller
- Measurement images saved on the Controller
- Images saved on SD card


The following operation is not required when making setups using live images. Also, registered image data is cleared when the Controller is turned OFF. To retain image data, save them on SD card.

## Selecting operation

### ► MENU mode - [Setup] - [Register] - [Image 0/1]

Setting value	Description
Register image	Selects the image to be registered. Live image: Registers the image captured from camera 0 or camera 1. Stored image: Registers the stored measurement image. Image in SD card: Registers the image saved in SD card.
Save to SD card	Saves the registered image on SD card. The folder "IMAGE" is automatically created on SD card, and is saved using the following folder names. One image file each can be saved, and the image file is overwritten when the registered image is next saved on SD card. Image 0: REGIMG00.BYR Image 1: REGIMG01.BYR
Delete image	Deletes the registered image.

## Using registered images

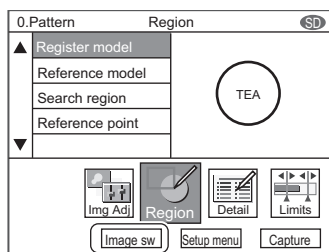

The following settings can be made to registered images:

- Image adjustment
- Region settings


Switch between live images and registered images by selecting [Image sw] that is displayed in each of the above menu hierarchies.

# Position Correction

This function is used when the position or orientation of the measurement target is not fixed. If you use this function, the amount of the shift from the reference position is calculated, and the position of the measurement region is corrected before measurement is performed.


## Important

After using an image for setting position correction, save the image to SD card.

 Registering Images p.114

When adjusting by position correction, use a saved image. If you use an image different from the one that was initially set to perform adjustments, position correction might not be set correctly.

To perform adjustments with a different image, repeat the settings for measurement items, too.

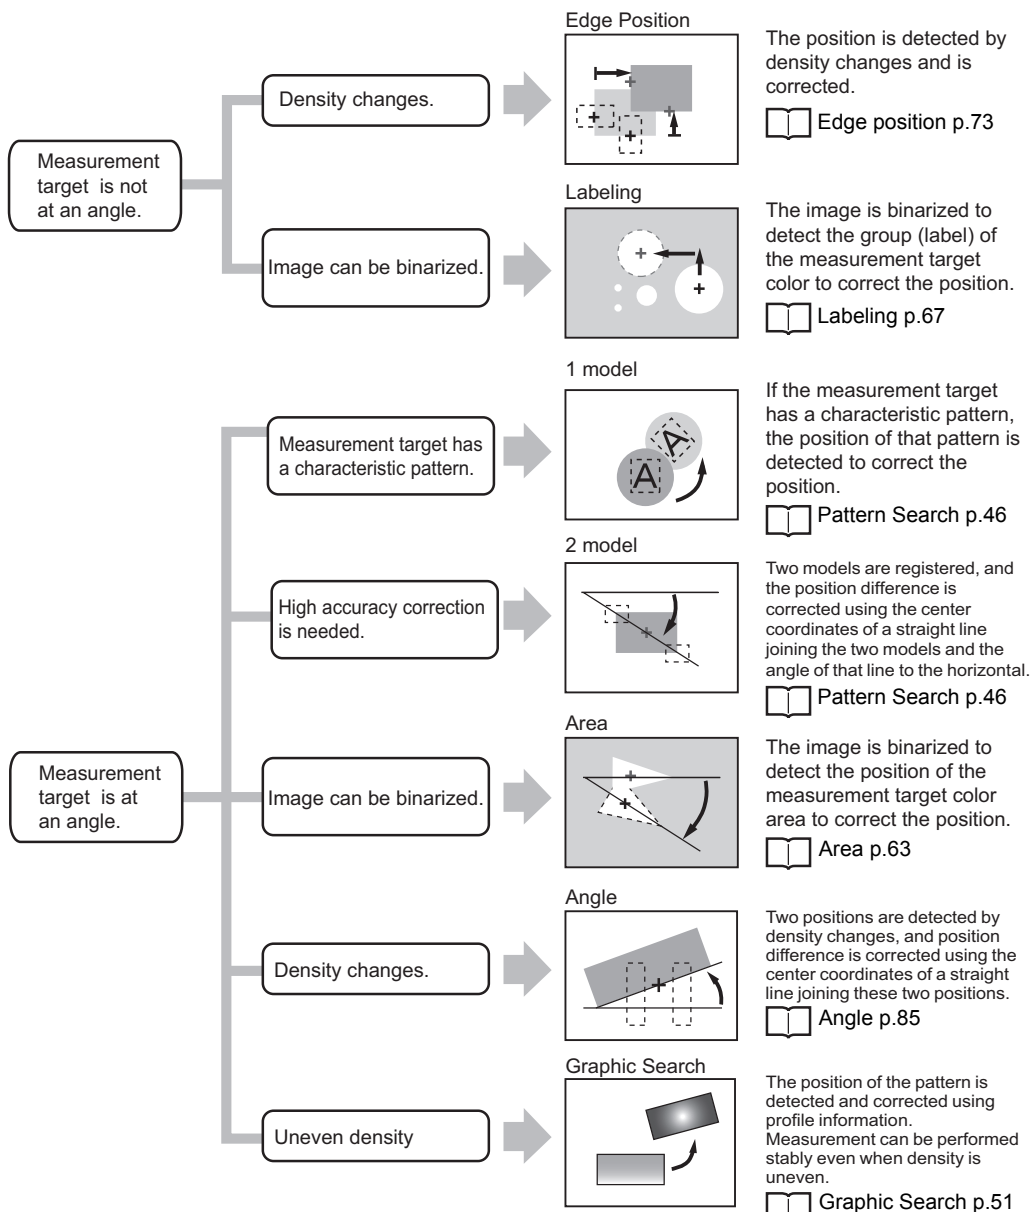

**Note**

- This section describes guidelines for selecting position correction items. The setup parameters for each item are the same as those for the measurement items. For details, see those items.
- Labeling is not provided for the ZFX-C10/C15.
- Normally, a single position correction is sufficient. However, to ensure reliable correction of positions or to shorten the processing time, correct the position in 2 stages. [Position0] is the correction performed for the 1st position correction, and [Position1] is the correction performed for the 2nd position correction.

The direction in which shift can be corrected automatically turns [ON] according to the preset position correction method. Change the setting for directions to exclude from position correction to [OFF].

► **MENU mode - [Setup] - [Position] - [Camera 0/1] - [Position0/1] - [Correction setting]**

Setting value	Description
X correction	Correct shift in the X direction.
Y correction	Correct shift in the Y direction.
θ correction	Corrects shift in the rotary direction. Items not supported in correction of shift in the rotary direction are not displayed.

# Additional Functions

## Calculation

The ZFX-C can output two types of data (measurement values and judgment values) to external devices. Output content is set as calculation expressions.

### Measurement Values/judgment

The measurement values and judgments of each region can be output.

As the output content can be set as an expression, calculations can be made with the measurement values of other regions. Up to 32 expressions can be set.

#### ► MENU mode - [Setup] - [Add func] - [Calculation] - [Data] or [Judge]

Setting value	Description
Data	The measurement value is output. Up to 32 expressions, 0 to 31, can be set.
Judgment	The judgment is output. Up to 32 expressions, 0 to 31, can be set. Judgment conditions can be set for each expression.

#### Note

Select the output destination at [System] - [Output].



p.142

### Variables

Calculation expressions that are not output to external devices can be set. These expressions are called "variables". You can set frequently used expressions or part of long expressions that cannot fit into the maximum number of digits of calculation expressions, and you can reference variables from other calculation expressions. Up to 32 expressions can be set.


#### ► MENU mode - [Setup] - [Add func] - [Calculation] - [Variables]

Setting value	Description
Variables	Up to 32 expressions, 0 to 31, can be set. Judgment conditions can be set for each expression.


## Setup Parameters

### Item No.

Item Nos. are displayed as follows.

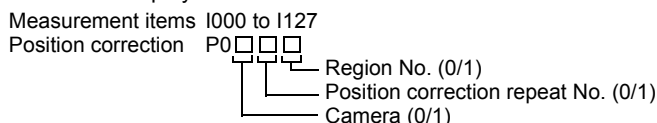

The parameters that can be set to expressions differ according to the measurement item.

 "Possible output results" from measurement items

### List of functions

The following describes the functions that are available for expressions.

#### General functions


Function	Description
ABS	Calculates the absolute value. ABS (argument)
MOD	Calculates the remainder obtained by dividing the dividend by the ordinal. MOD (dividend, ordinal) If the numerical value to be handled is a real number when calculating the remainder, numbers past the decimal point of the real number are rounded to the nearest whole number before calculation of the remainder is executed. The result is the remainder of division of the integer. Example: MOD(13,4)... Result: 1 (remainder obtained by dividing 13 by 4) MOD (25.68,6.99)... Result: 1 (remainder obtained by dividing 26 by 7)
MAX	The largest value of the four arguments is returned. MAX (argument 1, argument 2, argument 3, argument 4)
MIN	The smallest value of the four arguments is returned. MIN (argument 1, argument 2, argument 3, argument 4)
SQRT	Calculates the square root. When the argument is a minus number, "0" is returned as the calculation result to indicate that the judgment result is an NG. SQRT (argument)
AVE	Calculates the average. AVE (Up to 4 arguments can be set.)
IMAX	The index (0 to 15) having the largest value of the maximum of 16 arguments is returned. IMAX (argument 1, argument 2, argument 3, and so forth to argument 16) Example: IMAX (10,54,25) ..... Result: 1 IMAX (-20,-54, -1) ... Result: 2
IMIN	The index (0 to 15) having the smallest value of the maximum of 16 arguments is returned. IMIN (argument 1, argument 2, argument 3, and so forth to argument 16) Example: IMIN (10,54,25) ..... Result: 0 IMIN (-20,-54, -1) .... Result: 1



### Trigonometric functions

Function	Description
SIN	Calculates the sine. The result is returned in the range -1 to 1. Specify the angle in the numerical expression in degrees. SIN (numerical expression)
COS	Calculates the cosine. The result is returned in the range -1 to 1. Specify the angle in the numerical expression in degrees. COS (numerical expression)
ATAN	Calculates the arc tangent of the Y-axis and X-axis components. The result is returned as a radian in the range $-\pi$ to $\pi$ . ATAN (Y-axis component, X-axis component)  Example: To calculate the angle formed between a horizontal line and a straight line joining the gravities of items 0 and 1 ATAN (I001.Y-I000.Y, I001.X-I000.X)  When both of the two arguments are 0, 0 is returned as the calculation result to indicate that the judgment is NG.

### Geometrical functions

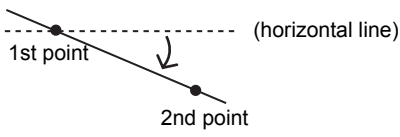Function	Description
ANGL	Calculates the angle formed by a straight line connecting two points (gravity and center of model). The angle is calculated with respect to the horizontal line. The result is returned in the range -180 to 180. ANGL (Y-axis component, X-axis component) Example: To calculate the angle formed by a straight line joining the gravities of items 0 and 1 ANGL (I001.Y-I000.Y, I001.X-I000.X)   When both of the two arguments are 0, 0 is returned as the calculation result to indicate that the judgment is NG.
DIST	Calculates the distance between two points (gravity and center of model). DIST (X-axis coordinate of 1st point, Y-axis coordinate of 1st point, X-axis coordinate of 2nd point, Y-axis coordinate of 2nd point)  Example: To calculate the distance between the gravities of items 0 and 1 DIST (I000.X, I000.Y, I001.X, I001.Y)  The following calculation is performed internally: $\sqrt{(I001.X-I000.X)^2 + (I001.Y-I000.Y)^2}$

### Logic functions

Function	Description
AND	Calculates the logical product. When either of the arguments is "0", "0" is returned as the calculation result, and "-1" is returned for the other argument. AND (argument1, argument 2)

Function	Description
OR	Calculates the logical sum. When both of the arguments is "0", "0" is returned as the calculation result, and "-1" is returned for the other argument. OR (argument1, argument 2)
NOT	Calculates the logical NOT. NOT (argument)

## List of operators

The following describes the arithmetic operators that are available for expressions.

Operator	Description of Operation
+	Addition
-	Subtraction
*	Multiplication
/	Division of real numbers

## Values of other expressions

[Variables], [Data], or [Judgment] can be selected to perform an operation using values of another expression. Expressions that can be used are displayed as follows.

Expression type	Expression number display	
	Measurement value	Judgment result
Variables	VR.0 to VR.31	VJ.0 to VJ.31
Data	RS.0 to RS.31	---
Judgment	PR.0 to PR.31	PJ.0 to PJ.31

## Setting the Number of Display Digits


You can change the number of display digits in "Variables list," "Data list" and "Judgments list" in the RUN and ADJ modes.

► **MENU mode** - [Setup] - [Add Func] - [Calculation] - [Data], [Judge] or [Variables] - [Expression] - [Display format]

Setting value	Description
Digits of integer	Sets the number of digits to display at the integer section. Range: 0 to 8 (default value: 8)
Digits of decimal	Sets the number of digits to display past the decimal point. Range: 0 to 3 (default value: 3)

### Note

Besides changes to the number of display digits, the display pattern of the "Variables list," "Data list" and "Judgments list" can be changed.

 p.146

## Setting Reflection of Individual Results

You can select which item results are to be reflected in the overall judgment that is output to the OR signal of the parallel interface.

### Note

The overall judgment result can be checked in the RUN mode or ADJ mode.


### ► MENU mode - [Setup] - [Add func] - [OR setting]

Setting value	Description
Measurement item	Sets measurement items to be included in the overall judgment to [ON]. Range: ON (default value), OFF
Position correction item	Sets position correction items to be included in the overall judgment to [ON]. Range: ON (default value), OFF
Calc./variable	Sets whether or not include the results of [Calculation/Variable] in the overall judgment. Range: ON (default value), OFF
Calc./judge	Sets whether or not include the results of [Calculation/Judgment] in the overall judgment. Range: ON (default value), OFF
Calc./alarm	Sets whether or not to include the [Calculation/Logging Monitor] alarm in the overall judgment. Range: ON, OFF (default value)

# Logging Monitor

This function displays a log of the measurement results on the monitor. By observing the trends of measurement values, you can prevent frequent occurrence of defective products, and you can use this information to analyze the cause of NGs that occur.

Up to three parameters can be logged and monitored simultaneously, and up to 10,000 items of data can be held in a single parameter.


 How Items Are Displayed on the Logging Monitor p.128

## Setting

### Log Settings

The following explains the data to be logged and the conditions used as the trigger for generating a warning.

► **MENU mode - [Setup] - [Add func] - [Logging monitor] - [Log0/1/2] - [Modify]**

Setup Item	Description
Reference data	Sets the measurement values to be displayed on the logging monitor as a calculation expression. Up to three parameters from among Measurement item, Position correction item, Variable, or Data can be logged and monitored simultaneously.   How to set calculation expressions p.117
Warning Condition	Sets the warning range to prompt the operator to be alert before NGs frequently occur.
Logging	Selects logging On/Off. Range: On, Off (default value)

### Display condition

Sets the conditions for displaying data on the logging monitor.

► **MENU mode - [Setup] - [Add func] - [Logging monitor] - [Display condition]**

Setup Item	Description
Warning Count	Specify to the warning range the allowable number of consecutive NGs before the warning is to be generated. Range: 1 to 999 (default value: 1)
Display average	Selects whether or not to display the average in the graph display on the logging monitor. This setup item is enabled when the graph display scale is set to value greater than 200 (results). The graph display scale can be changed in the ADJ mode. Range: OFF (default value), ON
Display maximum Display minimum	Select whether or not to display the minimum and maximum values in the graph display on the logging monitor. This setup item is enabled when the graph display scale is set to value greater than 200 (results). The graph display scale can be changed in the ADJ mode. Range: OFF (default value), ON

## Note

The display range of the graph's horizontal and vertical axes can be changed in the ADJ mode.



Adjusting Logging Monitor Conditions p.133


## Erasing Measurement Values

This function allows you to erase (reset) accumulated data without having to turn the Controller OFF.

► **MENU mode** - [Setup] - [Add func] - [Logging monitor] - [Log0/1/2] - [Erase]

## File Format

The format of files saved on SD card are as follows:

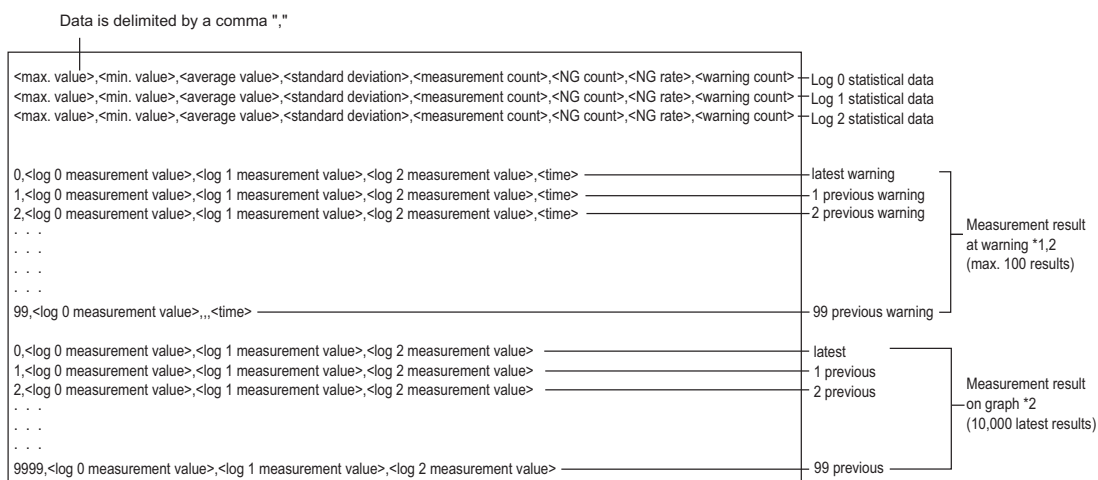

\*1: When a warning is inserted consecutively for even one of logs 0 to 2, the measurement values are logged.

\*2: Commas are aligned where logs are not set.


Example: 1,<measurement value>,<time>

## Note

### Difference between NG count and warning count

The "NG count" is the number of times that the measurement value exceeds or falls below the warning level.

The "warning count" is the number of times that the measurement value exceeded or fell below the warning level continuously for the number of times set for the warning count or more in the setup conditions.

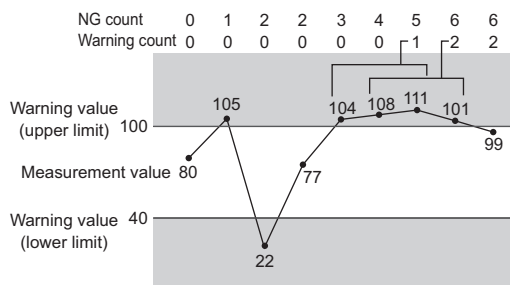

Saving/Loading Data p.153

MEMO

# FUNCTIONS USED DURING OPERATION


<b>Monitoring the Measurement Status - RUN Mode</b>	<b>126</b>
Displaying Measurement Information	126
Switching the Image Display Method	128
<b>Checking/Adjusting the Measurement - ADJ Mode</b>	<b>129</b>
Checking Measurement Status	129
Switching the Image Display Method	131
Using a Saved Image to Perform Re-measurement	131
Adjusting Measurement Conditions	132

# Monitoring the Measurement Status - RUN Mode

## Displaying Measurement Information


Measurement information is displayed on the LCD screen. You can switch the screen to display different measurement information according to your specific application. To switch the screen display, either select [Display SW] or press the F3 key.

### Individual results

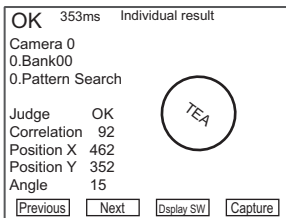


Results are displayed individually for each measurement item.

### All results/Region

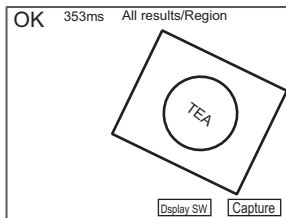

The entire measurement region is displayed.

### All results/Judge

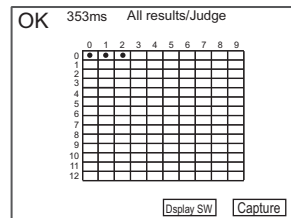

All measurement results are displayed as a list.


Horizontal axis: Smallest digit of item No.

Vertical axis: Upper two digits of item No.

Green circle: OK


Red circle: NG

### Position correction

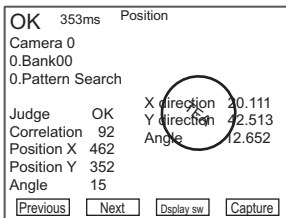


The position correction result is displayed.

### Variables list

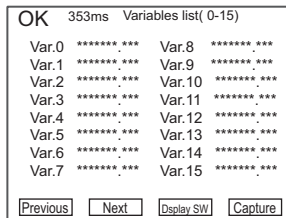


The variable results are displayed as a list.

### Data list

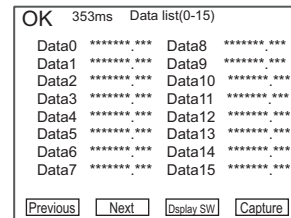


The data results are displayed as a list.

### Judgments list

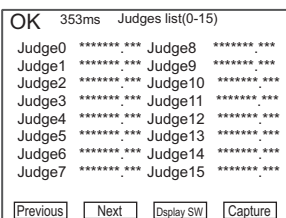


The judgment results are displayed as a list.

### Logging monitor

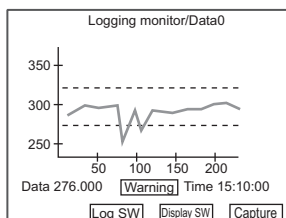

Measurement results are logged, and the log is displayed as a graph.

### Statistical data

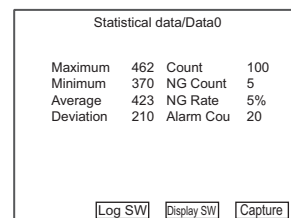

The statistical values of the logged data are displayed.

### Important

Logging data and statistical data are erased from memory when the Controller is turned OFF.



- To reset the log without turning the Controller OFF p.123
- To save logging data on the SD card p.153


### Note

Input the trigger using the SET and UP keys.



## Menu Buttons

Select the menu buttons displayed on the LCD screen by the touch pen or function keys. The functions that are assigned to buttons differ according to the screen.

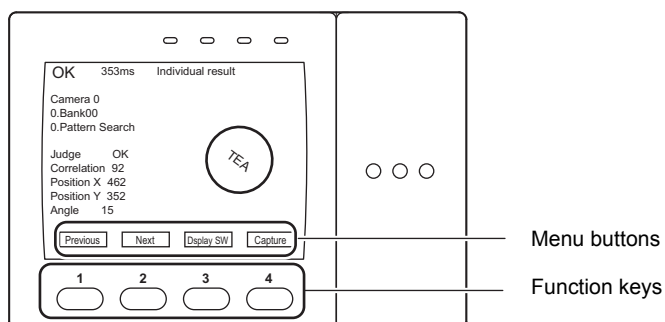

Screen	F1	F2	F3	F4
Individual results	Previous	Next	Display switch (sw)	Capture
All results/Region	-	Camera switch (sw)	Display switch (sw)	Capture
All results/Judge	-	-	Display switch (sw)	Capture
Position correction	Previous	Next	Display switch (sw)	Capture
Variables list	Previous	Next	Display switch (sw)	Capture
Data list	Previous	Next	Display switch (sw)	Capture
Judgment list	Previous	Next	Display switch (sw)	Capture
Logging monitor	-	Log switch (sw)	Display switch (sw)	Capture
Statistical data	-	Log switch (sw)	Display switch (sw)	Capture

### Menu button functions


Function Name	Description
Previous	Individual results/Position correction: The previous measurement item results are displayed. Variables/Data/Judgment list: The previous page is displayed.
Next	Individual results/Position correction: The next measurement item results are displayed. Variables/Data/Judgment list: The next page is displayed.
Camera switch (sw)	Switches the camera to be displayed.
Log switch (sw)	Logging monitor: Switches the parameters to be displayed. Statistical data: Displays the statistical data of the assigned setting value.
Display switch (sw)	Switches the content of the measurement information that is displayed.
Capture	Captures the display screen and saves it on SD card.

## How Items Are Displayed on the Logging Monitor

The trends of three parameters can be monitored in the logging monitor.

By displaying the minimum and maximum values, whether or not an NG has occurred can be checked and judged in real time.

Up to 10,000 items of data can be logged, and the logging monitor data is held in memory until the Controller is turned OFF.

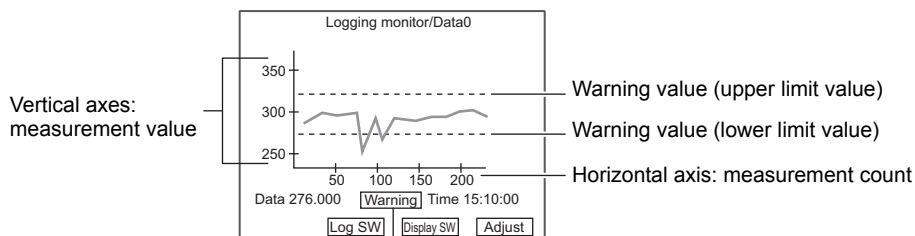


The warning is displayed when the measurement result falls below or exceeds the warning value.

Adjusting the scale of the horizontal and vertical axes p.133


## Switching the Image Display Method

In the Individual results display or Position correction display, you can hide or reduce the size of images that are displayed simultaneously with measurement information. Each press of the  $\uparrow$  UP key/ $\downarrow$  DOWN key switches the image display as follows:


Full display

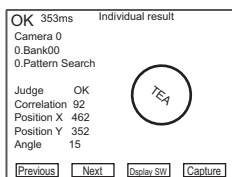

1/4 display

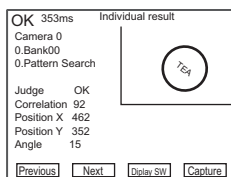

No image

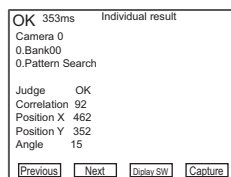

The 1/4 display is available only for the individual results display and position correction display.

In the "Variables list," "Data list" or "Judgments list" display, each press of the  $\uparrow$  UP key/ $\downarrow$  DOWN key toggles display/hide of the camera image.

No image


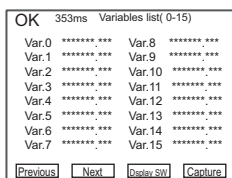


Image display

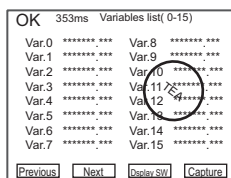


# Checking/Adjusting the Measurement - ADJ Mode

## Checking Measurement Status


Display the image currently being measured and measurement results on the LCD screen while performing continuous measurement. (In the ADJ mode, trigger input is not accepted.) The currently saved measurement data can also be checked using the logging monitor and statistical data. Saved images can also be displayed. To switch the screen display, either select [Display SW] or press the F3 key.

### Individual results

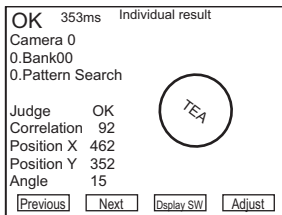


Results are displayed individually for each measurement item.

### All results/Region

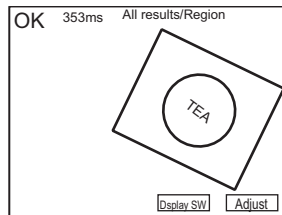


The entire measurement region is displayed.

### All results/Judge

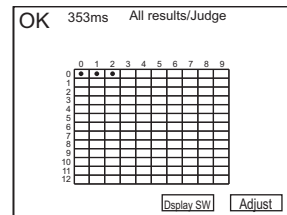


All measurement results are displayed as a list.  
Horizontal axis: Smallest digit of item No.  
Vertical axis: Upper two digits of item No.  
Green circle: OK  
Red circle: NG

### Position correction

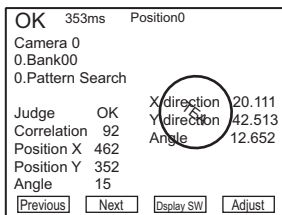


The position correction result is displayed.

### Variables list

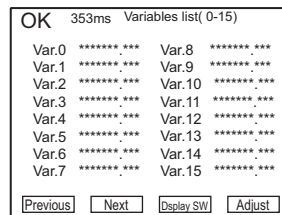


The variable results are displayed as a list.

### Data list

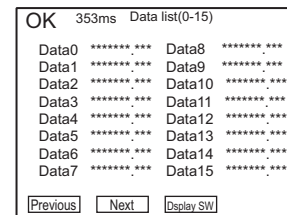


The data results are displayed as a list.

### Judgments list

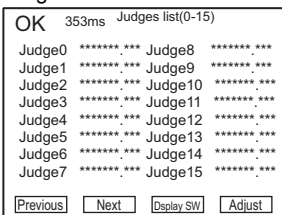


The judgment results are displayed as a list.

### Stored image

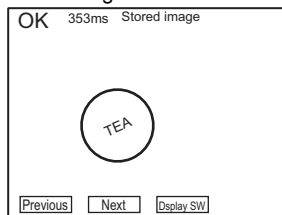

Saved images are displayed.

### Logging monitor

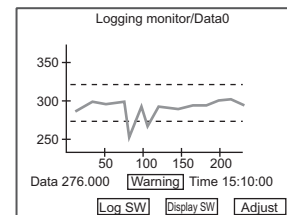

Conditions can be adjusted while viewing the measurement results saved to the logging monitor.


### Statistical data

Statistical data/Data0			
Maximum	462	Count	100
Minimum	370	NG Count	5
Average	423	NG Rate	5%
Deviation	210	Alarm Cou	20

The statistical data saved to the logging monitor is displayed.

## Menu Buttons

Select the menu buttons displayed on the LCD screen by the touch pen or function keys. The functions that are assigned to buttons differ according to the screen.

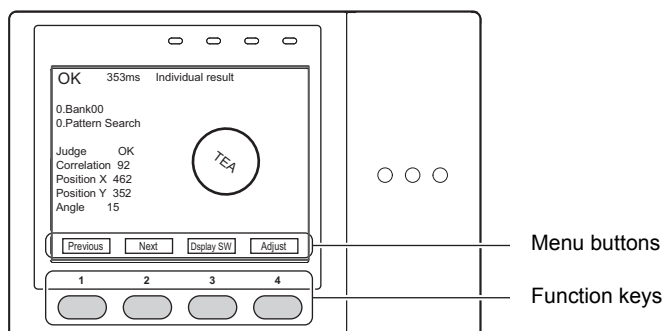

Screen	F1	F2	F3	F4
Individual results	Previous	Next	Display switch (sw)	Adjust
All results/Region	-	Camera switch (sw)	Display switch (sw)	Adjust
All results/Judge	-	-	Display switch (sw)	Adjust
Position correction	Previous	Next	Display switch (sw)	Adjust
Variables list	Previous	Next	Display switch (sw)	Adjust
Data list	Previous	Next	Display switch (sw)	-
Judgments list	Previous	Next	Display switch (sw)	Adjust
Stored image	Previous	Next	Display switch (sw)	-
Logging monitor	-	Log switch (sw)	Display switch (sw)	Adjust
Statistical data	-	Log switch (sw)	Display switch (sw)	-

### Menu button functions

Function Name	Description
Previous	Individual results/Position correction: The previous measurement item results are displayed. Variables/Data/Judgment list: The previous page is displayed. Saved image: The previous saved image is displayed.
Next	Individual results/Position correction: The next measurement item results are displayed. Variables/Data/Judgment list: The next page is displayed. Saved image: The next saved image is displayed.
Camera switch (sw)	Switches the camera.
Log switch (sw)	Logging monitor: Switches the parameters to be displayed. Statistical data: Displays the statistical data of the assigned setting value.
Display switch (sw)	Switches the content of the measurement information that is displayed.
Adjust	Adjusts the measurement items related parameters.

#### Note Capture function


In the ADJ mode, the capture function is assigned to the AUTO key.

## Switching the Image Display Method


In the Individual results display or Position correction display, you can hide or reduce the size of images that are displayed simultaneously with measurement information. Each press of the ↑ UP key/↓ DOWN key switches the image display as follows:

In the Stored image display, the image display is switched between 1/4 display and full display.


Full display

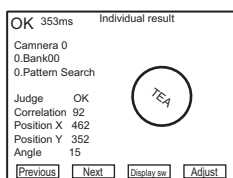

1/4 display

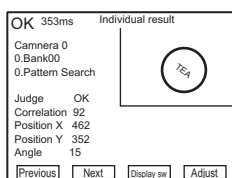

No image

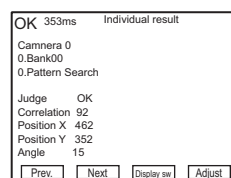

The 1/4 display is available only for the individual results display and position correction display.

The image is not displayed while a saved image is displayed.

In the "Variables list," "Data list" or "Judgments list" display, each press of the ↑ UP key/↓ DOWN key toggles display/hide of the camera image.

No image


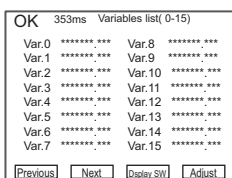


Image display

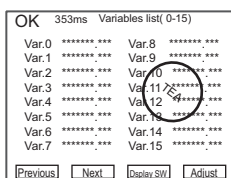

## Using a Saved Image to Perform Re-measurement

Re-measurement can be performed using a measurement image saved in internal memory. Images are saved to internal memory in the RUN mode. If the ← L key/→ R key is pressed in the Individual results display or All results/Region display, the screen switches to the saved image and re-measurement is executed.

### Note

Up to 100 images can be saved. Images that were judged as NG also can be saved.



Measurement Image Save Conditions, p.150

# Adjusting Measurement Conditions

If you switch to the adjustment mode screen, the ADJ mode is still active and you can adjust measurement conditions.

## Adjusting Measurement Item Conditions

Adjusting conditions while monitoring the live image

OK 353ms Individual result

Camera 0  
0.Bank00  
0.Pattern Search

Judge OK  
Correlation 92  
Position X 462  
Position Y 352  
Angle 15

TEA

Previous Next Display sw Adjust

Adjusting conditions while monitoring a saved image

OK 353ms Individual result

TEA

Previous Next Display sw Adjust

Adjust Mode

▲ 0.Pattern search  
1.Pattern search  
2.Pattern search  
▼

TEA

Select the target item.

Adjust Mode

▲ Register model  
Reference model  
Search region  
Reference point  
▼

TEA



Img Adj Limits Region

- Adjusting the measurement region
- Adjusting the image (other than "Select camera")
- Adjusting the threshold value


## Adjusting Logging Monitor Conditions

The logging monitor has the following three adjustment items.


Item	Description
Warning level	In addition to a judgment threshold, warning levels can be set so that a warning is displayed when the measurement result falls below or exceeds the warning value. Displaying "Warning" before NGs frequently occur enables feedback to pre-processes.
Display range (vertical axis)	The scale of the horizontal and vertical axes can be changed to make the graph easier-to-view.
Number of display results (horizontal axis)	

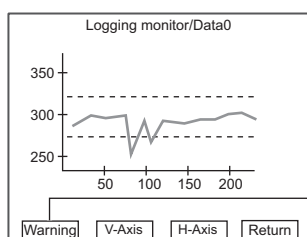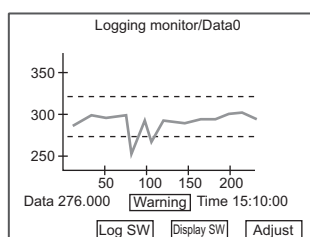


**Warning level**  
Specify the warning level by vertically dragging the bar or by directly entering numerical values.

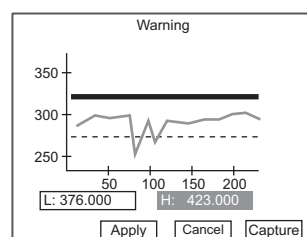

**Display range (vertical axis)**  
Specify the center value and scale width using numerical values.

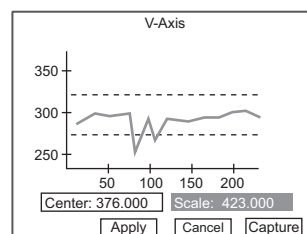

**Number of display results (horizontal axis)**  
Select from the currently displayed options.

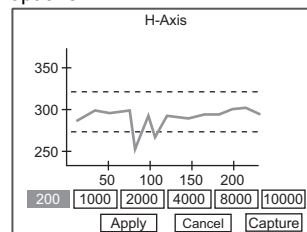

MEMO



# ADDITIONAL FUNCTIONS

<b>Bank Settings</b>	<b>136</b>
Bank Data Operations	137
Bank Group Operations	137
<b>System Settings</b>	<b>138</b>
Camera Specifications	138
Communication Setup	138
Output Settings	142
Display Settings	144
Operation Settings	147
Measurement Control Conditions	150
Operation Conditions during Startup	151
Setting/Changing the Display Language	152
Setting/Changing the Date	152
Clearing Saved Images	152
<b>Tools</b>	<b>153</b>
Saving/Loading Data	153
SD Card Operations	154
Checking Density Distribution (Profile)	154
Checking the Communication Status with External Devices	155
Displaying the Controller Information	156



# Bank Settings

The ZFX-C can hold up to 32 sets of settings, which are called a "bank," in internal memory. Bank 0 is displayed as the default bank when the Controller is turned ON. Banks 1 to 31 are also provided in addition to this. The device setup can be changed easily by just switching banks if banks are registered to suit specific conditions and content.

## Note

The number of banks can be increased to 1024 by attaching an SD card (capacity: 256MB). 32 banks are handled as a single group, and up to 32 groups can be set. In other words, this means that 32 bank groups are the same as having set 1024 banks.

In this case, bank group 0 is saved on the Controller's internal flash memory, and bank groups 1 to 31 are saved on the attached SD card.

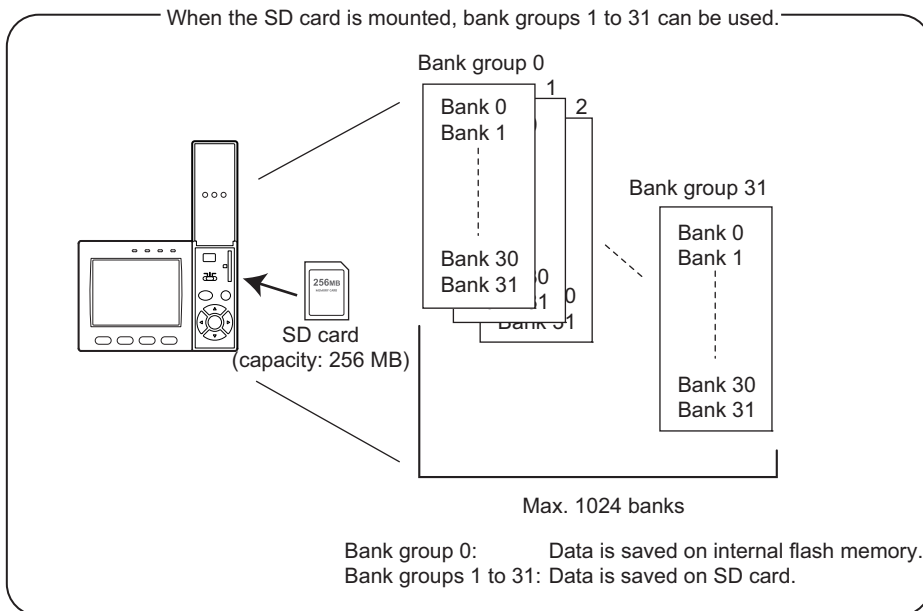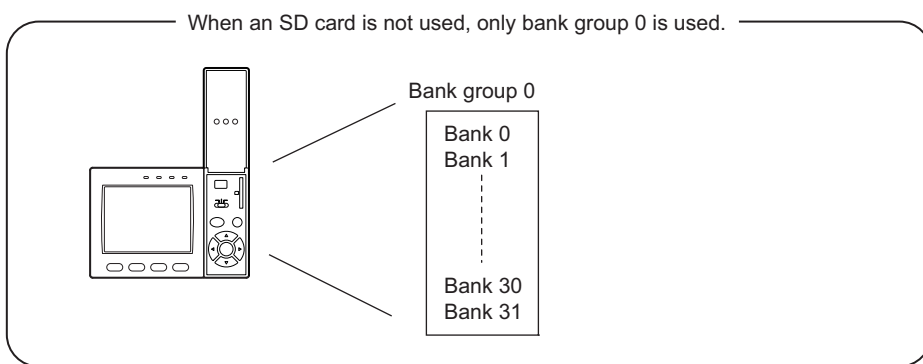

# Bank Data Operations

The following operations can be performed on bank data.

## ► MENU mode - [Bank] - [Bank]

Setup Item	Description
Switch	Switches the currently selected bank to other banks. Switching of banks can also be instructed by operating the keys on the Controller, or by issuing external signals or serial communication commands. Range: 0 to 31
Copy	Copies already created bank data to other banks. Select [Copy] and the copy destination bank after displaying the copy source No. (default value: Bank0)  <b>Important</b> Be sure to save bank data after copying a bank. Data is cleared when the Controller is turned OFF after you just copy the data.
Rename	Specified bank No. can be renamed with any name. (within 16 characters)
Erase	Deletes specified bank data.

# Bank Group Operations

When the bank group is switched to any group other than 0 and saved, the directory "BANKGRP" is automatically created on the SD card. The data of bank groups is saved to this directory using file names BGR\_0001.BNG to BGR\_0031.BNG.

### Important

When setup data has been changed, save the setup data before switching the bank group. Otherwise, the newly changed setup data is cleared. To automatically save setup data when a bank group is switched, set [Save at switch BG] to ON.

 Saving during Switching of Bank Groups p.148

## ► MENU mode - [Bank] - [Bank Group]

Setup Item	Description
Switch	Switches the bank group with the SD card attached. After the bank group is switched, select the target bank No. Range: 0 to 31

### Note



Copy/erase/rename can be executed on bank groups also.

# System Settings

## Camera Specifications

Set the basic conditions of the camera connected to the Controller.

### ► MENU mode - [System] - [Camera] - [Camera 0/1]

Setup Item	Description
White balance	The environment or lighting around the camera sometimes makes images captured from the camera look as if they are color-tinted even if the image is of a white measurement target. The function for correcting the color so that white objects are reproduced correctly in white on screen is called "white balance." Automatically adjusts the white balance while displaying white paper or cloth on screen. This function can be set only when a color camera is connected to the Controller.
Strobe delay time	Set the delay time from input of the TRIG signal up to output of the STGOUT signal. Range: 0 to 60000 $\mu$ s
Strobe polarity	Sets the output polarity of the STGOUT signal. Range: Positive/Negative  <Positive when signal is in PNP type>      <Negative when signal is in PNP type> <Negative when signal is in NPN type>      <Positive when signal is in NPN type>  High ..... Low  High  Low      .....      Low .....  When strobe polarity is set to "Negative", a delay of about 50 to 100 $\mu$ s occurs from input of the TRIG signal until the STGOUT signal turns Low. When a high-speed shutter is used, use the Controller with the strobe polarity set to "Positive".
Strobe width	Sets the time that the STGOUT signal is output. Range: 0 to 60000 $\mu$ s
Trigger delay time	Adjusts the time from input of the TRIG signal until the camera's shutter opens. Adjust this time, for example, to prevent mutual interference. This function is displayed only when the ZFX-C2_ is used. Range: 0 to 60000 $\mu$ s

## Communication Setup

Set the communication specifications for the Controller matched to the communication specifications of external devices.

### Serial Communication

#### RS-232C/422

Set the basic communication specifications for when communications is performed with external devices on the serial interface. Set the communication specifications to match those of the external devices.

### ► MENU mode - [System] - [Comm] - [RS-232C/422]

Setup Item	Setting value
Interface	RS-232C (default value), RS-422
Baud rate	9600, 19200, 38400 (default value), 57600, 115200
Data length	7 bit, 8 bits (default value)

Setup Item	Setting value
Parity	None (default value), Even, Odd
Stop bits	1 bit (default value), 2 bits

## Normal

Set the conditions required for performing serial communications in the normal mode.

### ► MENU mode - [System] - [Comm] - [Normal]

Setup Item	Setting value
Delimiter	CR (default value), LF, CR+LF

## Parallel Communication

### Parallel communication

Set the conditions required for performing parallel communications.

### ► MENU mode - [System] - [Comm] - [Parallel]

Setup Item	Description
Polarity	Sets the ON condition when the judgment result is output to the DO0 to DO15 and OR signals. NG: ON: Signals turn ON when the judgment is NG. (default value) OK: ON: Signals turn ON when the judgment is OK.
Output cycle	Sets the output cycle for the measurement results. Set a time that is "Gate ON delay + Gate ON time" or more and that is shorter than the measurement cycle. Range: 2.0 to 10000.0 ms (default value: 10.0 ms)
Gate ON delay	Sets the time from output of the measurement result to the DO0 to 15 signals until the GATE signal turns ON. This is the time to wait until stable output data can be obtained. Set a value longer than the ON delay/OFF delay time of the external device. Range: 1.0 to 1000.0 ms (default value: 0.0 ms)
Gate ON time	Sets the time that the GATE signal is ON. Set a value that allows the external device to capture the measurement result. Range: 1.0 to 1000.0 ms (default value: 5.0 ms)
Handshaking	Sets the output method for the measurement results. OFF: Measurement results are output asynchronously with external devices. (default value) ON: Measurement results are output synchronously with external devices.
Timeout	Sets the time until the timeout error is output. A timeout error occurs when there is no response from the external device within the preset time. Range: 1.0 to 60.0 s (default value: 10.0 s)

## OR signal

Set the output conditions of the OR signal.




### ► MENU mode - [System] - [Comm] - [OR output]

Setup Item	Description
Output mode	<p>Sets the output conditions of the OR signal.</p> <p>One-shot: The OR signal turns ON for the specified time only when the ON condition (Polarity) is satisfied. The OR signal turns OFF when the specified time has elapsed.</p> <p>Level: The ON/OFF status is held until it next changes after the OR signal has been output. (default value)</p>
Output time	<p>Sets the time that the OR signal is output as a one-shot signal.</p> <p>Range: 0 to 255 ms (default value: 0 ms)</p>

## ENABLE signal ON range

Set the timing during measurement processing that the ENABLE signal is turned ON.

### ► MENU mode - [System] - [Comm] - [ENABLE range] - [Range]

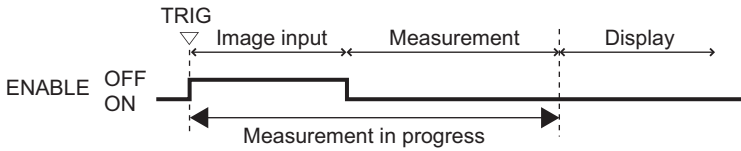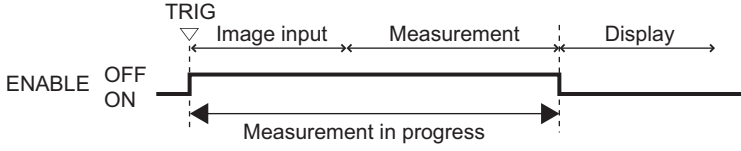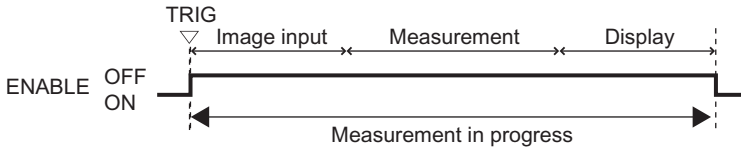Setting value	Description
Input image	<p>Turns the ENABLE signal ON when image input is complete. This serves as a guideline as to whether it is OK or not to move the measurement target.</p>  <p><b>Important</b></p> <p>When [Input image] is selected, do not input the next command until measurement is complete even if the ENABLE signal is ON. If the next command is input, the measurement currently being executed or the input command will not be executed normally.</p>
Measurement	<p>Turns the ENABLE signal ON when measurement is complete. (default value)</p> 
Display	<p>Turns the ENABLE signal ON when display of the measurement result is complete. Processing until end of display is processed as "measurement in progress."</p> 

## ENABLE reverse

Set whether or not to reverse the ON/OFF state of the ENABLE signal.

### ► MENU mode - [System] - [Comm] - [ENABLE output] - [Reverse]

Setting value	Description
OFF	The ON/OFF state of the ENABLE signal is not reversed. (default value)
ON	The ON/OFF state of the ENABLE signal is reversed. The ENABLE signal turns ON during processing by the ZFX. The ENABLE signal can be used as a signal for indicating that the ZFX-C is executing processing.

## Ethernet Communication

Set the communications specifications for performing communications with external devices on an Ethernet connection.

### ► MENU mode - [System] - [Comm] - [Ethernet]

Setting value	Description
Connection	Sets whether to enable or disable Ethernet communications. ON: Ethernet communications is enabled. (default value) OFF: Ethernet communications is disabled. This shortens the measurement time.
IP address	Sets the same address (excluding the rightmost address) as the PC that the ZFX-C is connected to. Set a unique address as the rightmost address. Do not set the same address twice in the network. (0.0.0.0 to 255.255.255.255, default value: 192.168.0.250)
Subnet mask	Sets the same subnet mask as the PC that the ZFX-C is connected to. (0.0.0.0 to 255.255.255.255, default value: 255.255.255.0)
Default gateway	Sets the IP address of the default gateway. (0.0.0.0 to 255.255.255.255, default value: 192.168.0.1)
Port number	Sets the port No. used for communication with ZFX. (1 to 65535)

### Important

- Port number is fixed to 23.
- Before connecting to an existing LAN, consult with the network administrator to confirm the network settings. If wrong settings are set, the ZFX-C and other devices on the network might no longer function properly.
- The ZFX-C cannot be controlled simultaneously from multiple PCs on the network.
- The network state sometimes causes a delay in data communications with the ZFX-C. If a fast response is required, we recommend performing data communications over a parallel I/O interface.
- The firewall functions of the PC that the ZFX-C is connected to might disturb data communications with the ZFX-C. In this case, disable the firewall on the PC.

# Output Settings

Set the output destination for the measurement results and the various conditions required according to the output destination.

## Output Destination

Set the items that are output as the measurement result and their output destinations. The ZFX-C can output two items, "data" and "judgment," as measurement results.

### Data output destination

Set the items that are output as the measurement result and their output destinations.

#### ► MENU mode - [System] - [Output] - [Data output]

Setup Item	Description
RS-232C/422	Selects ON to output data on the RS-232C/422 interface. (default value: OFF)
Parallel	Selects ON to output data via the parallel port. (default value: OFF)
SD card	Selects ON to output data to the SD card. (default value: OFF)
USB	Selects ON to output data via the USB port. (default value: OFF)
Ethernet	Selects [ON] to output data on an Ethernet connection. (default value: OFF)

### Judgment output destination

Set the output destination when judgments are to be output as the measurement results.

#### ► MENU mode - [System] - [Output] - [Judgement output]

Setup Item	Description
Parallel	Selects ON to output judgments via the parallel port. (default value: OFF)

### Overall Judgment Output

Set whether or not to output the overall judgment.

#### ► MENU mode-[System]-[Output]-[Total jg. output]

Setup Item	Description
Parallel	Selects [OFF] to disable overall judgment on the OR signal of the parallel port. (default value: ON)



## Output Conditions

When "Serial output" or "SD card" is output as the data output destination, set the output form and output format.

## ASCII format

When outputting measurement values in ASCII format, set the following items.

▶ **MENU mode - [System] - [Output] - [Date format (Serial)/(SD Card)]**

Setup Item	Description
Output form	Selects ASCII.
Digits of integer	<p>Sets the number of output digits of the integer section. When "0" is selected, all of the digits of the data are output shifted to the left.</p> <p>When there are fewer data digits than the preset number of digits, "0" is inserted in free digits.</p> <p>When there are more data digits than the preset number of digits, "9" is output for the preset number of digits.</p> <p>Range: 0 to 8 (default value: 8)</p>
Digits of decimal	<p>Sets the number of output digits past the decimal point. When "0" is selected, digits past the decimal point are rounded up to the nearest integer.</p> <p>Range: 0 to 3 (default value: 3)</p>
Field separator	<p>Sets the separator between individual output data items.</p> <p>Range: None, Comma (default value), Tab, Space, Semicolon</p>
Decimal separator	<p>Sets the number of digits past the decimal point.</p> <p>Range: None, Period (default value), Comma</p>
Record separator	<p>Sets the separator between individual output data records.</p> <p>Range: None, Comma, Tab, Space, Delimiter (default value)</p>
Display at time	<p>Prefixes the output data with time information.</p> <p>Range: OFF (default value), ON</p>
File name	<p>Sets the name of the output file. (only when SD card is selected) The directory "OUTFILE" is automatically created in the root directory of the SD card. Output files are stored in this directory.</p>

**Note**      **Output format**

< Measurement value of data 0 >, < Measurement value of data 1>...< Measurement value of data 31 > Delimiter

↑                                  ↑  
Field separator                      Record separator

When Display at time is set to "ON", the data is prefixed with the time information.

<Year/month/day>, <Hours/minutes/seconds>, <Measurement value of data 0>, <Measurement value of data 1> ... <Measurement value of data 31> Delimiter

Example: On August 1st, 2007 → 2007/8/1

Example: At 1 minute, 20 seconds past 12 am → 12:01:20

## Binary format

When outputting measurement values in binary format, set the following items. Setup of other items is not required as they are for ASCII format.

### ► MENU mode - [System] - [Output] - [Date format (Serial)/(SD Card)]

Setup Item	Description
Output form	Selects binary.
Display at time	Prefixes the output data with time information. Range: OFF (default value), ON
File name	Sets the name of the output file. (only when SD card is selected)

#### Note Output format

The value obtained by multiplying the measurement value by 1000 times is output continuously as 4 bytes per single data item. Minus numbers are output as 2's complement.

<Measurement value of data 0 x 1000> <Measurement value of data 1 x 1000> ... <Measurement value of data 31 x 1000>

4 bytes                      4 bytes                      4 bytes

Example: When data 0 is "256.324" and data 1 is "-1.000"

\$00	\$03	\$E9	\$44	\$FF	\$FF	\$FC	\$18
------	------	------	------	------	------	------	------

Data 0: 256324      Data 1: -1000  
(256.324 x 1000)      (-1.000 x 1000)

When Display at time is set to "ON", the data is prefixed with the time information.

<Year/month/day/hours/minutes/seconds><Measurement value of data 0 x 1000><Measurement value of data 1 x 1000>...<Measurement value of data 31 x 1000>

6 bytes

↑  
Year, month, day, hours, minutes, and seconds are assigned to each byte.

## Display Settings

Set the Controller's display conditions.

### ECO Display

The ZFX-C has an ECO mode display function for darkening the LCD screen to suppress current consumption when control keys or menu buttons are not operated for three minutes or more. Set this item to ON to enable the ECO mode display function.


The ECO display setting is enabled only in the RUN mode.

### ► MENU mode - [System] - [Display] - [Eco mode]

Setting value	Description
ON	Enables the ECO mode display function. (default value)
OFF	Disables the ECO mode display function.

## Display Setting

The items displayed in the measurement screen in the RUN mode and the ADJ mode can be selected.

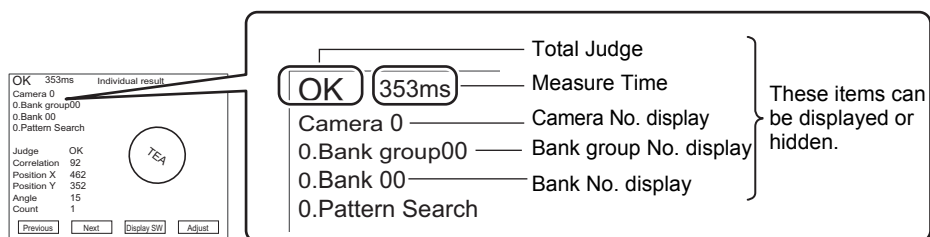


### ► MENU mode - [System] - [Display] - [Display Setting]

Setup Item	Description
Total Judge	Sets whether to display or hide the overall judgment. ON: Displays the overall judgment.(default value) OFF: Hides the overall judgment.
Measure Time	Sets whether to display or hide the measurement time. ON: Displays the measurement time.(default value) OFF: Hides the measurement time.
Bank No. display	Sets whether to display or hide the bank No. and bank name. ON: Displays the bank No.(default value) OFF: Hides the bank No.
Bank group No. display	Sets whether to display or hide bank group No. and bank group name. ON: Displays bank group No. OFF: Hides bank group No.(default value)
Camera No. display	Sets whether to display or hide the camera No. ON: Displays the camera No.(default value) OFF: Hides the camera No.

## Designate Colors

Change the color of text displayed in the measurement screen in the RUN mode and the ADJ mode to a desired color.

You can choose from Red, Yellow, Green, Cyan, Blue, Magenta, and White.

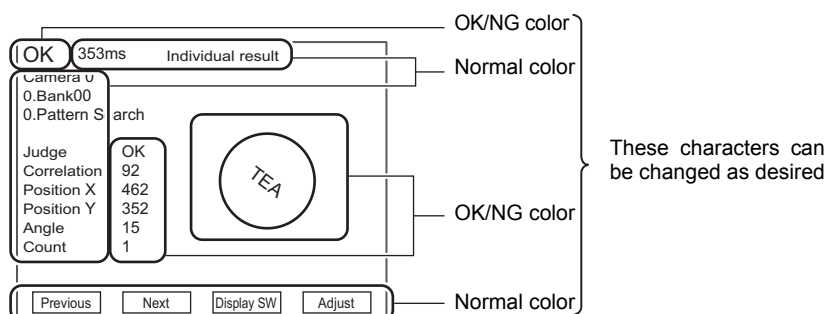



### ► MENU mode - [System] - [Display] - [Designate colors]

Setup Item	Description
Normal color	Changes normal colors to a desired color. (default value: Yellow)
OK color	Changes OK colors to a desired color. (default value: green)
NG color	Changes NG colors to a desired color. (default value: Red)

## Calculation List Settings

You can change the display pattern of "Variables list," "Data list" and "Judgments list" in the RUN and ADJ modes.

### ► MENU mode - [System] - [Display] - [Screen customize] - [Calculation list]

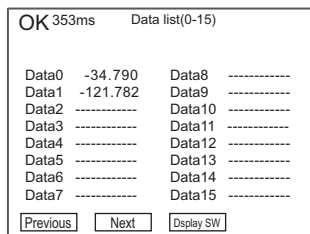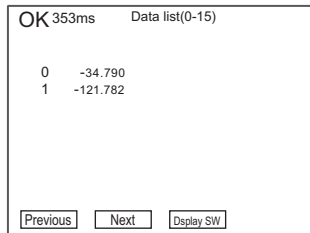Setup Item	Description
Format 1	<p>Displays text strings such as "Var.", "Data" and "Judge". Displays all Nos. including numbers not set with an expression. (default value)</p> 
Format 2	<p>Does not display text strings such as "Var.", "Data" and "Judge". Displays only numbers set with an expression.</p> 

# Operation Settings

Set and change operation-related functions.

## Display Capture

This function captures the content displayed on the LCD screen and saves it on SD card.

### Note

It takes several seconds to capture displays, during which measurement cannot be executed. To prevent the inability to perform measurement due to erroneous operation, set this function to OFF.

### ► MENU mode - [System] - [Operation] - [Display capture]

Setting value	Description
OFF	Disables the display capture function. (default value)
ON	Enables the display capture function.

### Executing display capture

Displays can be captured when [Capture] is displayed on the LCD screen. Select either the F4 function key or [Capture] on the LCD screen.

### File names

When display capture is executed, the directory "CAPTURE" is automatically created at the root directory on the SD card, and an image file of the currently displayed screen is stored to the CAPTURE directory.

The format of file names is "CAPT\*\*\*.BMP". A running number starting from 000 is automatically assigned to "\*\*\*\*".

## Saving during Switching of Bank Groups

Set whether or not to save setup data when a bank group is switched. If saving of setup data is disabled, the total time taken to switch bank groups can be shortened.

### Important

When setup data is changed at the default setting (saving of setup data set to OFF), be sure to manually save the data before you switch bank groups. Otherwise, the newly changed setup data is cleared.



Saving Setup Data p.36

### ► MENU mode - [System] - [Operation] - [Save at Switch BG]

Setting value	Description
ON	Saves setup data when a bank group is switched.
OFF	Does not save setup data when a bank group is switched. (default value)

## Password

You can set a password for enabling switching to other modes to prevent erroneous operation.

### Note

If you have forgotten your password, you can confirm it by entering the PASSWORD command via the serial interface.



Serial Communication Command Reference

### ► MENU mode - [System] - [Operation] - [Password] - [MENU/ADJ/RUN mode]

Setting value	Description
OFF	No password is set for moving to other modes. (default value)
ON	A password must be input to switch to other modes.

### ► MENU mode - [System] - [Operation] - [Password]

Setting value	Description
Password settings	Sets the password.

## Key Lock in RUN Mode

Menu buttons and operation of the touch panel in the RUN mode can be locked to prevent erroneous operation. Note, however, that mode switching is not locked.

### ► MENU mode - [System] - [Operation] - [RUN mode key lock]

Setting value	Description
OFF	The key lock is disabled. (default value)
ON	The key lock is enabled.

## AUTO button (RUN mode)

In the RUN mode, all measurement items can be batch-set automatically by pressing the [AUTO] button. AUTO setting content differs with each measurement item.



For details, see "AUTO Setting" p.182 .

### ► MENU mode - [System] - [Operation] - [AUTO Button (RUN mode)]

Setup Item	Description
ON	In the RUN mode, when the [AUTO] button is pressed, automatic setting of all measurement items is executed.
OFF	In the RUN mode, the [AUTO] button does not function.

## Save With AUTO Button

This function enables "AUTO setting" to be automatically saved after AUTO execution in RUN mode.

### Important

All settings will be deleted if you turn the power OFF without saving the settings.

### ► MENU mode - [System] - [Operation] - [Save With AUTO Button]

Setup Item	Description
ON	Settings are saved immediately after AUTO Button in RUN mode is executed. Settings are not deleted even if the power is turned OFF. Note, however, that measurement is not possible while an AutoSave is being executed.
OFF	AutoSave is not performed after AUTO Button in RUN mode is executed.

# Measurement Control Conditions

Set and change measurement processing-related functions.

## Measurement Image Save Conditions

Sets the conditions for saving measurement images.

### Note

#### Saving measurement images

Up to 100 images can be saved. When the number of saved images exceeds 100, new images are saved by overwriting the oldest image. Up to 50 images are saved to one camera when two cameras are connected. When the Controller is turned OFF, images saved on the Controller are cleared. Saved images only can also be cleared without turning the Controller OFF.



p.152

#### ► MENU mode - [System] - [Measure] - [Image storage]

Setting value	Description
None	Measurement images are not saved. (default value)
Only NG	Measurement images are saved only when the measurement result is NG.
All	All measurement images are saved regardless of the measurement result.

## Saved Image Delete Conditions

Sets the conditions for clearing saved images.

#### ► MENU mode - [System] - [Measure] - [Image deletion]

Setting value	Description
At bank switch	Clears saved image at bank switching. (default value)
OFF	Disables clearing of saved image at bank switching.



## Handling the ENABLE Signal

Set how the ENABLE signal is handled.

### Note ENABLE signal

The ENABLE signal is a control signal for indicating that the ZFX-C is ready to accept a measurement trigger or a command from an external device. External devices monitor the ON/OFF timing of this ENABLE signal to input the measurement trigger or commands to the ZFX.

## Operation when the TRIG signal is input during measurement

Next measurement is not executed even if the TRIG signal from an external device is input during measurement. Set whether or not to notify an external device that TRIG signal input was not accepted.

### ► MENU mode - [System] - [Measure] - [Trig in measure]

Setting value	Description
OFF	The ERR signal does not turn ON even if the TRIG signal turns ON during measurement.
ERR ON	The ERR signal turns ON when the TRIG signal turns ON during measurement. (default value) The ERR signal turns OFF when the next TRIG signal is input at the correct timing.

## Operation Conditions during Startup

Set the type of the bank data and display screen to be displayed when the Controller is started up.

### ► MENU mode - [System] - [Startup]

Setup Item	Description
Startup Bank Group	Sets the bank group No. to be displayed when the Controller is started up. (default value: 0) When bank groups 1 to 31 are selected, start up the Controller with the SD card containing the corresponding bank data attached.
Startup Bank	Sets the bank No. to be displayed when the Controller is started up. Range: 0 to 31 (default value: 0)
Startup screen	Set the screen to be displayed in the RUN mode when the Controller is started up. Range: Individual results (default value), the saved screen  <b>Important</b> When the selected display screen is inappropriate as a display target, All results/Region is displayed as the default screen. (Example: When no measurement items are registered)

# Setting/Changing the Display Language

Set the display language of the LCD screen.

## ► MENU mode - [System] - [Language]

Setting value	Description
Japanese	UI text in the LCD screen and menus is displayed in Japanese.
English	UI text in the LCD screen and menus is displayed in English.

# Setting/Changing the Date

Set the date and time of the Controller's internal calendar timer.

## ► MENU mode - [System] - [Date]

Setup Item	Description
Year, Month, Day, Hour, Minute, Second	Set the date and time units.

# Clearing Saved Images

Measurement images saved on the Controller can be cleared without turning the Controller OFF.

## ► MENU mode - [System] - [Init.] - [Clear stored images]

## Saving/Loading Data

You can back up setup data and measured image data on SD cards. Alternatively, these backed up data can be loaded to the Controller.

### Data that can be saved/loaded

- System data: Setup data under [System]
- Bank data/bank group data: Setup data under [Setup]
- Image data: Measurement image data saved internally on the Controller  
(proprietary format: color images \*.BYR, black-and-white images \*.GRY)
- Logging data: Data accumulated by the logging monitor

#### Important


During execution of a save or a load, do not input the RESET signal or turn the power OFF. Doing so might damage the data, or prevent the Controller from functioning normally when it is next started up.

### ► MENU mode - [Tool] - [Backup]

Setup Item	Description
Image data	Select the target data to perform save/load on.
Bank data	Save: Saves the target data on the Controller to SD card.
Bank group data	Load: Loads target data saved on SD card to the Controller.
System data	<b>Important</b>
Logging data	Logging data can only be saved.

#### Note

### Configuration of directory/files on SD Card

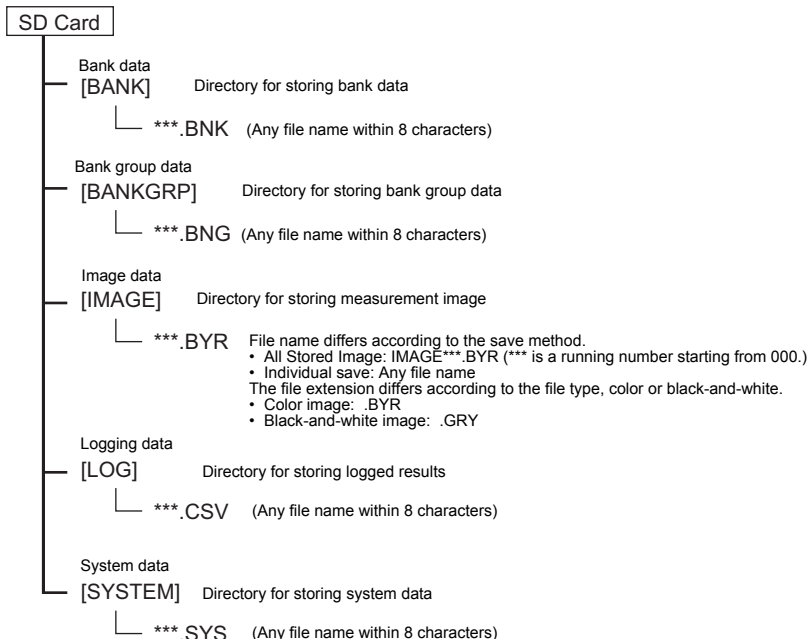

# SD Card Operations

## ► MENU mode - [Tool] - [SD card]

Setup Item	Description
File operation	Deletes or renames files, for example.

### Note


The remaining space on the SD card can be checked.

## Checking Density Distribution (Profile)

The graph indicating the density distribution of a single line in the screen is called a "profile." Profiles can be displayed for any horizontal or vertical line.


When a color camera is connected to the Controller, profiles can be displayed using a specified color filter.

## ► MENU mode - [Tool] - [Profile]

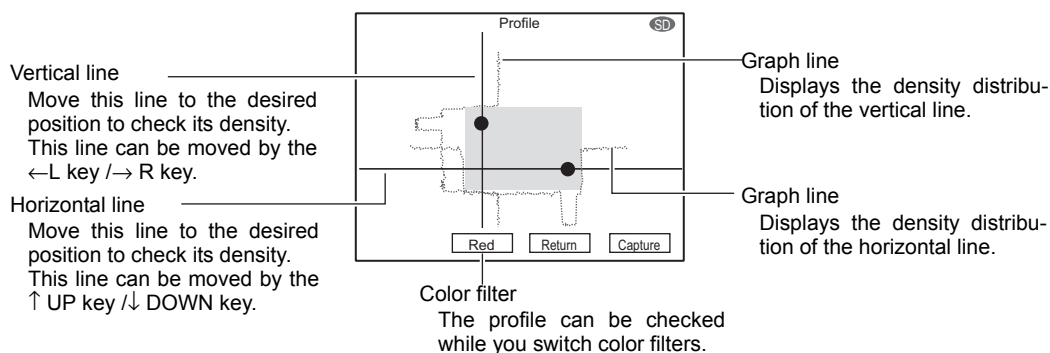

**Note****How to fully utilize the profile function**


- You can check whether or not light is illuminating the measurement target evenly.

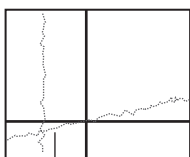

If the graph lines are inclined even though the measurement target illuminated as a uniform color on screen, you can judge that lighting is uneven.

- You can judge the extent of the density difference between the background and desired inspection location.

Example: Defect inspection

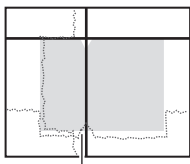


You can monitor depressions on the graph lines to the extent of density differences at certain locations.

## Checking the Communication Status with External Devices

When the Controller is connected to an external device via the RS-232C/422 interface or parallel interface, you can monitor the communication status to verify the normality of the wiring and communication setup.

### RS-232C/422 Communication

Check the communication status of the RS-232C/422 interface.

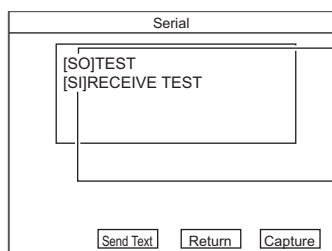

#### Display [SO]

This is the content sent to the external device.

When [Send Text] is selected, a test string is sent to the external device from the ZFX. The test string can be edited.

#### Display [SI]

This is the content received from the external device.

When a test string exceeding 16 characters is sent, characters from the 17th character onwards are not displayed.

When the echoback setting is set to [ON], the received content is sent to the external device as it is.

### Monitor conditions

Edit the test string and echoback setting.


#### ► MENU mode - [Tool] - [I/O mon.] - [RS-232C/422]

Setup Item	Description
Monitoring	The content sent to the external device and content received from the external device are displayed.
Test string	Sets the text string (maximum 16 alphanumeric characters) to be sent to the external device.

Setup Item	Description
Echoback	Sets whether or not the content received from an external device is to be returned to that device as it is. ON: The content received from an external device is sent to that device as it is. (default value) OFF: The content received from an external device is not returned.

## Parallel Communication

You can check the communication status on the parallel interface.

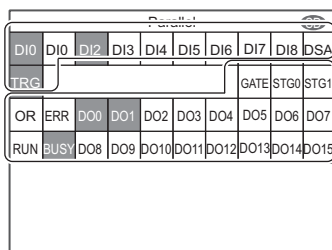

### Input signals

A reversed signal indicates that an input from an external device to the ZFX-C is ON.

### Output signals

A reversed signal indicates that an output to an external device from the ZFX-C is ON.

You can simulate turning output signals ON/OFF by selecting the signal to be tested on screen.

► MENU mode - [Tool] - [I/O mon.] - [Parallel]

## Displaying the Controller Information

Display the Controller's system information. This information allows you to check the version, memory usage, and other information.

► MENU mode - [Tool] - Sys Info]

Setup Item	Description
Version	Displays the Controller's version.
Memory capacity	Displays the memory usage.
Error history	Displays up to five of the latest I/O-related errors, as well as the date and time when the error occurred.
Clear error history	Clears the error log. The ERROR signal turns OFF when the error log is cleared.

**Note****Error display items**

The error display items displayed at [Error history] are as follows:

When an error is displayed, perform the appropriate remedy according to the indicated remedy.

Display Item	Cause	Remedy
Trigger input	The trigger signal acceptance error occurred since the trigger was input when the ENABLE signal was OFF.	When using a PLC, change the PLC ladder program so that triggers can be input when the ENABLE signal is ON. If the ladder program is normal, check to see if the trigger signal is causing chattering.
Parallel command	The command error occurred since the parallel command confirmation signal (DI8) was input when the ENABLE signal was OFF, or the specified command (DI7 to DI5) was an undefined signal state.	When using a PLC, change the PLC ladder program so that the DI8 signal can be input when the ENABLE signal is ON. If the ladder program is normal, check to see if the DI8 signal is causing chattering. Also, check to see if the DI7 to DI5 signals are at the signal level of the command to be executed, and applied before the DI8 signal is input.
SD CARD access	A write error occurred since the measurement result could not be output correctly to the SD card.	Check the following: <ul style="list-style-type: none"> <li>• Make sure that the CD card is inserted properly.</li> <li>• Make sure that the SD card is not locked.</li> </ul>
Parallel timeout	A time-out error occurred since the time to process the following events exceeded the fixed time (default: 10 seconds) during handshaking. <ul style="list-style-type: none"> <li>• Measurement end → DSA signal ON</li> <li>• GATE signal ON → DSA signal OFF</li> <li>• GATE signal OFF → DSA signal ON</li> </ul>	Check the ladder program to see if handshaking has been correctly executed on the PLC.
USB connection	An output error occurred since the measurement result could not be output correctly via the USB interface.	Check to see if the USB cable is inserted correctly.
LAN connection	An output error occurred since the measurement result could not be output correctly via the LAN.	Check to see if the LAN cable is inserted correctly. Check to see if the LAN communication condition is set correctly.
Image input	The following caused a communication error between the camera and Controller: <ul style="list-style-type: none"> <li>• Faulty connector contacts</li> <li>• Broken cable leads</li> <li>• Noise-induced data corruption</li> </ul>	Check the camera cable to see if it is connected correctly between the camera and the Controller. Replace the cable if its leads are broken. If this does not remedy the problem, a probable cause is that the communications error is occurring due to noise buildup on the camera cable. Move the camera and Controller away from noise-generating sources.
VDIN timeout	The following caused a communications error between the camera and Controller: <ul style="list-style-type: none"> <li>• Faulty connector contacts</li> <li>• Broken cable leads</li> <li>• Noise-induced data corruption</li> </ul>	Check the camera cable to see if it is connected correctly between the camera and the Controller. Replace the cable if its leads are broken. If this does not remedy the problem, a probable cause is that the communications error is occurring due to noise buildup on the camera cable. Move the camera and Controller away from noise-generating sources.
Camera communication	The following caused a communication error between the camera and Controller: <ul style="list-style-type: none"> <li>• Faulty connector contacts</li> <li>• Broken cable leads</li> <li>• Noise-induced data corruption</li> </ul>	Check the camera cable to see if it is connected correctly between the camera and the Controller. Replace the cable if its leads are broken. If this does not remedy the problem, a probable cause is that the communications error is occurring due to noise buildup on the camera cable. Move the camera and Controller away from noise-generating sources.

MEMO



# PARALLEL INTERFACE


<b>Connection</b>	<b>160</b>
Parallel Connector Specifications	160
<b>Internal Specifications</b>	<b>164</b>
<b>Signal I/O</b>	<b>166</b>
Input Signal	166
Output Signal	168
<b>Timing Charts</b>	<b>171</b>
Measurement (Handshaking OFF)	171
Measurement (Handshaking ON)	174
Commands Other than for Measurement	175
Signal Operation in terms of Measurement	176

# Connection

Signals such as measurement triggers can be input to the Controller, and signals such as measurement results can be output from the Controller via its parallel interface. Prepare a parallel I/O cable, and connect it to the Controller's parallel port for using the parallel interface to input commands and output measurement results.

## Parallel Connector Specifications

The Controller has two parallel ports; a standard parallel port and an extended parallel port.

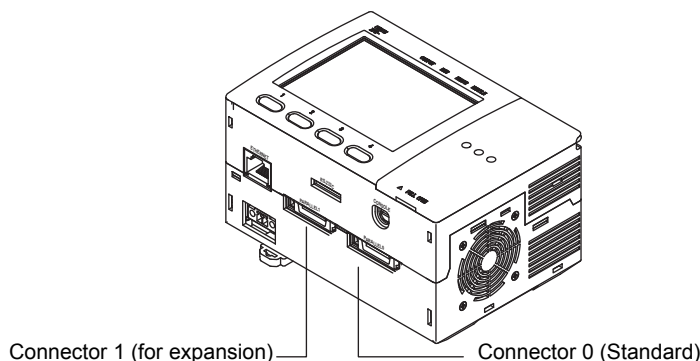


### Important

Before the Controller is turned ON, make sure that connectors 0 and 1 are wired correctly. If these connectors are wired in reverse, the cables or external devices may be damaged.

### Parallel I/O Connector 0 (Standard Parallel Port)

Wire the Terminal Block Adapter (supplied) and plug it into the Controller's parallel I/O connector 0.

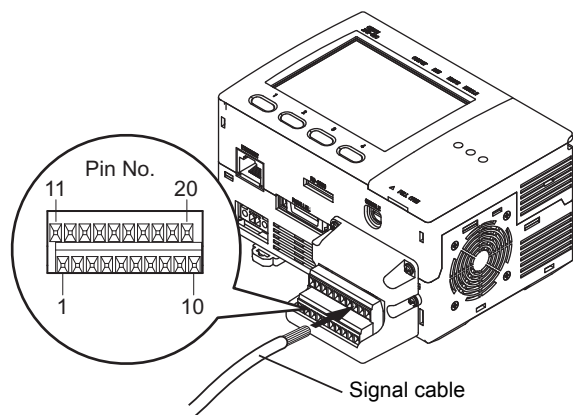

- Cable diameter: 0.14 to 1 mm<sup>2</sup>  
(AWG26 to 16 twisted lead)
- Cable length: 30 m
- Tightening torque for the respective wire:  
0.22 to 0.25 N•m
- Tightening torque for the Terminal Block  
Adapter: 0.3 N•m
- Terminal block adapter mounting screws:  
M2.6 x 7 screws  
(accessories, 4 p'ces)

### Important

Use only the provided screws to mount the terminal block adaptor. If the screws of a different length are used, the product may be damaged.

### Note

Instead of the Terminal Block Adapter, the parallel I/O cable (ZFX-VP) can be connected to it as well. The wiring of the parallel I/O cable is the same as that of the parallel I/O connector 1.

The pin assignment is as follows. Wire only required pins.

Pin No.	Signal name	Wire color (ZFX-VP)	Signal direction	Function
1	RESET	Brown	Input	Restarts the ZFX.
2	TRIG	Red	Input	Measurement trigger signal input
3	DI0	Orange	Input	Command parameter
4	DI1	Yellow	Input	
5	DI2	Green	Input	
6	DI3	Blue	Input	
7	DI4	Purple	Input	
8	DI5	Gray	Input	Command input
9	DI6	White	Input	
10	DI7	Black	Input	
11	DI8	Brown	Input	Parallel command confirmation signal
12	DSA	Red	Input	Data send request signal input
13	OR	Orange	Output	Overall judgment output
14	ERROR	Yellow	Output	ON when an error occurs
15	RUN	Green	Output	ON while in the RUN mode
16	ENABLE	Blue	Output	ON when measurement trigger signal can be input
17	GATE	Purple	Output	ON for the preset output time
18	DO15	Gray	Output	Data output
19	COMIN	White	-	Common for input signals, STGOUT0 and STGOUT1
20	COMOUT	Black	-	Common for OR, ERROR, RUN, ENABLE, GATE, DO15 signals

#### Important


Be sure to wire COMIN and COMOUT as well as the I/O signals.  
For details on wiring, see the internal circuit diagrams.



Internal Specifications p.164

## Parallel I/O Connector 1 (Extended Parallel Port)

Hold down the two latch locks on both sides of the connector of the parallel I/O cable (ZFX-VP) to unlock the connector, and connect it to the Controller's parallel I/O connector 1. To lock the connector again, release the latch locks.

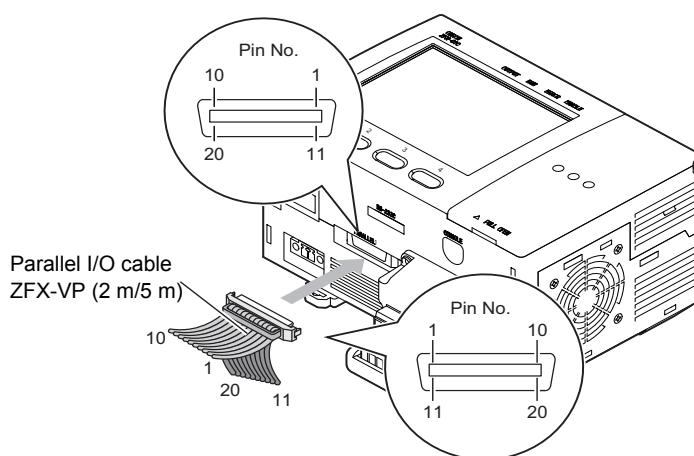

### ► Specification of a parallel I/O cable

Item	Connector	Flat cable
Manufacturer name	Hirose electric Co. Ltd.	Hitachi Cable, Ltd.
Model number	FX2B-20SA-1.27R	UL20012-ST10X28AWG
Electric wire size (thickness)	-	0.89 mm
Total cable width	-	12.70 mm
Cable length	-	2 m/5 m

Pin No.	Signal name	Wire color (ZFX-VP)	Signal direction	Function
1	STGOUT0	Brown	Output	Strobe trigger 0 output (for camera 0) *1
2	STGOUT1	Red	Output	Strobe trigger 1 output (for camera 1) *1 *2
3	DO0	Orange	Output	Data output
4	DO1	Yellow	Output	
5	DO2	Green	Output	
6	DO3	Blue	Output	
7	DO4	Purple	Output	
8	DO5	Gray	Output	
9	DO6	White	Output	
10	DO7	Black	Output	
11	DO8	Brown	Output	
12	DO9	Red	Output	
13	DO10	Orange	Output	
14	DO11	Yellow	Output	
15	DO12	Green	Output	
16	DO13	Blue	Output	
17	DO14	Purple	Output	
18	COMOUT	Gray	-	Common for STGOUT0, STGOUT1, and DO0 to DO6 signals
19	(OPEN)	White	-	(Leave open.)
20	COMOUT	Black	-	Common for DO7 to DO14 signals

\*1: Use the STGOUT0 or STGOUT1 signal when you want to connect a strobe device to the ZFX.

\*2: Do not connect any signals in the case of the ZFX-C10H/C15H/C10/C15.

#### Important

Be sure to wire COMOUT as well as the I/O signals.  
For details on wiring, see the internal circuit diagrams.



Internal Specifications p.164

# Internal Specifications

## Input Specifications

### ► RESET, DI0 to DI8, and DSA signals

Mode	NPN	PNP
Input voltage	12 to 24 VDC $\pm 10\%$	12 to 24 VDC $\pm 10\%$
ON current *1	5 mA min.	5 mA min.
ON voltage *1	8.8 V min.	8.8 V min.
OFF current *2	0.5 mA max.	0.5 mA max.
OFF voltage *2	1.1 V max.	1.1 V max.
ON delay	5 ms max.	5 ms max.
OFF delay	0.7 ms max.	0.7 ms max.
Internal circuit diagram		

### ► TRIG signal

Mode	NPN	PNP
Input voltage	12 to 24 VDC $\pm 10\%$	12 to 24 VDC $\pm 10\%$
ON current *1	5 mA min.	5 mA min.
ON voltage *1	8.8 V min.	8.8 V min.
OFF current *2	0.5 mA max.	0.5 mA max.
OFF voltage *2	0.8 V max.	0.8 V max.
ON delay	0.1 ms max.	0.1 ms max.
OFF delay	0.1 ms max.	0.1 ms max.
Internal circuit diagram		



\*1: The ON current/voltage is the value of the current/voltage that changes the status from OFF to ON. The value of the ON voltage is the potential difference between COM IN and each input terminal.

\*2: The OFF current/voltage is the value of the current/voltage that changes the status from ON to OFF. The value of the OFF voltage is the potential difference between COM IN and each input terminal.



\*3: The ON/OFF delay time for TRIG signal is different from the circuit diagram for RESET, DI0 to DI8, and DSA signals.

## Output Specifications

### ►OR, ERROR, RUN, ENABLE, GATE, DO0 to DO15 signals

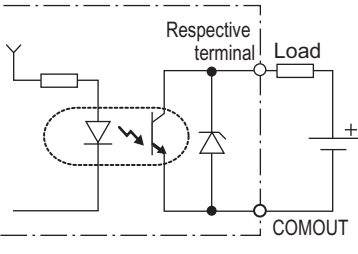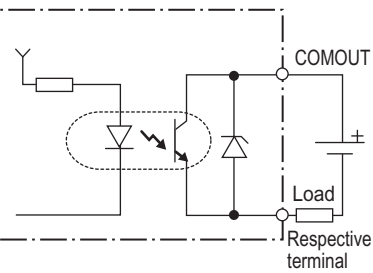Mode	NPN	PNP
Output voltage	12 to 24 VDC $\pm 10\%$	12 to 24 VDC $\pm 10\%$
Load current	45 mA max.	45 mA max.
ON residual voltage	2 V max.	2 V max.
OFF leakage current	0.2 mA max.	0.2 mA max.
Internal circuit diagram		

### ►STGOUT 0 to 1 signals

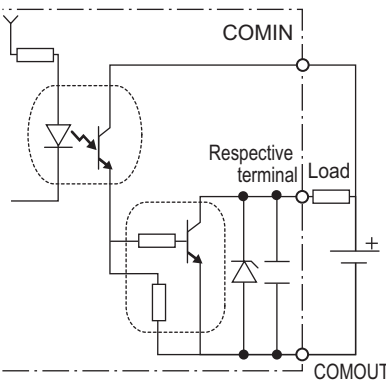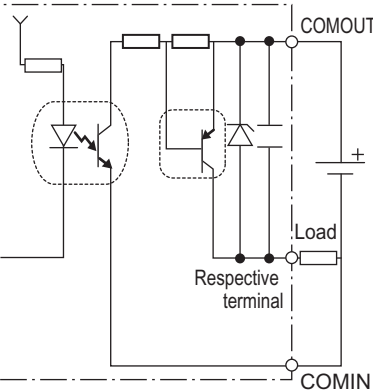Mode	NPN	PNP
Output voltage	12 to 24 VDC $\pm 10\%$	12 to 24 VDC $\pm 10\%$
Load current	45 mA max.	45 mA max.
ON residual voltage	2 V max.	2 V max.
OFF leakage current	0.2 mA max.	0.2 mA max.
Internal circuit diagram		

#### Important

Connect a load that matches the output specifications. Otherwise, a short-circuit may occur, which will cause the Controller to break down.

# Signal I/O

## Input Signal


The following signals can be input when the ZFX-C is in the RUN mode.

### Measurement Timing Input

A one-time measurement is performed if the TRIG signal is turned ON.

### Command Input

#### Input format

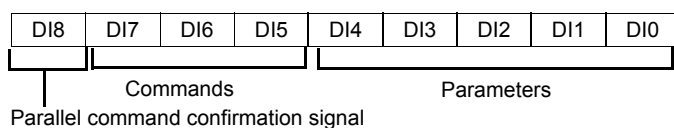

#### Commands

Signals DI0 to DI7 can input the following commands. Allow at least 5 ms after DI0 to DI7 are determined to be ON before turning DI8 ON.

#### Note

With the model re-registration setting commands, item Nos.0 to 31 can be registered. Item No.32 onwards cannot be registered by these commands. They can be registered by serial communication commands.

Command	Description	Command code			Parameter (binary code)				
		DI7	DI6	DI5	DI4	DI3	DI2	DI1	DI0
Continuous measurement	Measurements continue while the command is being input.	0	0	0	*	*	*	*	*
Bank switching	Switches the bank to measure.	0	1	0	Bank number				
Bank group switching	Switches the bank group data.	1	1	0	Bank group number				
Model re-registration	Registers the model again based on the last measurement image that was read. (Flexible search cannot be re-registered)	1	0	0	Item number				
Clear measured data	Clears the following measurement results: <ul style="list-style-type: none"><li>• Judgment results and measurement values of measurement items</li><li>• Judgment results and measurement values of expressions</li><li>• Logging data</li><li>• Parallel output signals (OR, DO0 to DO15)</li></ul>	1	0	1	0	0	0	0	0



Command	Description	Command code			Parameter (binary code)				
		DI7	DI6	DI5	DI4	DI3	DI2	DI1	DI0
Clear error	Clears the error output results. The parallel output signal (ERROR) is turned OFF to turn the ERROR LED OFF.	1	0	1	0	0	0	0	1
Clear parallel terminal	Clears the parallel output signals (OR, DO0 to DO15).	1	0	1	0	0	0	1	0
AUTO setting	Automatically batch-sets all measurement items.	1	1	1	*	*	*	*	*

In the above table, a "0" indicates the signal is OFF, a "1" indicates the signal is ON. A "\*" indicates that the ZFX-C does not read the bit status, so the bit status can be either 0 or 1.

**Note**

AUTO setting content differs with each measurement item.




See "AUTO Setting" p.182.

► Example


Command	Description	Command code			Parameter (binary code)				
		DI7	DI6	DI5	DI4	DI3	DI2	DI1	DI0
Bank switching	Switching to bank 0.	0	1	0	0	0	0	0	0
	Switching to bank 1.	0	1	0	0	0	0	0	1
	Switching to bank 2.	0	1	0	0	0	0	1	0
	:	:							
	Switching to bank 31.	0	1	0	1	1	1	1	1
Bank group switching	Switching to bank group 0.	1	1	0	0	0	0	0	0
	Switching to bank group 1.	1	1	0	0	0	0	0	1
	Switching to bank group 2.	1	1	0	0	0	0	1	0
	:	:							
	Switching to bank group 31.	1	1	0	1	1	1	1	1
Model re-registration	Re-registering the model of item 0.	1	0	0	0	0	0	0	0
	Re-registering the model of item 1.	1	0	0	0	0	0	0	1
	Re-registering the model of item 2.	1	0	0	0	0	0	1	0
	:	:							
	Re-registering the model of item 31.	1	0	0	1	1	1	1	1

# Output Signal

Measurement results are output each time a measurement is made. Measurement values and judgment results can be output as the measurement results. Up to 32 data are output respectively (except for overall judgment result outputs.) They are output for the number of times in the expression set at "Calculation".

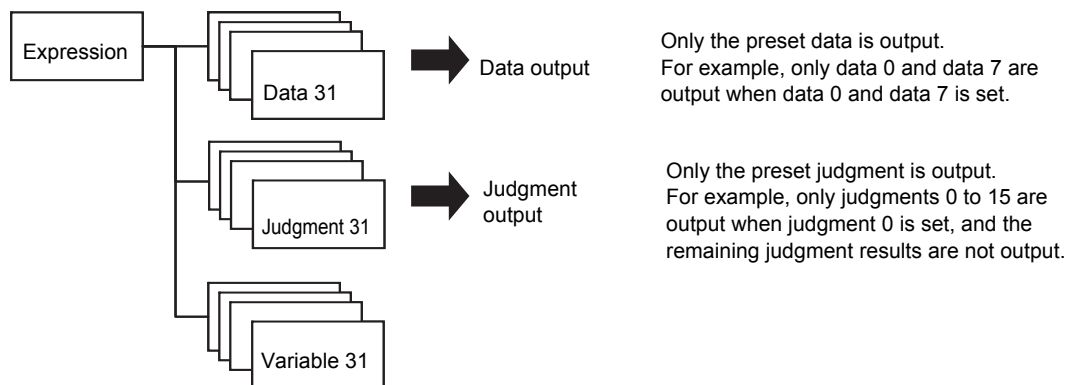

Data is output only when the ZFX-C is in the RUN mode; data is not output when the ZFX-C is in ADJ mode.

 p.117

## Note

After measurements have been made in the RUN mode, the data that is output to the OR and DO signals is retained until new measurements are made in the RUN mode. The status of these output is retained even if the ZFX-C is switched from the RUN mode to another Mode.

### Overall judgment result


The ZFX-C outputs the OR signal indicating the overall judgment result. The following items can be specified whether or not to be included in the overall judgment result. The user can select whether a signal is output when the overall judgment result is OK or NG.


 Setting Reflection of Individual Results p.121

- Position correction item
- Measurement item
- Calculation (variable) result
- Calculation (judgment) result
- Logging monitor warning

### Individual judgment result

The judgment results based on the expressions that were set in the [Add func/Calculation/Judge/judge 0 to 31] are output to DO0 to DO15. The user can select whether a signal is output when the judgment result is OK or NG. The default setting is for a signal to be output when the judgment result is NG.

 Calculation p.117

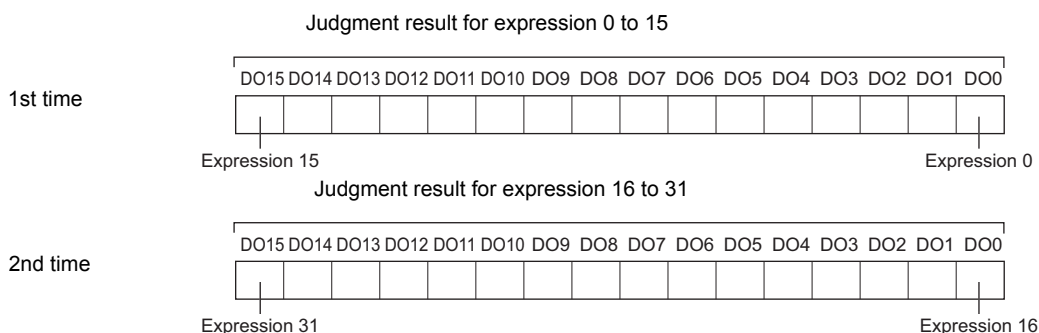


Up to 32 individual judgment results are output. No data is output when the judgment is not set in the Expression.

## Measurement Value Output

 The measurement values for expressions that were set in 0 to 31 of [Add func/Calculation/Data] is output before the judgment results output, when "Parallel Output ON" was selected as the data output destination in the [System/Output/Data output] menu.

Only integer values are output. (The real values are rounded to the nearest integer.) Data is output in 2's complement format.

The measurement values for respective expressions are output in 16-bit at a time. When two or more expressions are set, 16-bit measurement values are output sequentially by the number of times equivalent to the set expressions.



### Note

Values in the range -32,768 to 32,767 can be output. A value of -32,768 will be output if the measurement is less than -32,768 and a value of 32,767 will be output if the measurement is greater than 32,767.

## Output example


When measurement value is "+1234"

DO15	DO14	DO13	DO12	DO11	DO10	DO9	DO8	DO7	DO6	DO5	DO4	DO3	DO2	DO1	DO0
0	0	0	0	0	1	0	0	1	1	0	1	0	0	1	0

When measurement value is "-1234"

DO15	DO14	DO13	DO12	DO11	DO10	DO9	DO8	DO7	DO6	DO5	DO4	DO3	DO2	DO1	DO0
1	1	1	1	1	0	1	1	0	0	1	0	1	1	1	0

## Output timing example

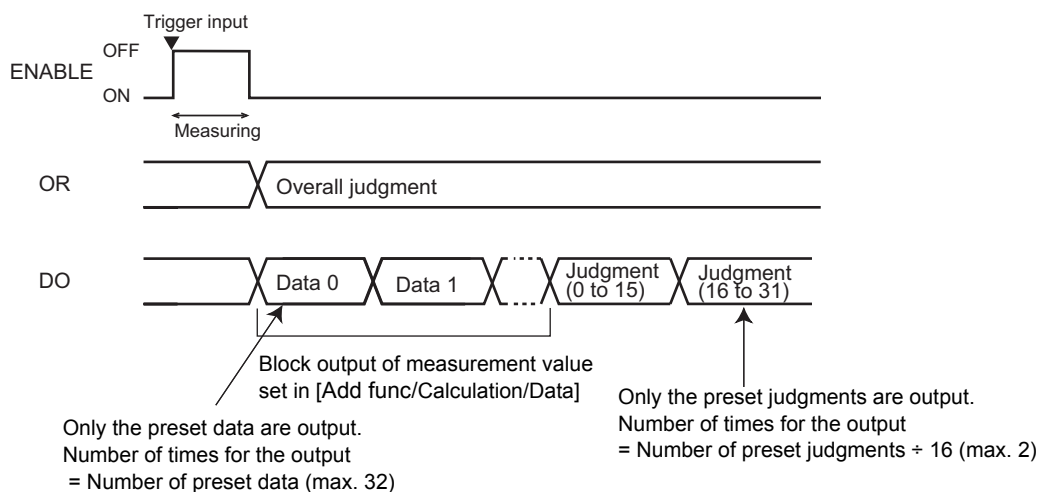


# Timing Charts

## Measurement (Handshaking OFF)

When handshaking is set to OFF, the ZFX-C outputs measurement results to the external device without synchronizing communications. Monitor the ZFX-C's GATE signal from the external device and read the measurement results at the external device while the ZFX-C's GATE signal is ON.

### Trigger Measurement

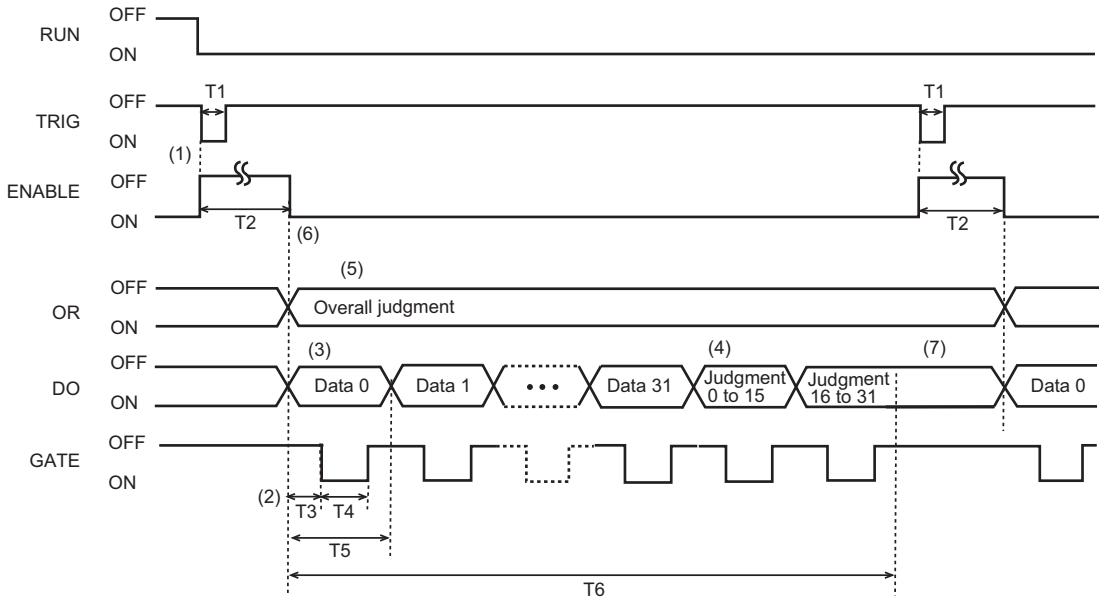


T1: Trigger input time	Set to ON for at least 0.5 ms.
T2: Measurement time	This time is "image input" + "measurement". This time can be changed to only "image input" or "image input" + "measurement" + "display".
T3: Gate ON delay	This is the time to wait until stable output data can be obtained. This time can be changed.
T4: Gate ON time	This is the time required for the external device to capture output data from the Controller. This time can be changed.
T5: Output cycle	This is the interval in which the DO signal state changes. This time can be changed.
T6: Total output time	This time is equivalent to "output cycle (T5) x number of output data items". Input the trigger at an interval longer than this time. When the total output time is longer than T2, non-output data accumulates in the Controller as the next measurement is executed before measurement results are output. When the Controller becomes filled up with this non-output data, data can no longer accumulate in the Controller. When this happens, output of non-output data continues, and the next measurement is no longer possible until queued data has finished accumulating.

### ► Explanation of operation

- (1) When the measurement trigger (TRIG signal) is input from the external device, measurement is executed once synchronized with the rising edge of the TRIG signal (OFF → ON).
- (2) The GATE signal is used to control the timing at which the external device captures measurement results. Set the Gate ON delay (T3) and Gate ON time (T4) so that  $T3+T4 < T5$ .
- (3) When parallel output is set to "ON" as the data output destination, data is output for the number of times in the expression set at "Calculation (data)" (maximum 32 times). When parallel output is OFF, data is not output.
- (4) When parallel output is set to "ON" as the judgment output destination, judgment is output for the number of times in the expression set at "Calculation (judgment)" (maximum twice). When parallel output is OFF, judgment is not output.
- (5) The overall judgment is output. Overall judgment is NG if there is even one NG for the preset measurement items and judgment results in the expression. In the case of level output, the ON/OFF status of the OR signal does not change until the next output as shown in this example.
- (6) When the timing for turning the ENABLE signal ON is set to "end of image input", a delay occurs until output is started after the ENABLE signal turns ON as measurement is also executed after the ENABLE signal turns ON. Do not input the next trigger until measurement is completed.
- (7) The last output of DO is retained until the next trigger is input, even if an output period is set. This applies no matter whether the last output is data output or judgment output.

## Continuous Measurement

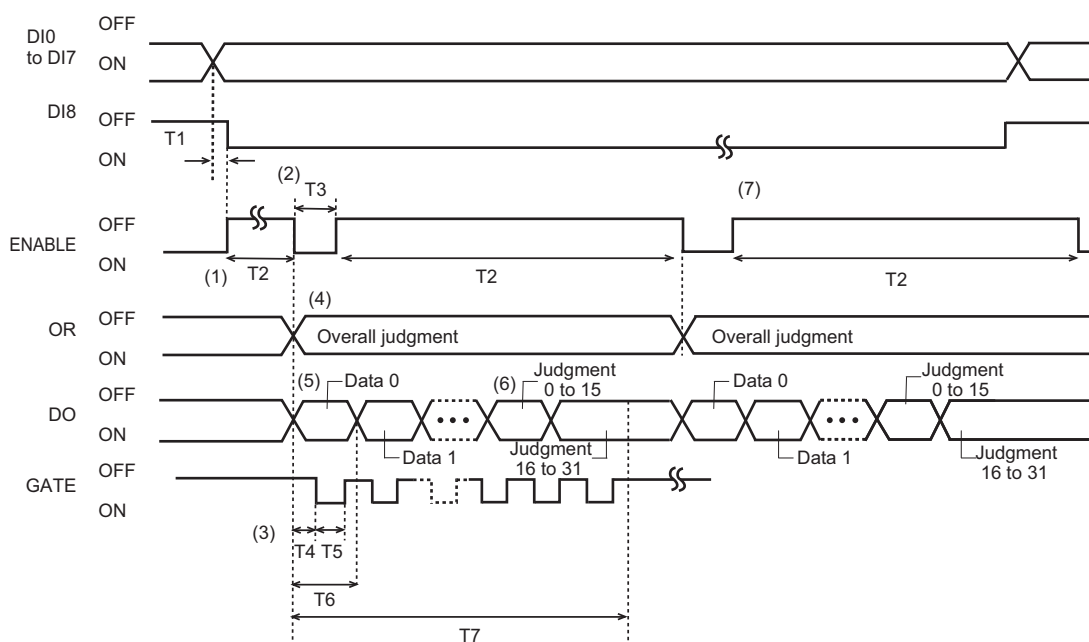

T1: Execution trigger delay time	This is the delay time until the execution trigger DI8 signal is input after commands are set to DI0 to DI7. Set a delay of at least 5 ms.
T2: Measurement time	This time is "image input" + "measurement". This time can be changed to only "image input" or "image input" + "measurement" + "display".
T3: Measurement interval time	This time changes according to the ENABLE signal conditions."

T4: Gate ON delay	This is the time to wait until stable output data can be obtained. This time can be changed.
T5: Gate ON time	This is the time required for the external device to capture output data from the Controller. This time can be changed.
T6: Output cycle	This is the interval in which the DO signal state changes. This time can be changed.
T7: Total output time	This time is equivalent to "output cycle (T6) x number of output data items". Set the total output time to be shorter than the measurement time (T2). When the total output time is longer than T2, non-output data accumulates in the Controller as the next measurement is executed before measurement results are output. When the Controller becomes filled up with this non-output data, data can no longer accumulate in the Controller. When this happens, output of non-output data continues, and the next measurement is no longer possible until queued data has finished accumulating.


### ► Explanation of operation

- (1) Continuous measurement is started synchronized with the rising edge of the DI8 signal (OFF → ON).
- (2) When the timing for turning the ENABLE signal ON is set to "end of image input", a delay occurs until output is started as measurement is also executed after the ENABLE signal turns ON. The timing of measurement result output (OR, DO) does not change even if the ENABLE signal ON timing is set to "end of image input" or "display end".
- (3) The GATE signal is used to control the timing at which the external device captures measurement results. Set the Gate ON delay (T4) and Gate ON time (T5) so that  $T4+T5 < T6$ .
- (4) The overall judgment is output. Overall judgment is NG if there is even one NG for the preset measurement regions and judgment results in the expression. In the case of level output, the ON/OFF status of the OR signal does not change until the next output as shown in this example.
- (5) When parallel output is set to "ON" as the data output destination, data is output for the number of times in the expression set at "Calculation (data)" (maximum 32 times). When parallel output is OFF, data is not output.
- (6) When parallel output is set to "ON" as the judgment output destination, judgment is output for the number of times in the expression set at "Calculation (judgment)" (maximum twice). When parallel output is OFF, judgment is not output.
- (7) If DI0 to DI7 are in the continuous measurement command execution status and DI8 is ON when measurement processing ends, the next measurement is executed. The next measurement is also executed after display processing is executed when the timing that the ENABLE signal turns ON is set to "display end." When the timing is set to other than "display end," the next measurement is executed as soon as measurement ends.

# Measurement (Handshaking ON)

When handshaking is set to ON, the ZFX-C outputs measurement results to the external device while synchronizing communications. Handshaking is effective when multiple measurement results are output in numerical order and the handshaking function transfers data with more certainty.

## Trigger Measurement

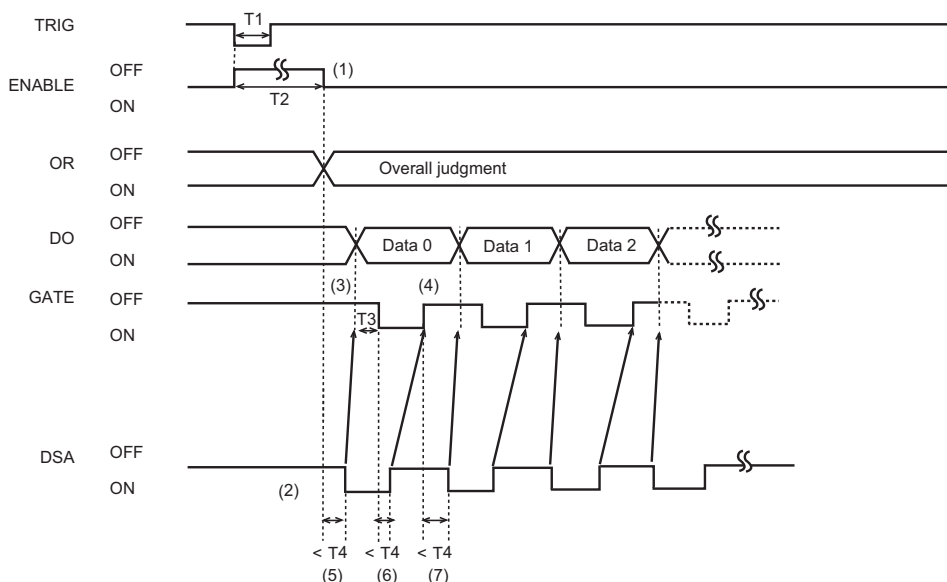

<b>T1:</b> Trigger input time	Set to ON for at least 0.5 ms.
<b>T2:</b> Measurement time	This time is "image input" + "measurement". This time can be changed to only "image input" or "image input" + "measurement" + "display".
<b>T3:</b> Gate ON time	This is the time to wait until stable output data can be obtained. This time can be changed.
<b>T4:</b> Timeout time	This is the time-out time for the following operations. <ul style="list-style-type: none"> <li>• Measurement end → DSA signal ON</li> <li>• GATE signal ON → DSA signal OFF</li> <li>• GATE signal OFF → DSA signal ON</li> </ul> The default time-out time is 10 s. This time can be changed.


### ► Explanation of operation

- (1) When measurement ends, the ENABLE signal turns ON.
- (2) The DSA signal turns ON by the external device requesting data transmission.
- (3) When the DSA signal turns ON, the DO signal is output.
- (4) When the DSA signal turns OFF, the GATE signal also turns OFF.
- (5) A time-out error occurs if the DSA signal does not turn ON during the preset time-out time after measurement ends.
- (6) A time-out error occurs if the DSA signal does not turn OFF during the preset time-out time after the GATE signal turns ON.
- (7) When multiple data items are being output for a single measurement, a time-out error occurs if the DSA signal does not turn ON with the preset time-out time after the GATE signal turns OFF.



# Commands Other than for Measurement

## Bank switching/Bank group switching/Model re-registration

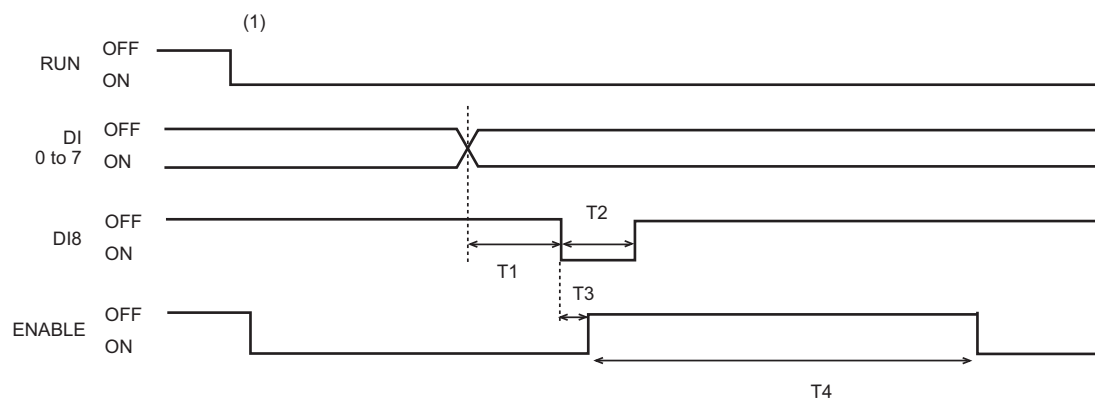


T1: Executing trigger delay time	This is the delay time until the execution trigger DI8 is input after commands are set to DI0 to DI7. 5 ms or more.
T2: Executing trigger ON time	5 ms or more
T3: Execution delay time	0.5 ms or less
T4: ENABLE OFF time	This time varies depending on settings for banks, bank groups, model registration.

### ► Explanation of operation

(1) The command input is accepted only in the RUN mode.

# Signal Operation in terms of Measurement

## Trigger Input

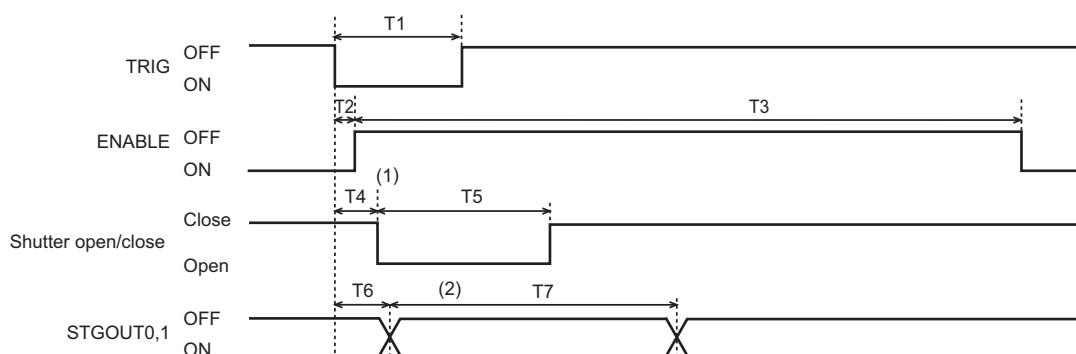


<b>T1:</b> Trigger input time	Set to ON for at least 0.5 ms.
<b>T2:</b> ENABLE output response time	This is the time after the trigger is input until the ENABLE signal turns OFF. 0.5 ms or less
<b>T3:</b> Measurement time	This time is "image input" + "measurement". This time can be changed to only "image input" or "image input" + "measurement" + "display".
<b>T4:</b> Trigger delay time	This is the time after trigger input until the camera's shutter is opened (max. 65.535 ms). This time can be changed for each camera. This time can be set only when the ZFX-C2_ is used.
<b>T5:</b> Shutter time	This is the time that the image is captured (max. 2 ms). This time can be changed by the shutter speed setting for each camera.
<b>T6:</b> Strobe delay time	This is the time after trigger input until the Controller outputs the STGOUT signal (max. 65.535 ms). This time can be changed for each camera.
<b>T7:</b> Strobe pulse width	This is the strobe trigger output time (max. 65.535 ms). This time can be changed for each camera.

### ► Explanation of operation

- (1) When two cameras are connected, delay the shutter open/close timing of cameras 0 and 1 by the trigger delay time (T4) to prevent mutual interface.
- (2) The STGOUT signal is used to output the strobe firing trigger to the strobe device connected to the Controller. After the shutter opens, the STGOUT signal is output after the STGOUT delay time (T6) has elapsed, and the strobe fires. The ON/OFF polarity of the STGOUT signal can be changed.

## ENABLE Signal Output

The following three output pattern can be specified for ENABLE signal.

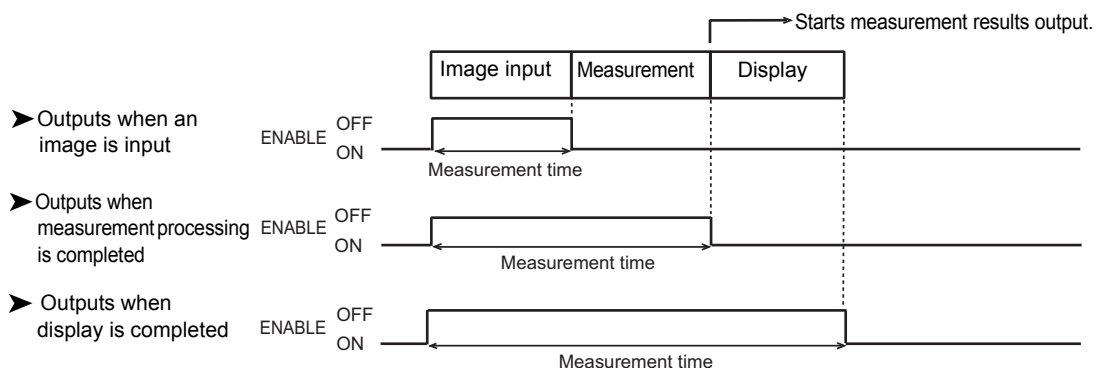


## OR Signal Output

The following two output pattern can be specified for the OR signal.


### ► Level output

Output of the overall judgment is retained until output of the next overall judgment.

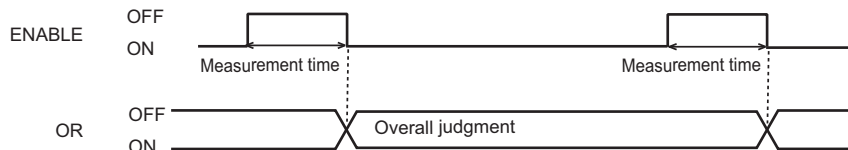

### ► One-shot output


The OR signal is remained to be ON during the output time set in [System/Comm/OR output/Output time] when [One-shot] is set in [System/Comm/OR output/Output mode].

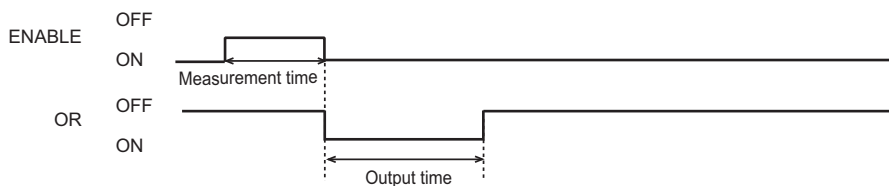

## Operation at Startup

This section shows the Controller's operation when it is powered ON in the RUN mode.

The following describes the order in which signals change.

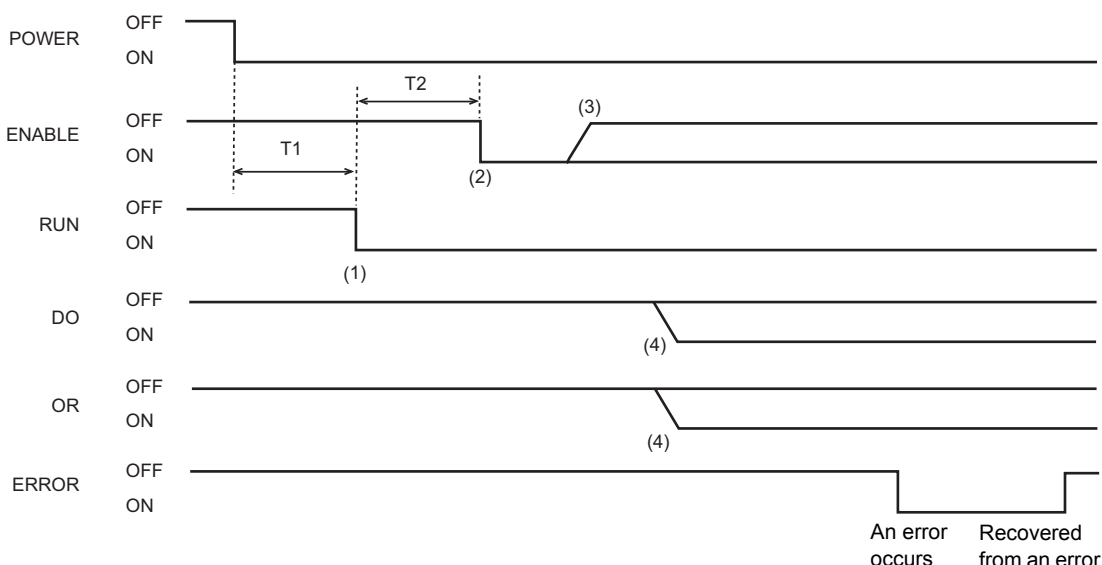

T1: Startup processing at power ON	The time required changes according to the settings.
T2: RUN mode initialization processing	The time required changes according to the settings.

### ► Explanation of operation

- (1) The RUN signal turns ON when the startup process is completed after the Controller is powered ON in the RUN mode.
- (2) When the RUN signal turns ON, initialization processing in the RUN mode is performed. When the initialization processing is completed, the ENABLE signal turns ON and command inputs can be accepted.
- (3) The ENABLE signal turns OFF when the Controller accepts command and stays OFF during processing commands.
- (4) The signal turns ON/OFF after output of data such as measurement results.

## Reset Input

Set the RESET signal to ON for at least 10 ms.

# APPENDICES

---

<b>Error Messages and Corrective Actions</b>	<b>180</b>
<b>List of Available Functions for Each Camera</b>	<b>181</b>
<b>AUTO Setting</b>	<b>182</b>
AUTO Setting of Measurement Items	182
AUTO Setting in Individual Adjustment Screens	184
<b>Specifications and External Dimensions</b>	<b>186</b>
Camera	186
Controller	196
Accessories & Options	199
<b>LED Safety</b>	<b>212</b>
<b>Basic Knowledge for Operation</b>	<b>213</b>
<b>Menu List</b>	<b>217</b>
<b>INDEX</b>	<b>221</b>
<b>How Color Images are Processed</b>	<b>225</b>
Color Filter	226
Color Pickup	228
Hue, Saturation and Brightness Value	230
<b>Version Upgrade Information</b>	<b>231</b>
<b>Revision History</b>	<b>234</b>

# Error Messages and Corrective Actions

The following shows error messages that are displayed on the LCD screen and their corrective actions.

Error message	Probable cause	Reference
Draw at least one OR figure.	The NOT figure mode is used to delete part of a drawn area. Draw in the OR region.	p.215
SD card access error	An error occurred during accessing of the SD card. <ul style="list-style-type: none"> <li>• Make sure that the SD card is inserted.</li> <li>• Make sure that the SD card is not locked.</li> <li>• Make sure that the attribute of files on the SD card is not read-only.</li> <li>• Make sure that the SD card has not run out of free space.</li> </ul>	-
Illegal syntax in expression.	An operation expression setting is probably illegal as follows: <ul style="list-style-type: none"> <li>• The number of brackets on the left and right differ.</li> <li>• The region Nos. are continuous.</li> <li>• The operators are continuous.</li> <li>• The constants are continuous.</li> <li>• The functions are continuous.</li> <li>• There are not enough or too many function arguments.</li> </ul>	p.117
Automatic setting failed.	Make sure that images are being captured appropriately. If images are too dark, adjust the shutter speed or the brightness of the lighting.	p.106, 108
Camera error	A camera connection error occurred. Make sure that the connector between the camera and the Controller is connected correctly.	p.29
Calibration failed.	Execute sampling or specify points at three locations that are not on a straight line.	p.109
SYSTEM ERROR (BOOT error)	A hardware error occurred. A probable cause is a Controller malfunction. Contact an OMRON sales representative.	-
Input value is incorrect.	The input numerical values are not within the permissible range. Change the numerical values so that they are within the permissible range.	-
Password is incorrect.	Input the correct password.	p.148
Insufficient free space of memory.	Delete unwanted banks and measurement items.	p.137
Model registration failed.	Make sure that images are being captured appropriately. If images are too dark, adjust the shutter speed or the brightness of the lighting.	p.106, 108
Loaded file is incorrect.	Specify the correct file and load the file again.	p.153
Fan error!	A fan error occurred. A probable cause is a Controller malfunction. Contact an OMRON sales representative.	-

# List of Available Functions for Each Camera

			Gain	Image Rate	Partial Function	Shutter Speed	Lighting control
Camera with lighting	Monochrome	ZFX-SR10_	Available	Available	Not available	Available <sup>(*)1</sup>	Available
		ZFX-SR50_	Available	Available	Not available	Available <sup>(*)1</sup>	Available
	Color	ZFX-SC10_	Available	Not available	Available	Available <sup>(*)1</sup>	Available
		ZFX-SC50_	Available	Not available	Available	Available <sup>(*)1</sup>	Available
		ZFX-SC90_	Available	Not available	Available	Available <sup>(*)1</sup>	Available
		ZFX-SC150_	Available	Not available	Available	Available <sup>(*)1</sup>	Not available
Camera only	Monochrome	ZFX-S	Available	Available	Not available	Available <sup>(*)1</sup>	Not available
	Color	ZFX-SC	Available	Not available	Available	Available <sup>(*)1</sup>	Not available

\*1: The shutter speed is determined by the image rate and partial function settings.

## Image Rate/Partial Function and Shutter Speeds

		Shutter Speed (s)									
		1/170 1/200 1/300 1/500	1/1000	1/1400	1/1500	1/2000	1/2500	1/3000	1/4000	1/8000	1/20000
ZFX-SR_	Image rate Fine	(*)2	Available	Available	Available	Available	Available	Available	Available	Available	Available
	Image rate Normal	(*)2	(*)2	(*)2	(*)2	Available	Available	Available	Available	Available	Available
	Image rate High speed	(*)2	(*)2	(*)2	(*)2	(*)2	(*)2	(*)2	Available	Available	Available
ZFX-SC10_ ZFX-SC50_ ZFX-SC90_	Partial function None	(*)2	Available	Available	Available	Available	Available	Available	Available	Available	Available
	Partial 1/2	(*)2	Available	Available	Available	Available	Available	Available	Available	Available	Available
	Partial 1/4	(*)2	(*)2	(*)2	(*)2	Available	Available	Available	Available	Available	Available
ZFX-SC150_ (*)1	Partial function None	(*)2	Available	Available	Available	Available	Available	Available	Available	Available	Available
	Partial 1/2	(*)2	Available	Available	Available	Available	Available	Available	Available	Available	Available
	Partial 1/4	(*)2	Available	Available	Available	Available	Available	Available	Available	Available	Available
ZFX-S	Image rate Fine	(*)2	Available	Available	Available	Available	Available	Available	Available	Available	Available
	Image rate Normal	(*)2	(*)2	(*)2	(*)2	Available	Available	Available	Available	Available	Available
	Image rate High speed	(*)2	(*)2	(*)2	(*)2	(*)2	(*)2	(*)2	Available	Available	Available
ZFX-SC	Partial function None	(*)2	Available	Available	Available	Available	Available	Available	Available	Available	Available
	Partial 1/2	(*)2	Available	Available	Available	Available	Available	Available	Available	Available	Available
	Partial 1/4	(*)2	(*)2	(*)2	(*)2	Available	Available	Available	Available	Available	Available

\*1: The LED lights for 1 ms only when it is turned ON/OFF.

\*2: These shutter speeds can be selected only when the lighting is turned OFF.

# AUTO Setting

Support functions for automatically optimally adjusting the measurement conditions are collectively referred to as the "AUTO setting."

The [AUTO] button is displayed at the bottom of screens that support execution of the AUTO setting.


The following explains the screens in which the [AUTO] button is displayed and items that are automatically set.

## AUTO Setting of Measurement Items

Basic setting of measurement items is completed by selecting the measurement item, setting measurement regions, and then executing automatic setting.


### step1

Selecting measurement items

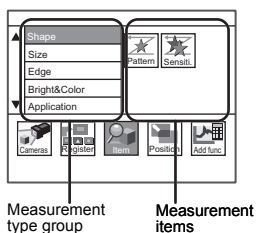

### step2


Setting measurement regions

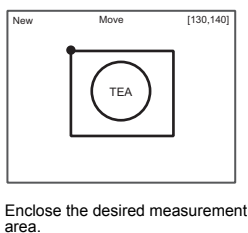

Enclose the desired measurement area.

### step3

Executing automatic setting

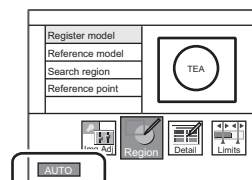

The optimum measurement conditions are automatically set just by selecting [AUTO]. Measurement conditions can also be checked and changed.

Measurement Item	Automatically set items
Pattern search	Color filter, Model image, Reference value
Graphic search	Color filter
Flexible search	Color filter, Model image (each time auto setting is executed, a new model is registered in an unregistered number, up to a maximum of 36 models)
Sensitive search	Color filter, Model image
Area	Color Pickup/Binary level, Threshold value, Brightness Control, Reference value
Labeling	Color Pickup/Binary level, Threshold value, Brightness Control, Reference value
Multi Color	Color Pickup, Threshold value, Reference value
Position	Color filter or Color Pickup/Binary level, Threshold value, Edge search color, Reference value
Width	Color filter or Color Pickup/Binary level, Threshold value, Edge search color, Reference value
Count	Color filter or Color Pickup/Binary level, Threshold value, Edge search color, Reference value
Angle	Color filter or Color Pickup/Binary level, Threshold value, Edge search color, Reference value
Brightness	Color filter, Threshold value, Reference value
HUE	Threshold value, Reference value
Grouping	Color filter
Defect	Color filter, Reference value



## List of automatically set items

Item	Explanation
Color filter	The currently displayed image is analyzed to automatically select the optimum color filter for measurement items that use a color filter.
Color Pickup/Binary level	The currently displayed image is analyzed to pick up a maximum of four candidate colors for the measurement target when a color camera is connected. Sets the binary level when a monochrome camera is connected.
Model image	The image with optimized color filter is registered as the model. When only the region is changed after AUTO setting, the model image is updated but the color filter is not updated.
Reference value	The measurement value of the currently displayed image is registered as the reference value. When the region is changed, the reference value is updated even if AUTO setting is not performed again.
Brightness control	The currently displayed image is analyzed to register the reference value of brightness.


# AUTO Setting in Individual Adjustment Screens

The ZFX displays candidates to support setting of items that take time to adjust.

## Automatic Pickup of Candidate Color

The currently displayed image is analyzed to pick up a maximum of four candidate colors for the measurement target.


 Color Pickup p.228

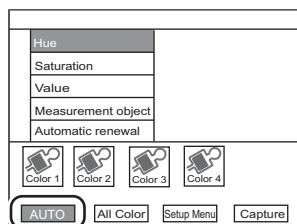


## AUTO Selection of Color Filter

The currently displayed image is analyzed to automatically select the optimum color filter.


This is used to adjust only the color filter independently of AUTO setting of measurement items.


 Color Filter p.226

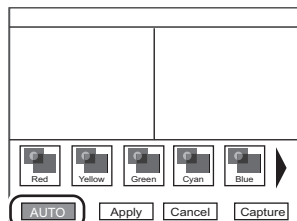

## AUTO Setting of Brightness Control

The currently displayed image is analyzed to automatically calculate and register the reference value of brightness.


 Brightness Control p.105

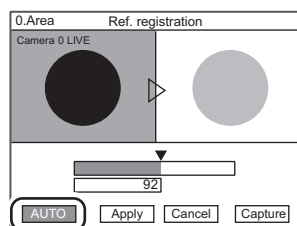

## AUTO Setting of Lighting

Candidate lighting patterns are displayed as images.

 Light Control (Recipe Functions) p.108

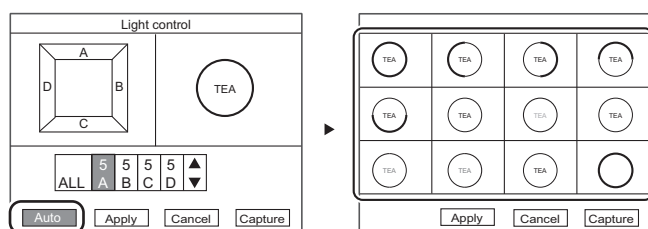




# Specifications and External Dimensions

## Camera




### Specifications

#### Camera with lighting






##### ZFX-SR10/SR50 (monochrome type)

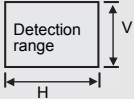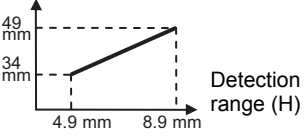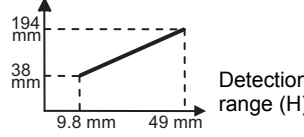Item		ZFX-SR10	ZFX-SR50
Detection range (H x V)		4.9 mm x 4.9 mm to 8.9 mm x 8.9 mm (variable range)	9.8 mm x 9.8 mm to 49 mm x 49 mm (variable range)
Setting distance (L)		34 mm to 49 mm	38 mm to 194 mm
Relationship between setting distance and detection range		Setting distance (L) 	Setting distance (L) 
Image capture element		All-pixel capture inter-line transfer type 1/3" CCD (monochrome)	
Effective number of pixels		659(H) x 494 (V)	
Pixel size		7.4 μm (H) x 7.4 μm (V)	
Shutter speed		1/170 to 1/20000 s	
Partial function (partial capture)		OFF	
Image rate function		Fine, Normal, High speed	
Frame rate (at capture of entire screen)		90 fps	
Lighting	Lighting method	Pulse lighting	
	LED	Red LED	
	Type	Direct lighting	
	Guide light	Available (center, measurement region)	
	Optional lighting I/F	Not available	
Ratings	Power supply voltage (supplied from Controller)	15 VDC	
	Current consumption	Approx. 200 mA	
Operation environment robustness	Ambient temperature range	Operating: 0 to + 40°C, Storage: -20 to +65°C (with no icing or condensation)	
	Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)	
	Ambient atmosphere	No corrosive gases allowed	
	Degree of protection	IP65 (IEC60529)	
	Dielectric strength	1000 VAC 50 Hz/60 Hz 1 min	
	Vibration resistance (durability)	10 to 150 Hz Single-amplitude 0.35 mm 10 times for 8 min each in X, Y, and Z directions	
	Shock resistance (destructive)	150 m/s <sup>2</sup> 3 times each in 6 directions (up/down, left/right, forward/backward)	
Connection method		Cable built-in type (Standard cable length 2 m)	
Material		Case: ABS, mounting fixture: PBT	
Weight		Approx. 200 g (including mounting fixture and cable)	
Accessories		mounting fixture (ZFV-XMF) 1 p'ce, Ferrite core 2 p'ces, Instruction Sheet	

**ZFX-SR10R/SR50R (monochrome type)**


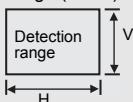
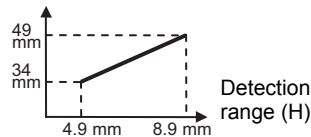
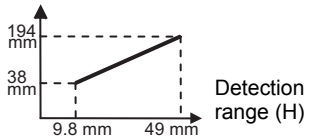
Item		ZFX-SR10R	ZFX-SR50R
Detection range (H x V) 		4.9 mm x 4.9 mm to 8.9 mm x 8.9 mm (variable range)	9.8 mm x 9.8 mm to 49 mm x 49 mm (variable range)
Setting distance (L)		34 mm to 49 mm	38 mm to 194 mm
Relationship between setting distance and detection range		Setting distance (L) 	Setting distance (L) 
Image capture element		All-pixel capture inter-line transfer type 1/3" CCD (monochrome)	
Effective number of pixels		659(H) x 494 (V)	
Pixel size		7.4 μm (H) x 7.4 μm (V)	
Shutter speed		1/170 to 1/20000 s	
Partial function (partial capture)		OFF	
Image rate function		Fine, Normal, High speed	
Frame rate (at capture of entire screen)		90 fps	
Lighting	Lighting method	Pulse lighting	
	LED	Red LED	
	Type	Direct lighting	
	Guide light	Available (center, measurement region)	
	Optional lighting I/F	Not available	
Ratings	Power supply voltage (supplied from Controller)	15 VDC	
	Current consumption	Approx. 200 mA	
Operation environment robustness	Ambient temperature range	Operating: 0 to + 40°C, Storage: -20 to +65°C (with no icing or condensation)	
	Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)	
	Ambient atmosphere	No corrosive gases allowed	
	Degree of protection	IP65 (IEC60529)	
	Dielectric strength	1000 VAC 50 Hz/60 Hz 1 min	
	Vibration resistance (durability)	10 to 150 Hz Single-amplitude 0.35 mm 10 times for 8 min each in X, Y, and Z directions	
	Shock resistance (destructive)	150 m/s <sup>2</sup> 3 times each in 6 directions (up/down, left/right, forward/backward)	
Connection method		Cable built-in type (Robot cable length 2 m)	
Material		Case: ABS, Mounting fixture (base): Aluminum, Mounting fixture (bracket): Stainless steel	
Weight		Approx. 270 g (including mounting fixture and cable)	
Accessories		Mounting fixture (ZFV-XMF3) 1 set, Ferrite core 2 p'ces, Instruction Sheet	

**ZFX-SC10/SC50/SC50W/SC90/SC90W/SC150/SC150R/SC150W (color type)**

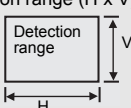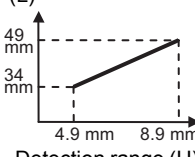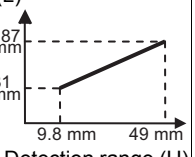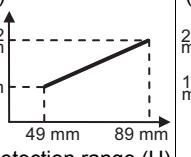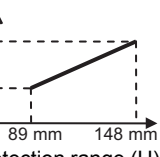Item		ZFX-SC10	ZFX-SC50/SC50W	ZFX-SC90/SC90W	ZFX-SC150/SC150R/SC150W
Detection range (H x V) 		4.9 mm x 4.9 mm to 8.9 mm x 8.9 mm (variable range)	9.8 mm x 9.8 mm to 49 mm x 49 mm (variable range)	49 mm x 49 mm to 89 mm x 89 mm (variable range)	89 mm x 89 mm to 148 mm x 148 mm (variable range)
Setting distance (L)		34 mm to 49 mm	31 mm to 187 mm	67 mm to 142 mm	115 mm to 227 mm
Relationship between setting distance and detection range		Setting distance (L)  Detection range (H)	Setting distance (L)  Detection range (H)	Setting distance (L)  Detection range (H)	Setting distance (L)  Detection range (H)
Image capture element		All-pixel capture inter-line transfer type 1/3" CCD (color)			
Effective number of pixels		659(H) x 494 (V)			
Pixel size		7.4 μm (H) x 7.4 μm (V)			
Shutter speed		1/170 to 1/20000 s			
Partial function (partial capture)		1/2 partial, 1/4 partial			
Image rate function		Not available			
Frame rate (at capture of entire screen)		90 fps			
Lighting	Lighting method	Pulse lighting			
	LED	White LED			
	Type	Direct lighting			
	Guide light	Not available			
	Optional lighting I/F	Not available	Available (ZFV-LT)		Not available
	Indicator Class*1	-	Risk Group 1	Risk Group 1	-
Ratings	Power supply voltage (supplied from Controller)	15 VDC	15 VDC, 48 VDC		
	Current consumption	Approx. 200 mA	Approx. 350 mA (15 VDC: approx. 150 mA, 48 VDC: approx. 200 mA) (including current consumption when optional lighting is connected)		
Operation environment robustness	Ambient temperature range	Operating: 0 to + 40°C, Storage: -20 to +65°C (with no icing or condensation)			
	Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)			
	Ambient atmosphere	No corrosive gases allowed			
	Degree of protection	ZFX-SC___: IP65 (IEC60529), ZFX-SC___W: IP67 (IEC60529)			
	Dielectric strength	1000 VAC 50 Hz/60 Hz 1 min			
	Vibration resistance (durability)	10 to 150 Hz Single-amplitude 0.35 mm Acceleration: 50 m/s <sup>2</sup> 10 times for 8 min each in X, Y, and Z directions			
	Shock resistance (destructive)	150 m/s <sup>2</sup> 3 times each in 6 directions (up/down, left/right, forward/backward)			
Connection method		Cable built-in type (ZFX-SC___R: Robot cable length 2 m, Otherwise: Standard cable length 2 m)			
Material		Case: ABS, mounting fixture: PBT			
Weight		Approx. 200 g (including mounting fixture and cable)	Approx. 270 g (including mounting fixture and cable)	Approx. 300 g (including mounting fixture and cable)	Approx. 600 g (including mounting fixture and cable)
Accessories		mounting fixture (ZFV-XMF) 1 p'ce, Ferrite core 2 p'ces, Instruction Sheet	mounting fixture (ZFV-XMF2) 1 p'ce, Ferrite core 2 p'ces, Warning label 1, Instruction Sheet	mounting fixture (ZFV-XMF2) 1 p'ce, Ferrite core 2 p'ces, Warning label 1, Instruction Sheet	Ferrite core 2 p'ces, Instruction Sheet

\*1: Applicable standards IEC62471

## ZFX-SC10R/SC50R/SC90R (color type)

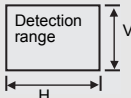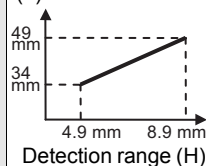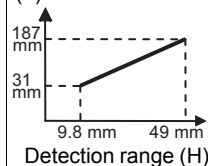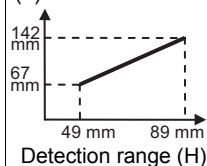Item		ZFX-SC10R	ZFX-SC50R	ZFX-SC90R
<div>Detection range (H x V) </div>		4.9 mm x 4.9 mm to 8.9 mm x 8.9 mm (variable range)	9.8 mm x 9.8 mm to 49 mm x 49 mm (variable range)	49 mm x 49 mm to 89 mm x 89 mm (variable range)
Setting distance (L)		34 mm to 49 mm	31 mm to 187 mm	67 mm to 142 mm
Relationship between setting distance and detection range		<div>Setting distance (L)  Detection range (H)</div>	<div>Setting distance (L)  Detection range (H)</div>	<div>Setting distance (L)  Detection range (H)</div>
Image capture element		All-pixel capture inter-line transfer type 1/3" CCD (color)		
Effective number of pixels		659(H) x 494 (V)		
Pixel size		7.4 μm (H) x 7.4 μm (V)		
Shutter speed		1/170 to 1/20000 s		
Partial function (partial capture)		1/2 partial, 1/4 partial		
Image rate function		Not available		
Frame rate (at capture of entire screen)		90 fps		
Lighting	Lighting method	Pulse lighting		
	LED	White LED		
	Type	Direct lighting		
	Guide light	Not available		
	Optional lighting I/F	Not available	Available (ZFV-LT)	
	Indicator Class <sup>*1</sup>	-	Risk Group 1	Risk Group 1
Ratings	Power supply voltage (supplied from Controller)	15 VDC	15 VDC, 48 VDC	
	Current consumption	Approx. 200 mA	Approx. 350 mA (15 VDC: approx. 150 mA, 48 VDC: approx. 200 mA) (including current consumption when optional lighting is connected)	
Operation environment robustness	Ambient temperature range	Operating: 0 to + 40°C, Storage: -20 to +65°C (with no icing or condensation)		
	Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)		
	Ambient atmosphere	No corrosive gases allowed		
	Degree of protection	ZFX-SC___: IP65 (IEC60529), ZFX-SC___W: IP67 (IEC60529)		
	Dielectric strength	1000 VAC 50 Hz/60 Hz 1 min		
	Vibration resistance (durability)	10 to 150 Hz Single-amplitude 0.35 mm Acceleration: 50 m/s <sup>2</sup> 10 times for 8 min each in X, Y, and Z directions		
	Shock resistance (destructive)	150 m/s <sup>2</sup> 3 times each in 6 directions (up/down, left/right, forward/backward)		
Connection method		Cable built-in type (ZFX-SC___R: Robot cable length 2 m, Otherwise: Standard cable length 2 m)		
Material		Case: ABS, Mounting fixture (base): Aluminum, Mounting fixture (bracket): Stainless steel		
Weight		Approx. 270 g (including mounting fixture and cable)	Approx. 400 g (including mounting fixture and cable)	
Accessories		Mounting fixture (ZFV-XMF3) 1 set, Ferrite core 2 p'ces, Instruction Sheet	Mounting fixture (ZFV-XMF4) 1 set, Ferrite core 2 p'ces, Warning label 1, Instruction Sheet	

\*1: Applicable standards IEC62471

## Camera only

### ZFX-S/SC

Item		ZFX-S (monochrome type)	ZFX-SC (color type)
Image capture element		All-pixel capture inter-line transfer type 1/3" CCD (monochrome)	All-pixel capture inter-line transfer type 1/3" CCD (color)
Effective number of pixels		659 (H) x 494 (V)	
Pixel size		7.4 μm (H) x 7.4 μm (V)	
Shutter speed		1/170 to 1/20000 s	
Partial function (partial capture)		Not available	1/2 partial, 1/4 partial
Image rate function		Fine, Normal, High speed	Not available
Frame rate (at capture of entire screen)		90 fps	
Lens mount		C mount	
Lighting	Optional lighting I/F	Available External lighting: 3Z4S-LT *1 Flash Controller: made by Moritex Corporation 3Z4S-LT MLEK-C100E1TSX *1	
Ratings	Power supply voltage (supplied from Controller)	15 VDC, 48 VDC	
	Current consumption	Approx. 160 mA	
Operation environment robustness	Ambient temperature range	Operating: 0 to + 50°C, Storage: -25 to +65°C (with no icing or condensation)	
	Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)	
	Ambient atmo- sphere	No corrosive gases allowed	
	Degree of protection	IP20 (IEC60529)	
	Dielectric strength	500 VAC 50 Hz/60 Hz 1 min	
	Vibration resis- tance (durability)	10 to 150 Hz Single-amplitude 0.35 mm Acceleration: 50 m/s <sup>2</sup> 10 times for 8 min each in X, Y, and Z directions	
	Shock resistance (destructive)	150 m/s <sup>2</sup> 3 times each in 6 directions (up/down, left/right, forward/backward)	
Connection method		Connector connection type (camera cable ZFX-VS/VSR required)	
Material		Case: Aluminum die cast alloy (C mount section), zinc die cast alloy (mounting base side), Cover: Zinc-plated copper plate 0.5 mm thick, Camera mounting base: ABS	
Weight		Approx. 80 g	
Accessories		Instruction Sheet	


\*1: 3Z4S-LT are not yet released for overseas.




## External Dimensions

### Camera with lighting


#### ZFX-SR10/SR50 (monochrome type)

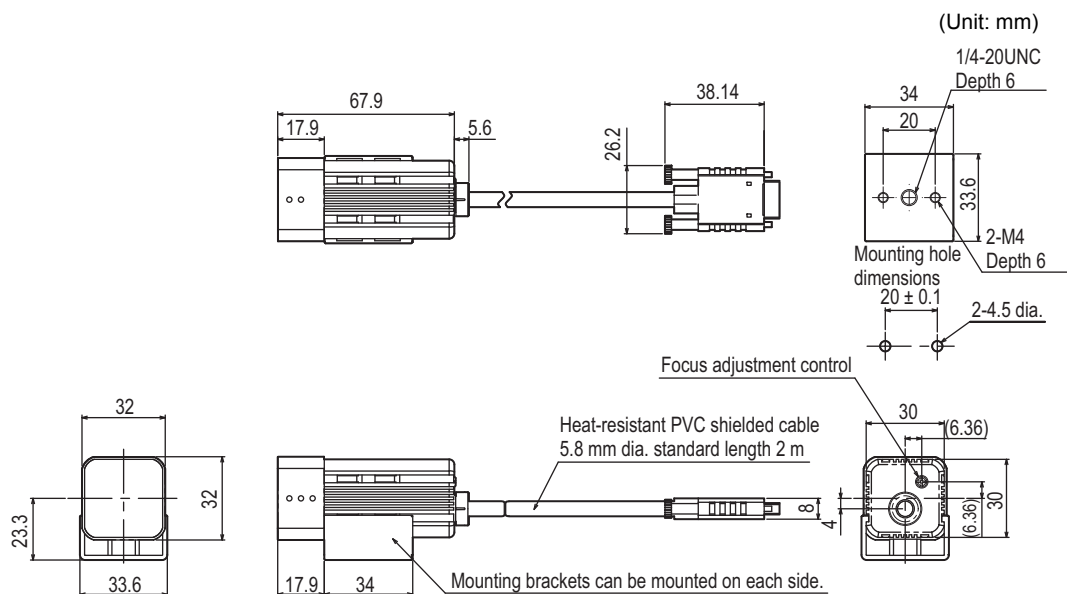


#### ZFX-SR10R/SR50R (monochrome type)

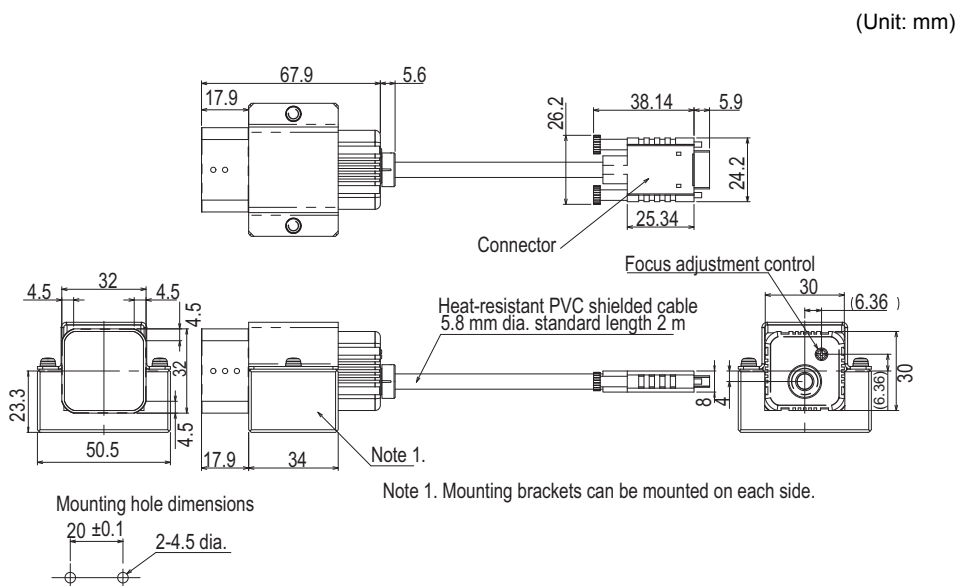


## ZFX-SC10 (color type)

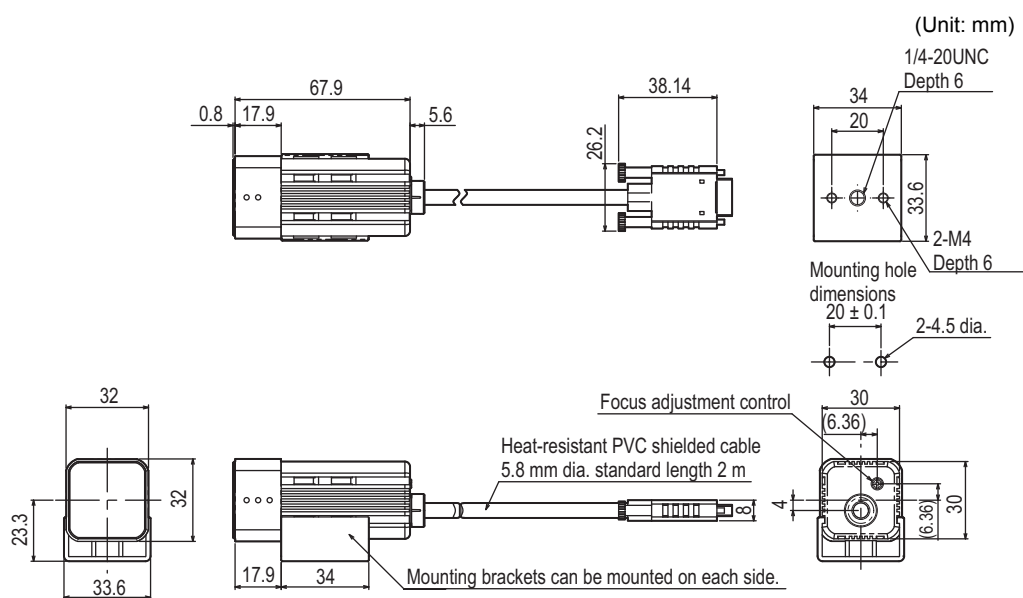


## ZFX-SC10R (color type)

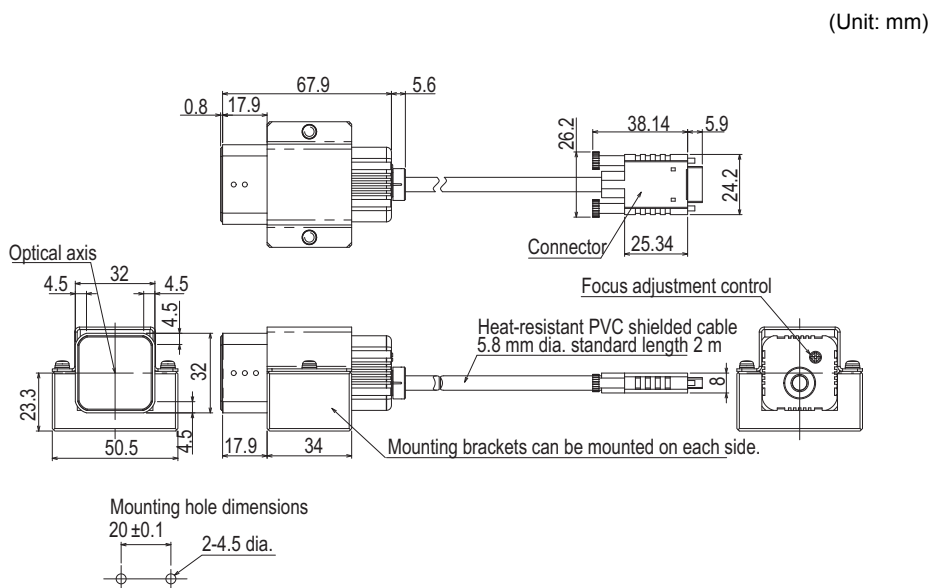

**ZFX-SC50/SC50W (color type)**

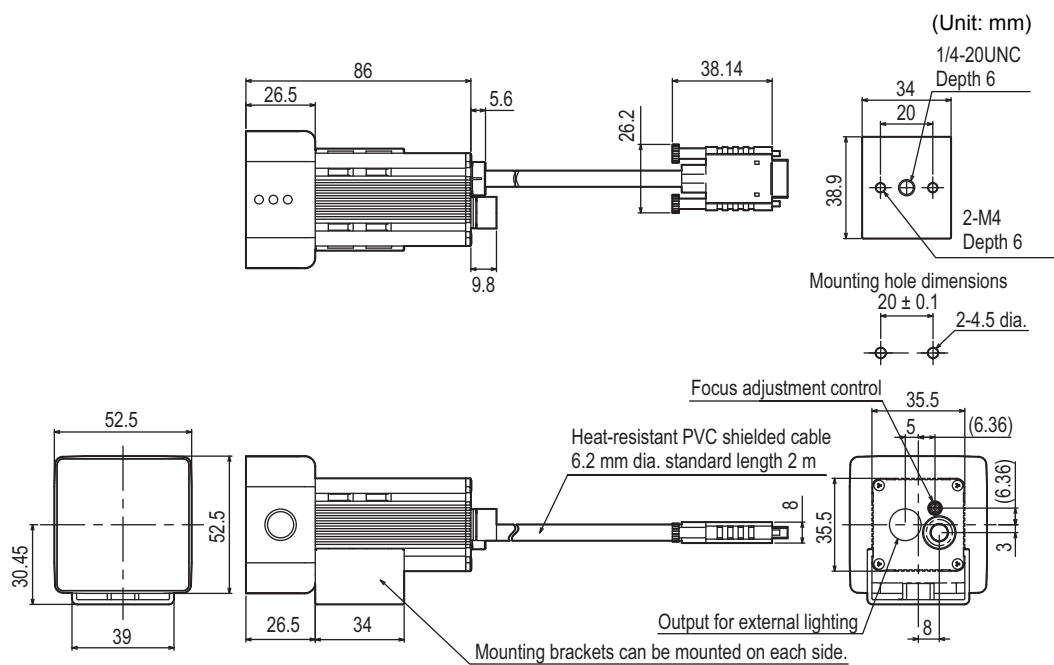


**ZFX-SC50R (color type)**

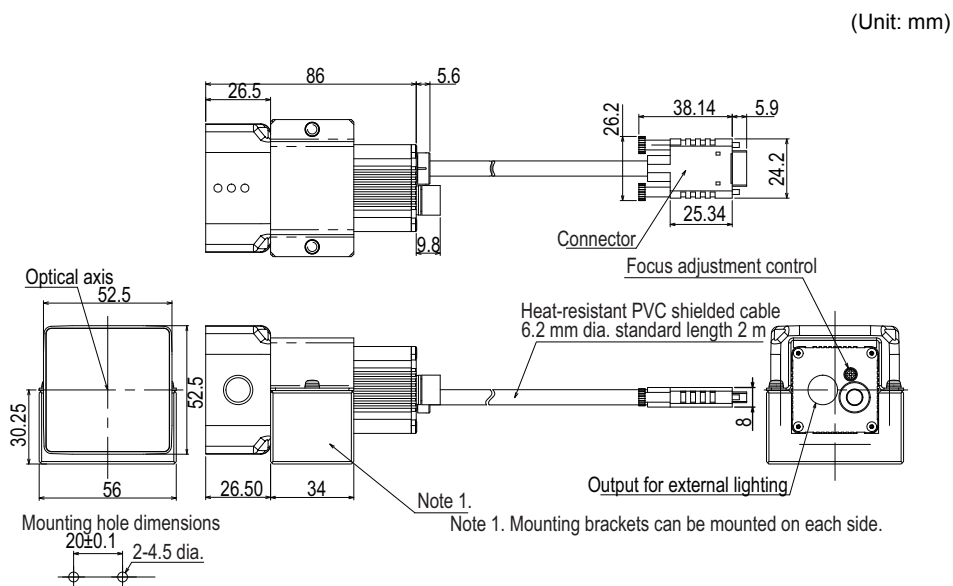


**ZFX-SC90/SC90W (color type)**

(Unit: mm)

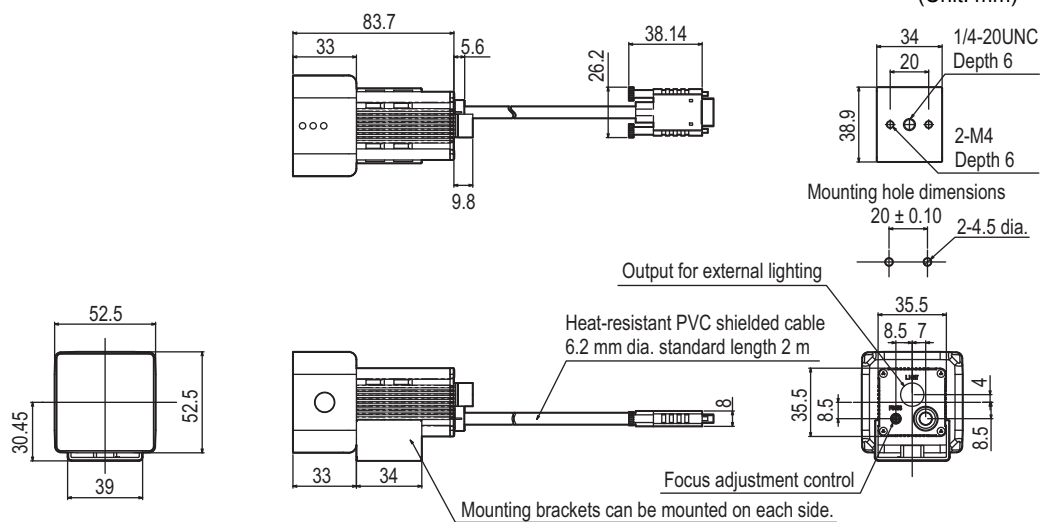
**ZFX-SC90R (color type)**

(Unit: mm)

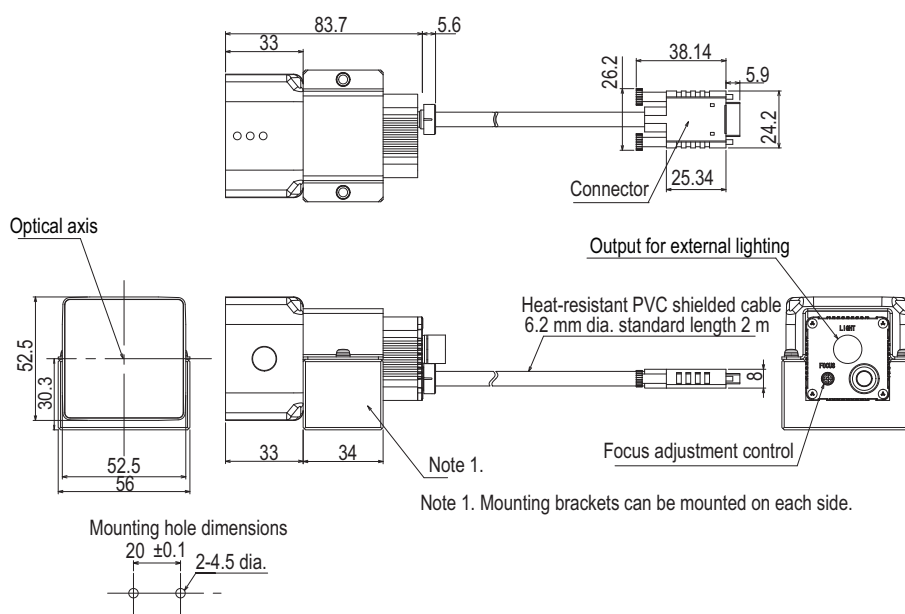

## ZFX-SC150/SC150R/SC150W (color type)


(Unit: mm)

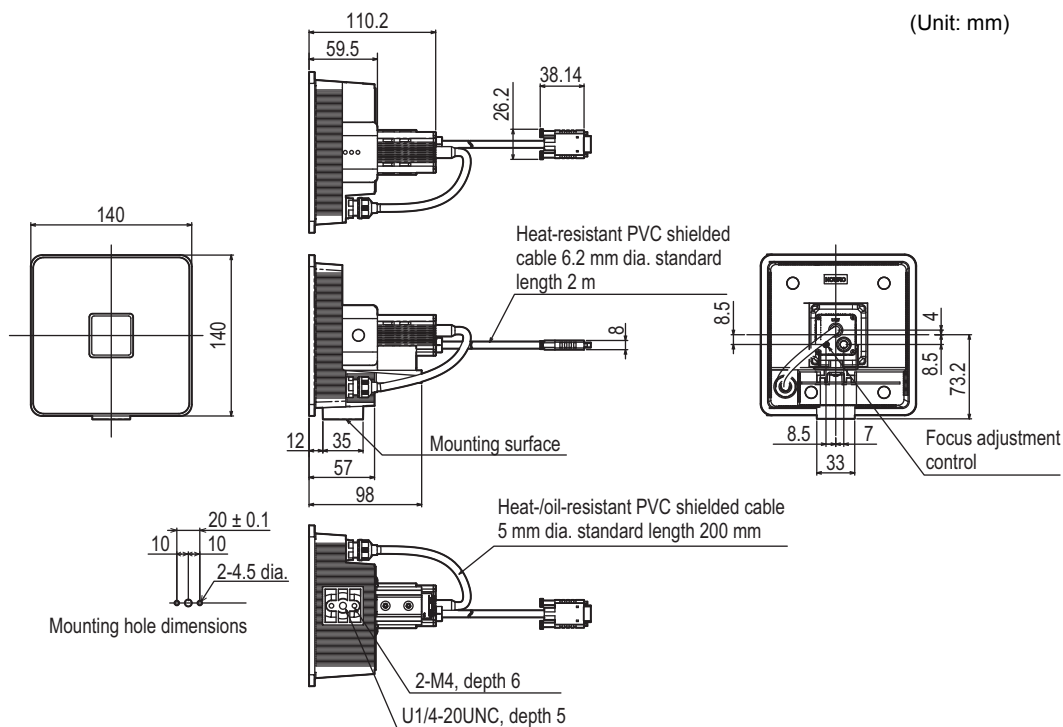

## Camera only

## ZFX-S (monochrome type) /SC (color type)

(Unit: mm)

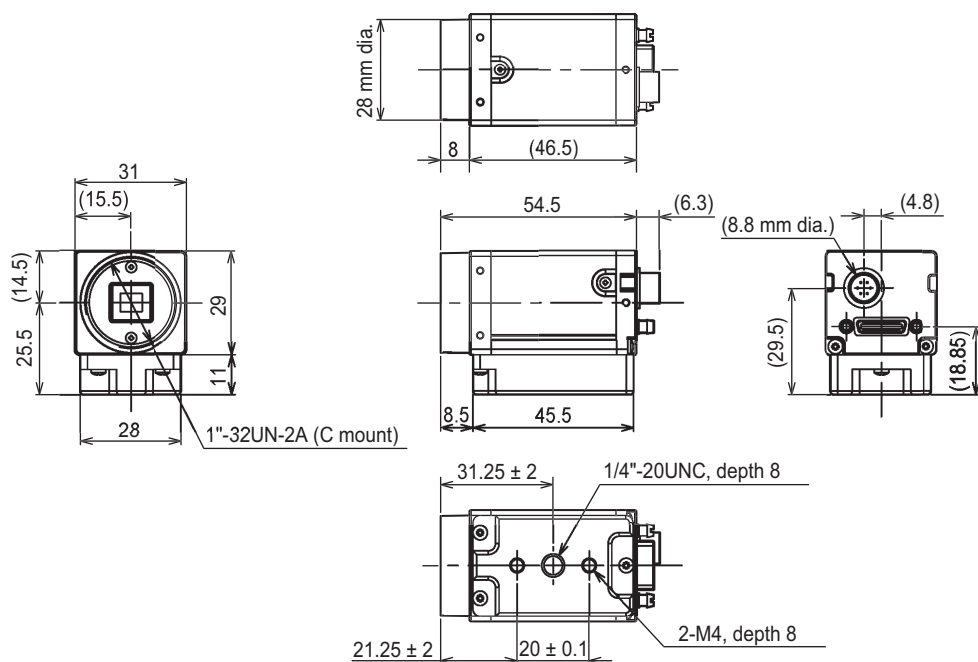

# Controller

## Specifications

### ZFX-C20/C25/C10H/C15H/C10/C15

Item			ZFX-C20	ZFX-C25	ZFX-C10H	ZFX-C15H	ZFX-C10	ZFX-C15
Number of connected cameras			2		1			
Connectable camera			ZFX-SR_/SC_/S/SC					
Processing resolution			When ZFX-SR_/SC_ is connected:464 (H) x464 (V) When ZFX-S/SC is connected:608 (H) x464 (V)					
Display		LCD monitor	3.5" TFT color LCD (320 x 240 pixels)					
		Indicator	"Measuring" indicator (color: green): RUN Trigger indicator (color: blue): ENABLE Judgment indicator (color: orange): OUTPUT Error indicator (color: red): ERROR					
External I/F	Parallel interface	Input	12 points (RESET, DSA, DI0 to 8, TRIG)					
		Output	23 points (OR, ERROR, RUN, ENABLE, GATE, STGOUT0 to 1 <sup>(*)</sup> , DO0 to 15)					
		Circuit type	NPN	PNP	NPN	PNP	NPN	PNP
	Serial interface	USB2.0	1 port, FULL SPEED, MINI-B connector					
		RS-232C	1 port, max. 115200 bps (cannot be used simultaneously with RS-422 interface)					
		RS-422	1 port, max. 115200 bps (cannot be used simultaneously with RS-232C interface)					
	Network communications	Ethernet	1 port, 100BASE-TX/10BASE-T					
	Monitor output		Analog RGB output, 1 ch (resolution VGA: 640 x 480)					
	Memory card I/F		SD card slot 1 ch					
Operation I/F			Touch panel, key operation, console connection					
Main functions	Number of registered banks		32 banks					
	Number of setup items		128 items/1 bank				32 items/1 bank	
	Measurement items	Shape inspection	Pattern search, sensitive search, flexible search, graphic search				Pattern search, sensitive search	
		Size inspection	Area, labeling				Area	
		Edge inspection	Position, width, count, angle				Position, width, count, angle	
		Brightness/color inspection	Brightness, HUE				Brightness, HUE	
		Application-based inspection	Defects, grouping				Defects	
	Position correction		1 model search, 2 model search, graphic search, position, area, labeling, angle				1 model search, 2 model search, position, area, angle	
Additional functions	Image memory function		Max. 100 images (when 2 cameras are connected, 50 images/camera)					
	Analysis function		Logging monitor				-	
Menu language			Japanese/English (can be switched)					
Ratings		Power supply voltage	21.6 to 26.4 VDC (including ripple)					
		Current consumption	1.5 A max.		1.2 A max.		1.0 A max.	
		Insulation resistance	Across all lead wires and Controller case: 20 MΩ (by 250 V megger)					
		Dielectric strength	Across all lead wires and Controller case, 1000 VAC, 50/60 Hz, 1 min					
Operation environment robustness	Ambient temperature range		Operating: 0 to + 50°C, Storage: -15 to +60°C (with no icing or condensation)					
	Ambient humidity range		Operating and storage: 35% to 85% (with no condensation)					
	Ambient atmosphere		No corrosive gases allowed					
	Degree of protection		IP20 (IEC60529)					
	Vibration resistance (durability)		Vibration frequency: 10 to 150 Hz Single-amplitude: 0.35 mm Acceleration: 50 m/s <sup>2</sup> 10 times for 8 minutes in X, Y, and Z directions					
	Shock resistance (destructive)		150 m/s <sup>2</sup> 3 times each in 6 directions (up/down, left/right, forward/backward)					
Material			Case: Polycarbonate (PC), Plate face: PMMA					


Item	ZFX-C20	ZFX-C25	ZFX-C10H	ZFX-C15H	ZFX-C10	ZFX-C15
Weight	Approx. 650 g				Approx. 620 g	
Accessories	Touch pen (ZFX-TP), Exhaust unit (ZFX-EU), Terminal block adapter (ZFX-XTB), Terminal block adapter mounting screws (4 p'ces), Ferrite core (2 p'ces), Instruction Sheet, Power connector					

\*1: Only STGOUT0 is functional on the ZFX-C10H/C15H/C10/C15.



## External Dimensions

ZFX-C20/C25/C10H/C15H/C10/C15

(Unit: mm)

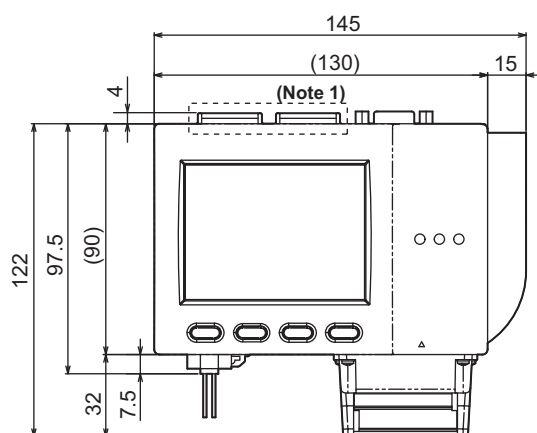

Note 1:  
Only connector 1 for camera 1 is provided  
on the ZFX-C10H/C15H/C10/C15.

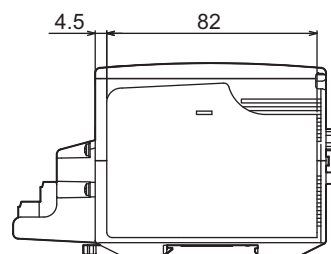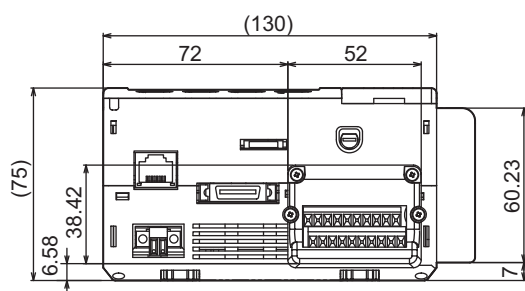




# Accessories & Options

## Camera Cable


### ZFX-VS 3M/8M, ZFX-VSR 3M

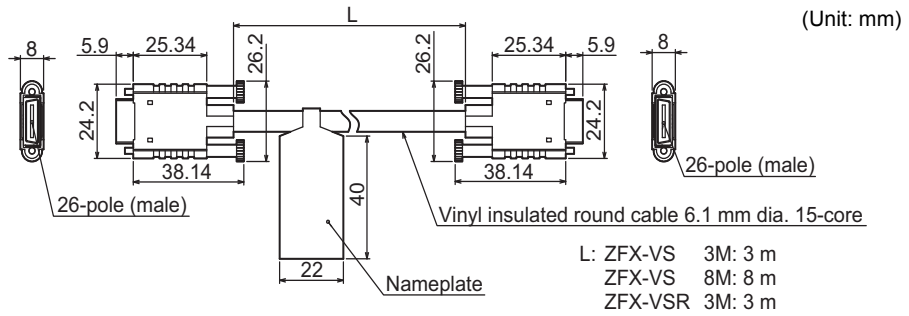


Item	ZFX-VS 3M	ZFX-VS 8M	ZFX-VSR 3M
Applicable Controller	ZFX		
Cable type	Standard cable		Robot cable
Cable length	3 m	8 m	3 m
Minimum bending radius	40 mm		
Weight	Approx. 250 g	Approx. 550 g	Approx. 250 g

## Right Angle Camera Cable

### ZFX-VSLA 3M/8M, ZFX-VSRLA 3M

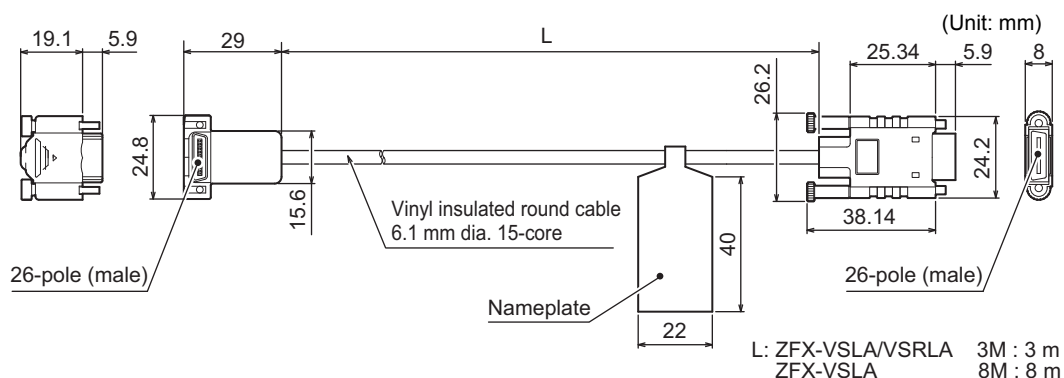

### ZFX-VSLB 3M/8M, ZFX-VSRLB 3M

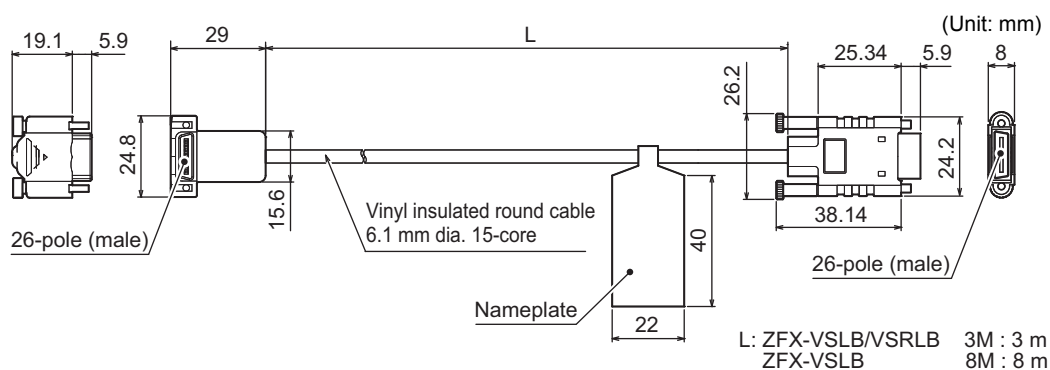


Item	ZFX-VSLA 3M	ZFX-VSLA 8M	ZFX-VSRLA 3M	ZFX-VSLB 3M	ZFX-VSLB 8M	ZFX-VSRLB 3M
Applicable Controller	ZFX					
Cable type	Standard cable		Robot cable	Standard cable		Robot cable
Cable length	3 m	8 m	3 m	3 m	8 m	3 m
Minimum bending radius	40 mm					
Weight	Approx. 250 g	Approx. 550 g	Approx. 250 g	Approx. 250 g	Approx. 550 g	Approx. 250 g


## Cable bending direction

### [ZFX-VSLA/VSRLA]

On the camera side, the cable bends downwards.

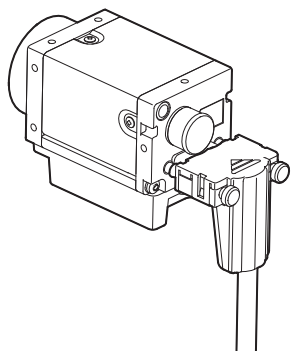


On the Controller side, the cable bends towards the front.

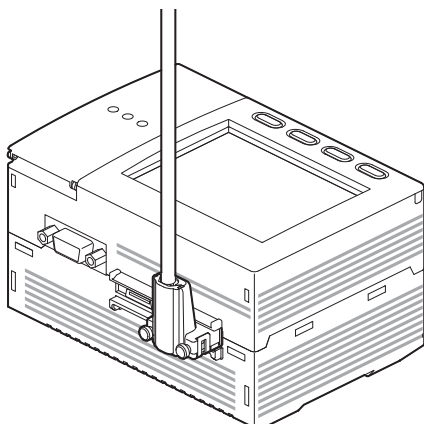


### [ZFX-VSLB/VSRLB]

On the camera side, the cable bends upwards.

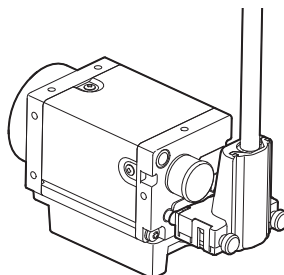

On the Controller side, the cable bends towards the rear.

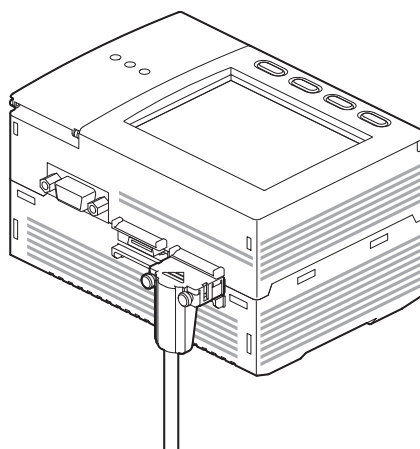


### Important

When the right angle camera cable is used, the Strobe Controller for external lighting cannot be connected to the lighting connector on the camera.

## Camera Extension Cable

### ZFX-XC3A/XC8A, ZFX-XC3AR

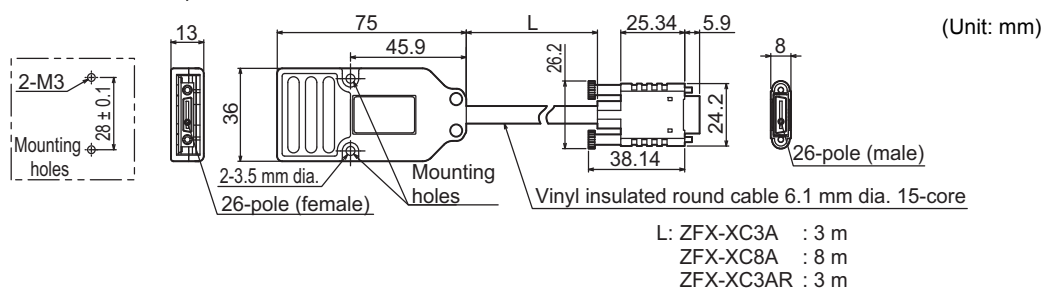


Item	ZFX-XC3A	ZFX-XC8A	ZFX-XC3AR
Applicable Controller/camera	ZFX		
Cable type	Standard cable		Robot cable
Cable length	3 m	8 m	3 m
Minimum bending radius	40 mm		
Power supply voltage	15 VDC		
Current consumption	Approx. 30 mA (extension cable only. excluding camera)		
Ambient temperature range	Operating: 0 to + 50°C, Storage: -20 to +65°C (with no icing or condensation)		
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)		
Vibration resistance (durability)	10 to 150 Hz Single-amplitude 0.35 mm 10 times for 8 min each in X, Y, and Z directions		
Shock resistance (destructive)	150 m/s <sup>2</sup> 3 times each in 6 directions (up/down, left/right, forward/backward)		
Material	Case: Polycarbonate (PC)		
Weight	Approx. 250 g	Approx. 550 g	Approx. 250 g


# Camera Long-distance Extension Cable

## Digital equalizer

### ZFX-XEQ01 (camera side)

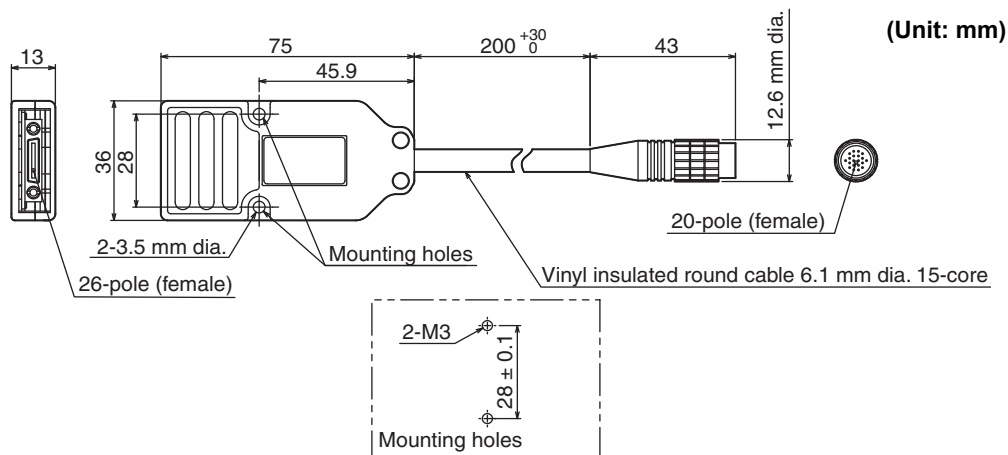

### ZFX-XEQ02 (Controller side)

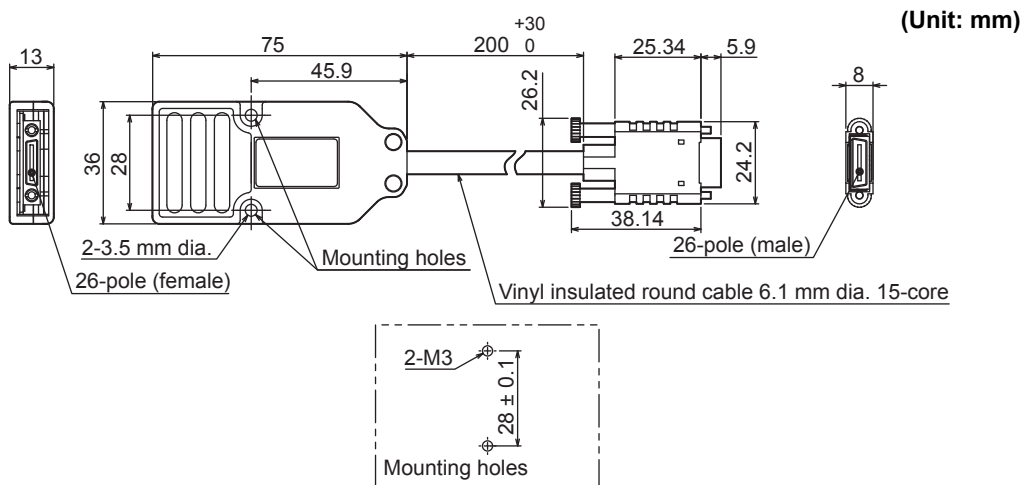


Item	ZFX-XEQ01	ZFX-XEQ02
Applicable controller/camera	ZFX series	
Cable length	200 mm	
Minimum bending radius	40 mm	
Current consumption	Approx. 30 mA	Approx. 80 mA
Ambient temperature range	Operating: 0 to + 50°C, Storage: -20 to +65°C (with no icing or condensation)	
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)	
Vibration resistance (durability)	10 to 150 Hz Single-amplitude 0.35 mm 10 times for 8 min each in X, Y, and Z directions	
Shock resistance (destructive)	150 m/s <sup>2</sup> 3 times each in 6 directions (up/down, left/right, forward/backward)	
Material	Case: Polycarbonate (PC)	
Degree of protection	IP20 (IEC60529)	
Weight	Approx. 70 g	

## Extension cable

### ZFX-XC15BR/XC25BR

(Unit: mm)

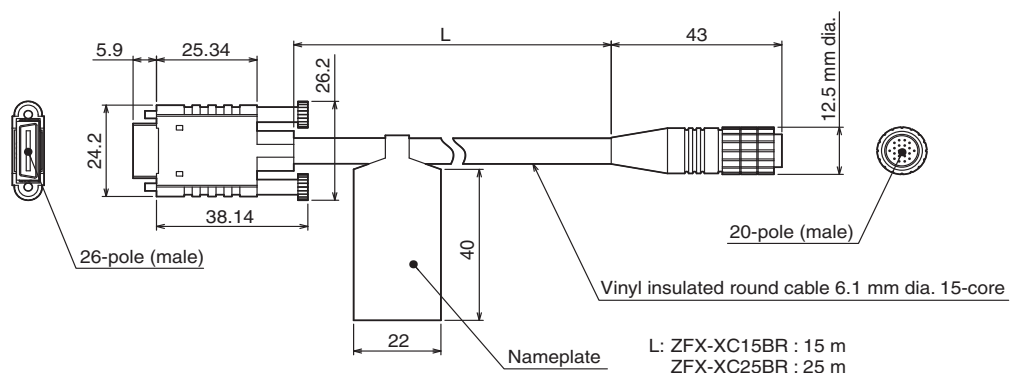

Item	ZFX-XC15BR	ZFX-XC25BR
Applicable controller/camera	ZFX series	
Cable length	15 mm	25 mm
Minimum bending radius	40 mm	
Weight	Approx. 900 g	Approx. 1,450 g

## Parallel I/O Cable


### ZFX-VP

Item	ZFX-VP
Cable length	2 m, 5 m
Minimum bending radius	5.5 mm
Material	Cable sheath: Non-lead heat-resistant vinyl, Connector: PBT resin/polyamide resin
Weight	2 m type approx.100 g, 5 m type approx. 250 g

## RS-232C/422 Cable

### ZFX-XPT2A/XPT5A/XPT15A (RS-232C), ZFX-XPT2B/XPT5B/XPT15B (RS-422)


(Unit: mm)

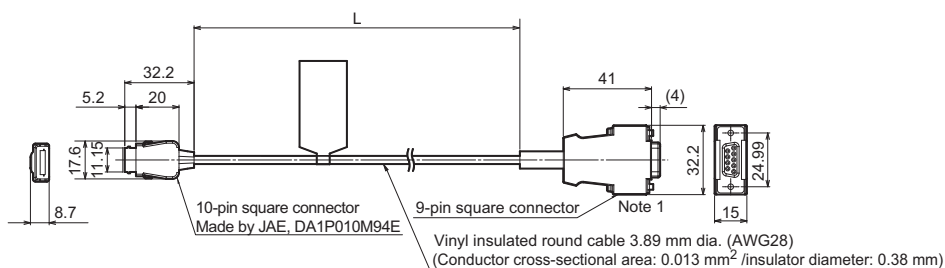

Note 1: Plug type connector

L:ZFX-XPT2\_ : 2m  
ZFX-XPT5\_ : 5m  
ZFX-XPT15\_ : 15m

#### ZFX-XPT2A/XPT5A/XPT15A

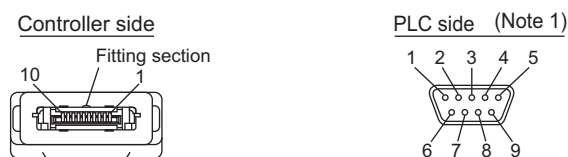

Signal name	Pin No.	Pin No.	Signal name
FG	1	1	FG
SD	2	2	SD
RD	3	3	RD
NC	4	4	RS
NC	5	5	CS
NC	6	6	NC
NC	7	7	NC
NC	8	8	NC
GND	9	9	GND
FG	10		
FG	Shell	Shell	FG

Note 1: Male connector

#### ZFX-XPT2B/XPT5B/XPT15B

Signal name	Pin No.	Pin No.	Signal name
FG	1	1	SDA(-)
NC	2	2	SDB(+)
NC	3	3	NC
NC	4	4	NC
RDB(+)	5	5	NC
RDA(-)	6	6	RDA(-)
SDB(+)	7	7	NC
SDA(-)	8	8	RDB(+)
GND	9	9	GND
FG	10		
FG	Shell	Shell	FG


Note 1: Male connector

Item	ZFX-XPT2A	ZFX-XPT2B	ZFX-XPT5A	ZFX-XPT5B	ZFX-XPT15A	ZFX-XPT15B
Cable length	2 m		5 m		15 m	
Minimum bending radius	22.8 mm					
Material	Cable sheath: Heat-resistant vinyl chloride (PVC)					
Weight	Approx. 50 g		Approx. 150 g		Approx. 350 g	

# LCD Monitor

## FZ-M08

(Unit: mm)

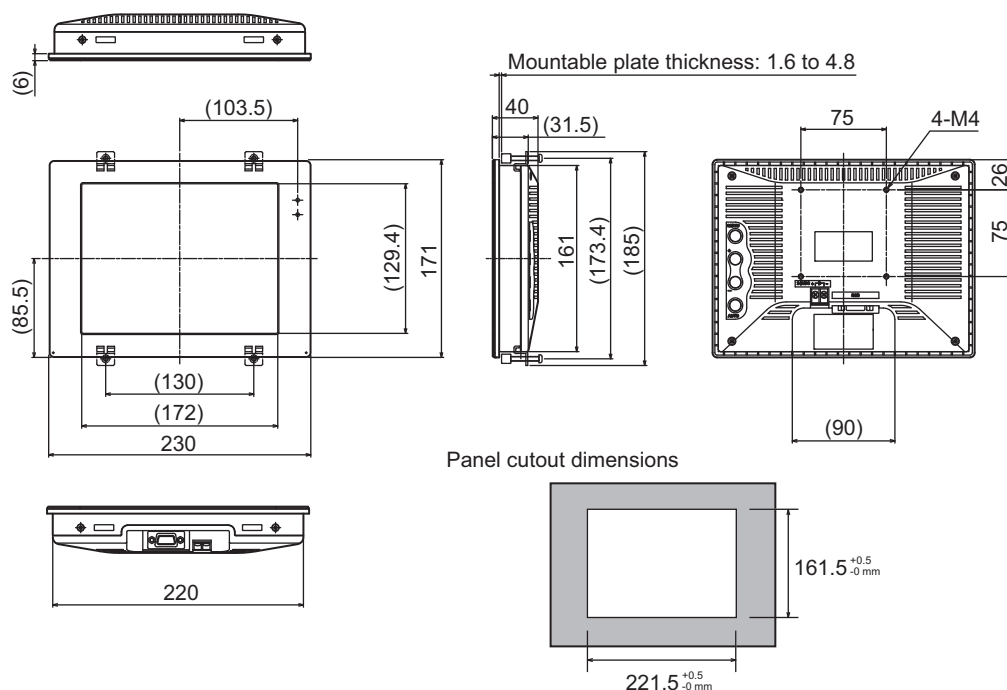


Item	FZ-M08
Power supply voltage	21.6 to 26.4 VDC
Current consumption	0.7 A max.
Video input signal	Analog RGB video input 1 ch
Screen size	21.3 cm across corners, 8.4 type or equivalent
Number of pixels	1024 (vertical) x 768 (horizontal) pixels
Number of display colors	16.7 million (8 bits/color)
Brightness <sup>(*)</sup>	500 cd/m <sup>2</sup>
Contrast ratio <sup>(*)</sup>	600:1
Visible angle <sup>(*)</sup>	Left/right: Angle 80°, Up: 60°, Down: 80° (contrast ratio 10:1 min.)
Backlight	Edge light system, White LED
Dielectric strength	Across all DC external terminals and GND: 840 VAC 50/60 Hz
Vibration resistance	10 to 150 Hz Single-amplitude 0.1 mm (max. acceleration 15 m/s <sup>2</sup> ) 10 times for 8 min each in 3 directions
Ambient temperature range	Operating: 0 to +50°C, Storage: -20 to +60°C
Ambient humidity range	Operating and storage: 20% to 85% (with no condensation)
Degree of protection	IP20 (IEC60529)
Material	Case: PC/PBT, Buttons: ABS
Weight	Approx. 1,000 g

\*1: Specifications of LCD panel. The optical characteristics differ slightly as a protective cover is attached on this product.



## Monitor Cable


### FZ-VM

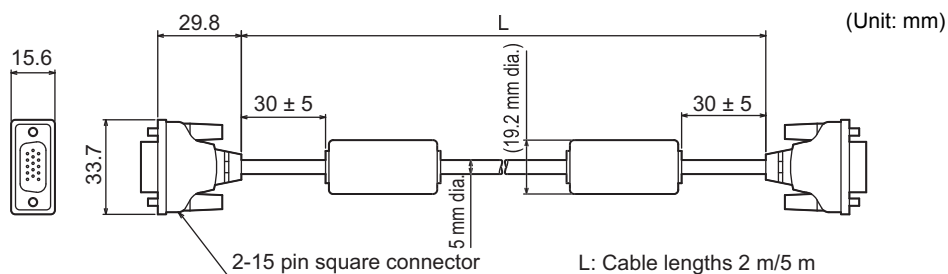

Item	FZ-VM
Material	Cable sheath: Heat-resistant PVC, Connector: PVC
Minimum bending radius	75 mm
Weight	Approx. 170 g

## Console

### ZFX-KP

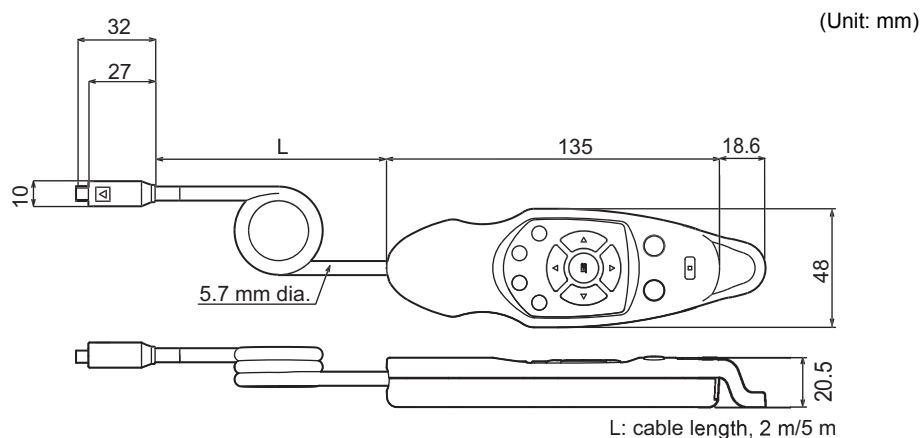

Item	ZFX-KP
Current consumption	Max. 14 mA (when all buttons are pressed)
Cable length	2 m, 5 m
Minimum bending radius	75 mm
Ambient temperature range	Operating: 0 to + 50°C, Storage: -15 to +60°C (with no icing or condensation)
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)
Vibration resistance (durability)	10 to 150 Hz (0.7 mm double amplitude), 80 min each in X, Y and Z directions
Shock resistance (destructive)	300 m/s <sup>2</sup> 3 times each in 6 directions (up/down, left/right, forward/backward)
Material	Body: ABS, Cable sheath: PVC, Connector: 66 nylon
Weight	Approx. 260 g (5 m)/Approx. 150 g (2 m)

#### Note

Key entry switches are located on the rear of the console.


ENABLE: Entry by console keys is enabled.

DISABLE: Entry by console keys is disabled.(excluding the MENU/ADJ/RUN mode switch)



## Panel Mount Adapters

### ZFX-XPM

(Unit: mm)

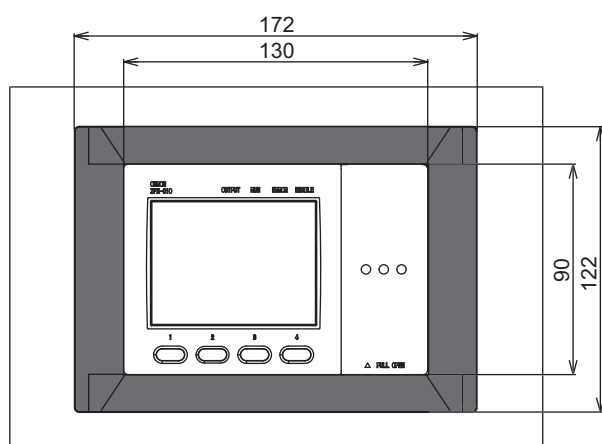

Panel cutout dimensions

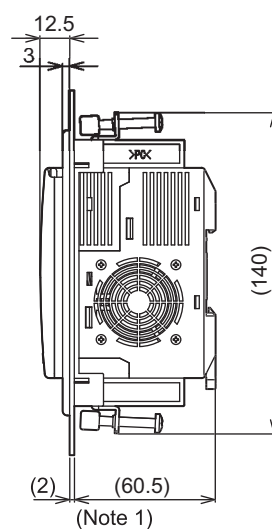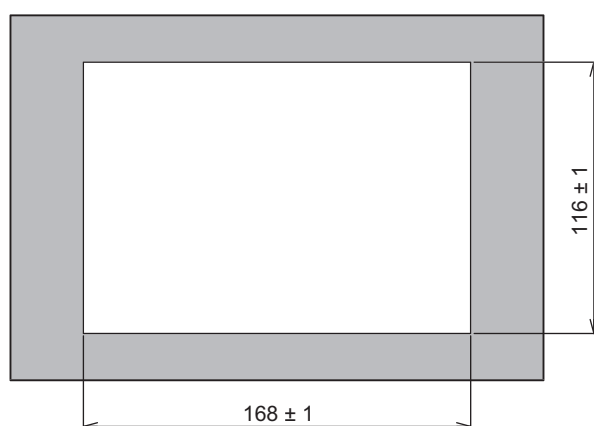


Note 1:  
Dimensions when the panel thickness is 2.0 mm

Item	ZFX-XPM
Applicable Controller	ZFX
Material	Polycarbonate (PC)
Weight	Approx. 100 g

## Optional Lighting


### ZFV-LTL01 (bar lighting)

(Unit: mm)

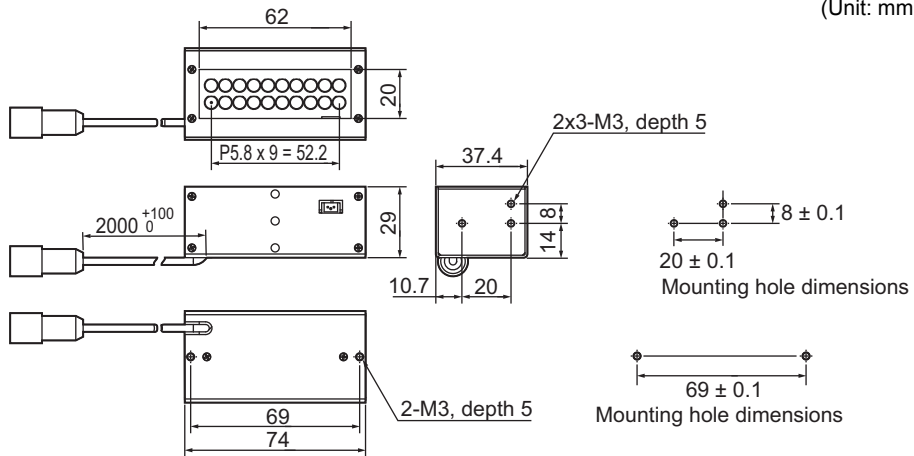


### ZFV-LTL02 (bar double-lighting)


(Unit: mm)

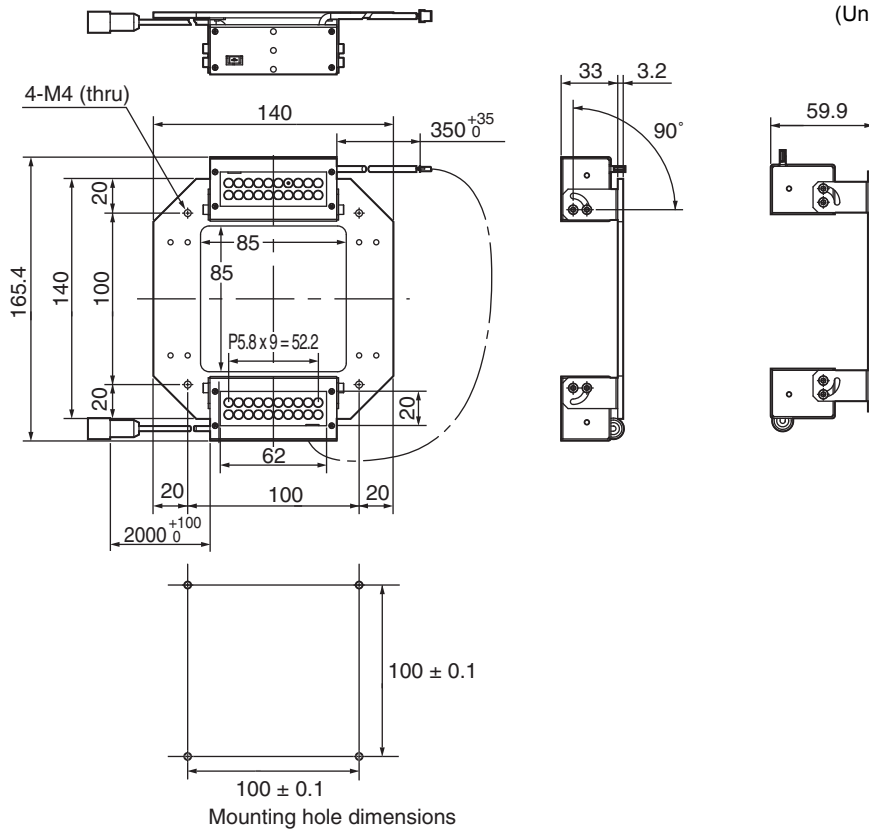

## ZFV-LTL04 (bar low-angle lighting)

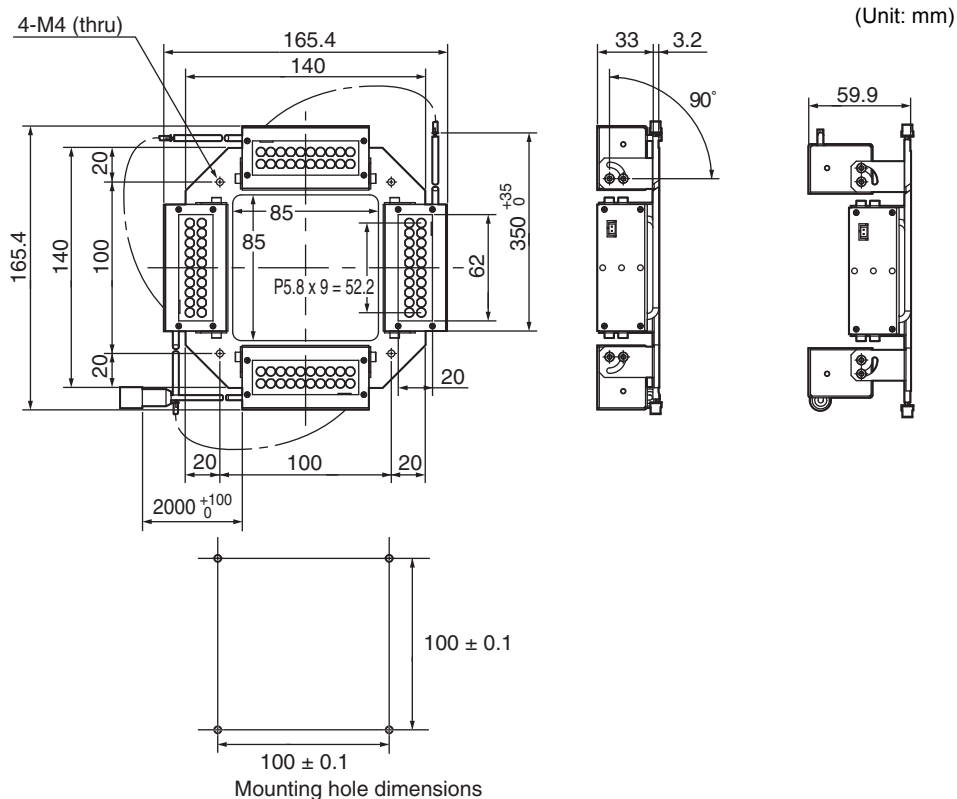

## ZFV-LTF01 (light source for through-beam lighting)

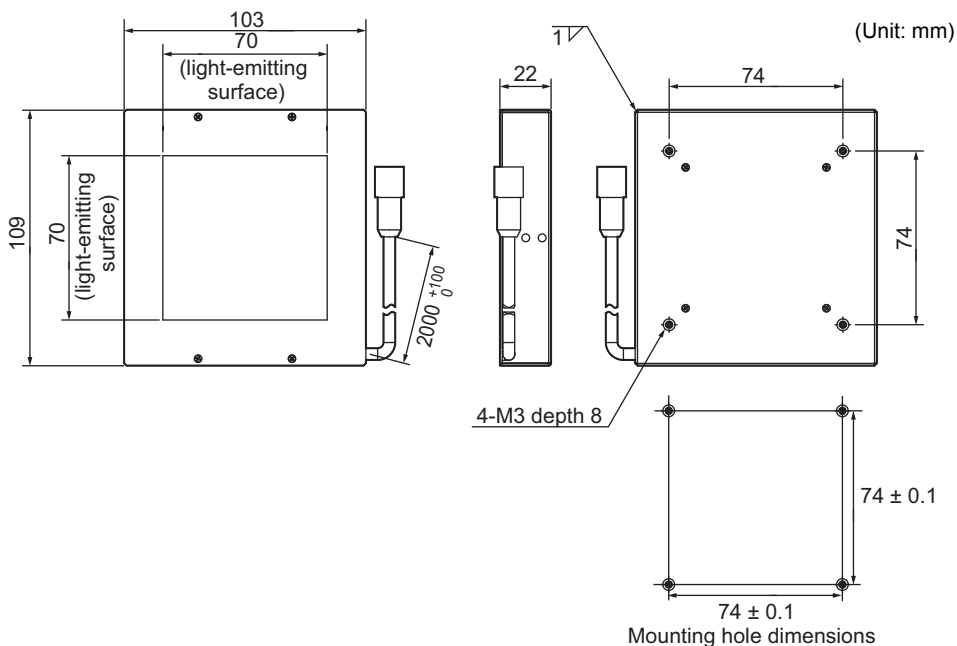

Item	ZFV-LTF01	ZFV-LTL01	ZFV-LTL02	ZFV-LTL04
Applicable camera	ZFV, ZFX			
Lighting method	Pulse lighting			
Lighting interval	Fixed (1.1 to 1.4 ms)			
Lighting source	White LEDs x 60 p'ces	White LEDs x 20 p'ces	White LEDs x 40 p'ces	White LEDs x 80 p'ces
Power supply voltage	48 VDC (supplied from camera)			
Current consumption	Approx. 160 mA	Approx. 80 mA	Approx. 120 mA	Approx. 210 mA
Dielectric strength	300 VAC 50 Hz/60 Hz 1 min			
Vibration resistance (durability)	10 to 150 Hz Single-amplitude 0.35 mm 10 times for 8 min each in X, Y, and Z directions			
Shock resistance (destructive)	150 m/s <sup>2</sup> 3 times each in 6 directions (up/down, left/right, forward/backward)			
Ambient temperature range	Operating: 0 to +40°C, Storage: -20 to +65°C (with no icing or condensation)			
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)			
Ambient atmosphere	No corrosive gases allowed			
Connection method	Cable built-in type (standard cable length: 2 m)			
Degree of protection	IP20 (IEC60529)			
Material	SPCC	SPCC, aluminum		
Weight	Approx. 500 g (packaged state: approx. 550 g)	Approx. 250 g (packaged state: approx. 300 g)	Approx. 650 g (packaged state: approx. 900 g)	Approx. 900 g (packaged state: approx. 1,150 g)
LED Class <sup>*1</sup>	---	Risk Group 1		

\*1: Applicable standards IEC62471

# LED Safety

For LED devices, class classification to indicate dangerous level and safety standards are stipulated in respective countries.

Take necessary safety preventive measures according to the standards.

## Classification

Standards and classifications <sup>(*)</sup>	
IEC62471	FDA (the U.S.A.)
ZFX-SC50/SC50R/SC50W/SC90/SC90R/SC90W: Risk Group 1	(Exception)

\*1: Safety standards vary with the country in which the instrument is to be used (except for Japan, Europe and the U.S.A.). Refer to the safety regulations and standards for laser devices stipulated in the country in which the instrument is to be used.


# Basic Knowledge for Operation

## Input Methods


The ZFX-C uses three input methods: input by the touch pen, input by operating the keys on the front of the Controller, and input from the console.

### Input by the touch pen

#### <Tapping>

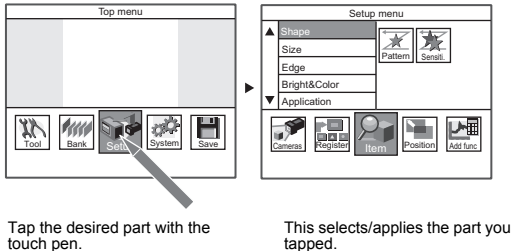


#### <Dragging>

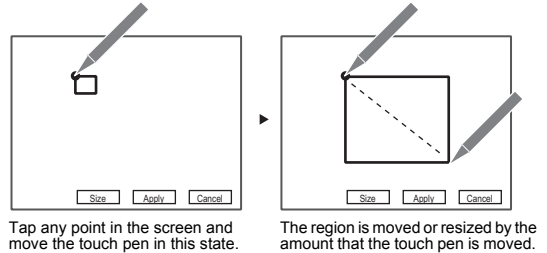


### Key entry from the Controller/Console

#### Controller


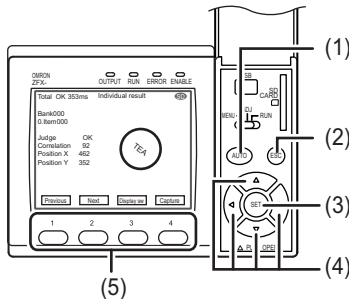


#### Console

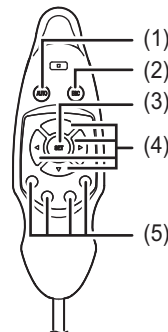

Name	Function
(1) AUTO key	Executes automatic setup of measurement conditions. This key is enabled only when the [AUTO] icon is displayed on the LCD screen.
(2) ESC key	Returns to the previous menu or cancels the current menu.
(3) SET key	Applies each item.
(4) ← L key → R key ↑ UP key ↓ DOWN key	Changes movement of the focus or numerical values in the following screens: <ul style="list-style-type: none"> <li>Item selection</li> <li>Threshold value parameter selection</li> <li>Parameter setup</li> <li>Measurement region setup</li> <li>Numerical value setup</li> </ul>
(5) Function keys	Directly sets each item that is displayed on the LCD screen. The function varies according to the display screen.

 Order of focus movement

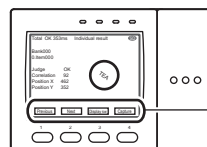


Menu button  
Displays the function corresponding to the function key.

## Parameter Setup


### Setting numerical values

A software keyboard is displayed on screen for parameters that require input of numerical values. Operate this software keyboard to input numerical values.

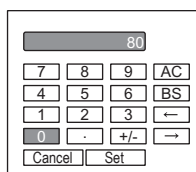


### Setting numerical values by the bar display

#### Touch pen input

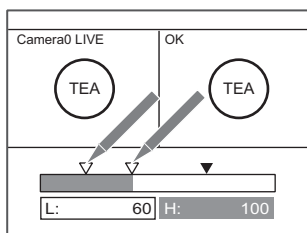


Tap and drag the ▽.

<To input numerical values directly>

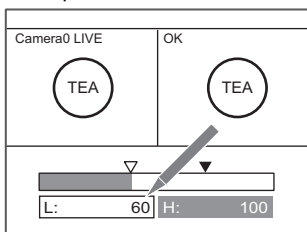


Tap the numerical value display.

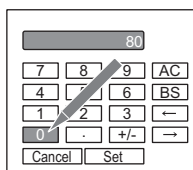


Set and apply the numerical values on the software keyboard.

#### Key input

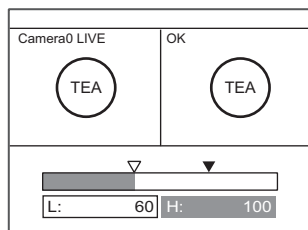

Select the target for input of the numerical values using the ← L key/→ R key, and press the SET key.

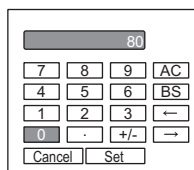


Set and apply the numerical values on the software keyboard.




## Setting the Region

### Moving and resizing regions

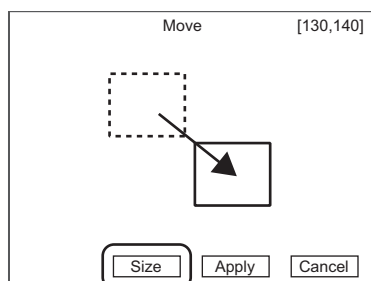

Size button ↓ ↑ Move button

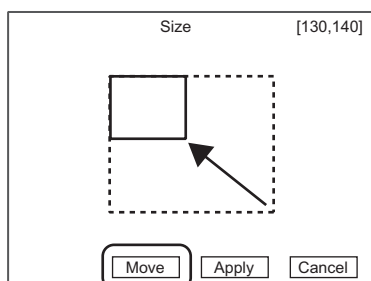

#### <Moving regions>

##### Touch pen operation

Tap any point in the screen and drag the touch pen in this state. The region moves by the amount that the touch pen is dragged (X, Y).

##### Key operation

↑ UP key: Moves the region upwards.  
 ↓ DOWN key: Moves the region downward.  
 → R key: Moves the region to the right.  
 ← L key: Moves the region to the left.  
 (Holding the keys down moves the region at high speed.)

#### <Resizing regions>

##### Touch pen operation

Tap any point in the screen and drag the touch pen in this state. The region is resized (enlarged or reduced) by the amount that the touch pen is dragged (X, Y).

Also, you can drag somewhere else on screen to set a region on top of [Cancel] or other buttons at the bottom of the screen, and resize the region.

##### Key operation


↓ DOWN key/→ R key: Enlarges a region.  
 ↑ UP key/← L key: Reduces a region.  
 (Holding the keys down moves the region at high speed.)

### Combining multiple shapes

Depending on the measurement item, up to five shapes can be combined to set a measurement region. Combining various shapes in this way allows you to draw complex shape regions or exclude unwanted parts from the measurement region.

Item	Description
OR	When drawing a complex shape, register a combination of shapes as a single region.
NOT	This item is used for excluding part of a region.


Example:

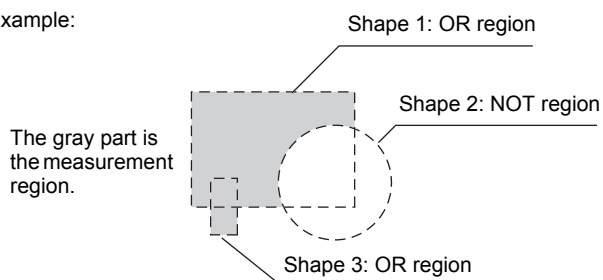





The shapes that can be selected differ according to the measurement item. Only selectable shapes are displayed.

Shape	How to draw this shape
Box	<p>The entire shape moves. The bottom right coordinates move.</p>
Circle	<p>The entire shape moves. The diameter is changed.</p>
Ellipse	<p>The entire shape moves. The bottom right coordinates move.</p>
Polygon	<p>Specification of 1st point      Specification of 2nd point      Specification of 3rd point onwards      Applying the shape      The shape moves (only when it is corrected).</p>
Circum	<p>The entire shape moves. The diameter is changed. The width is changed.</p>
Arc	<p>The entire shape moves. The end point moves. The center moves. The width is changed.</p>
Box (diagonal development)	<p>The entire shape moves. The end point moves. The width is changed. The shape moves. The new size is applied.</p>

# Menu List

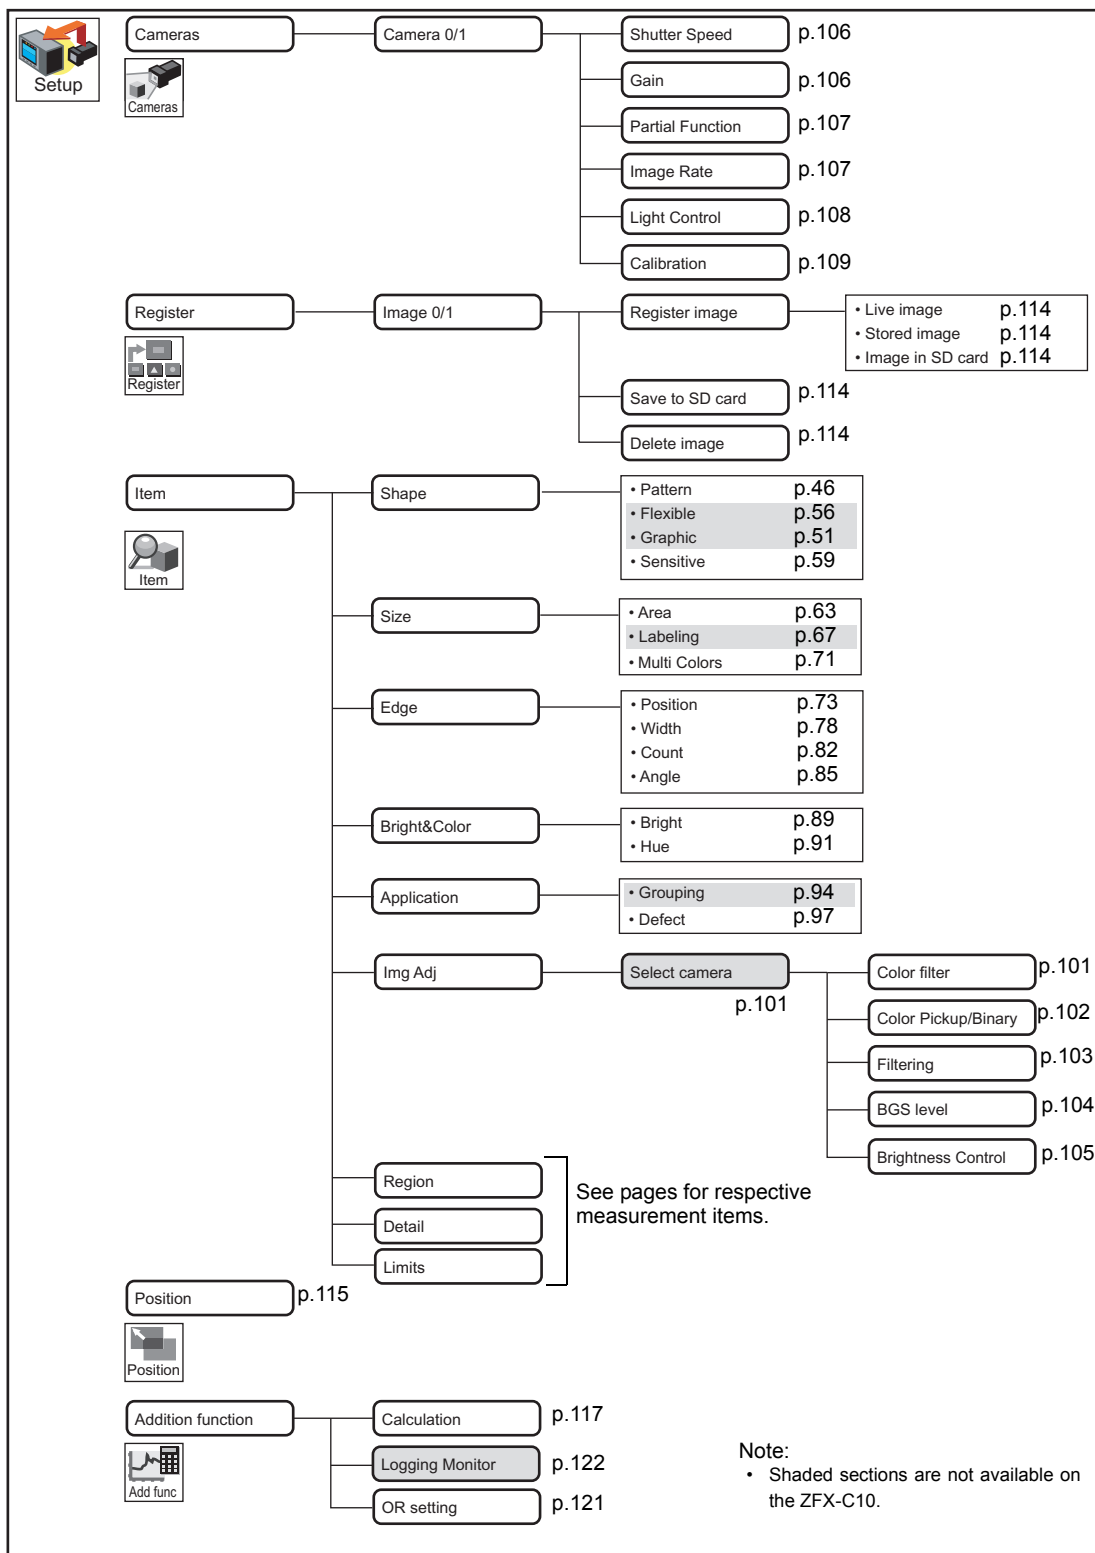

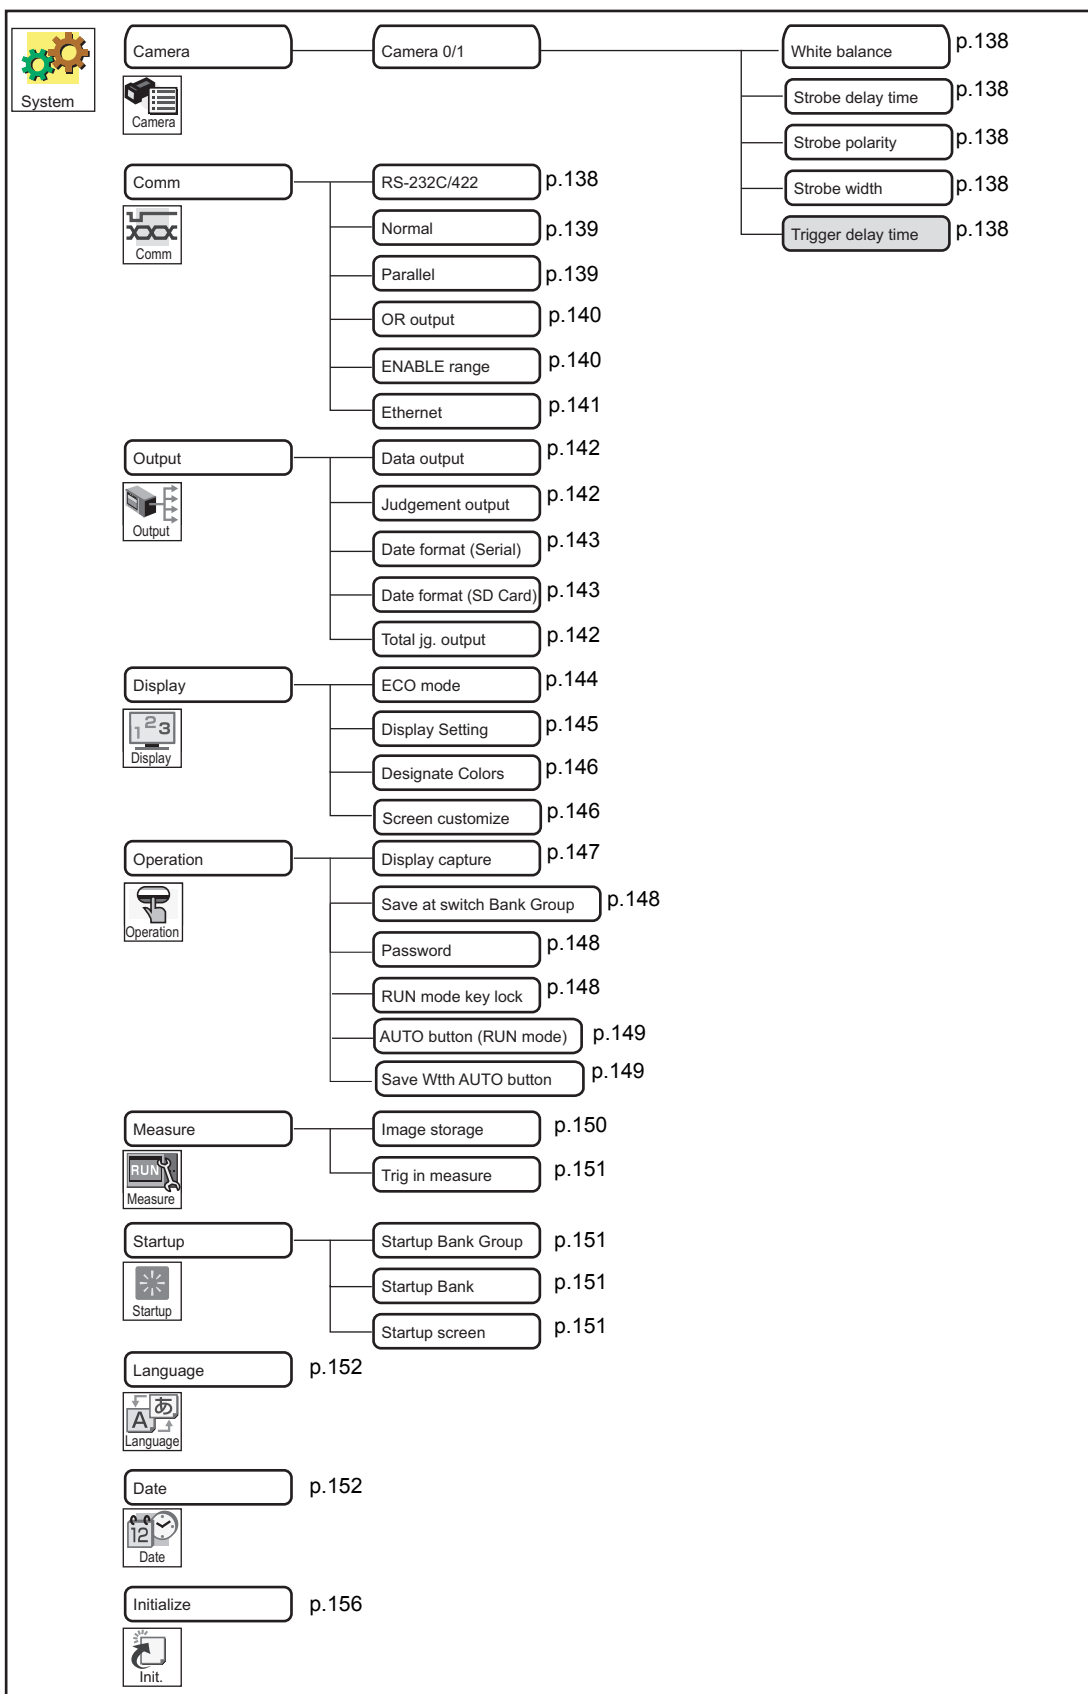

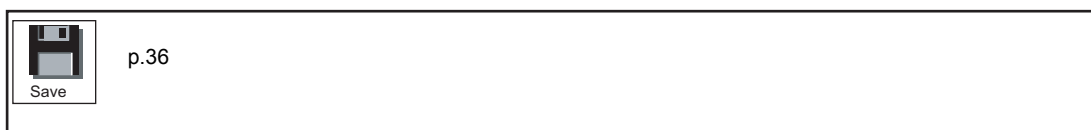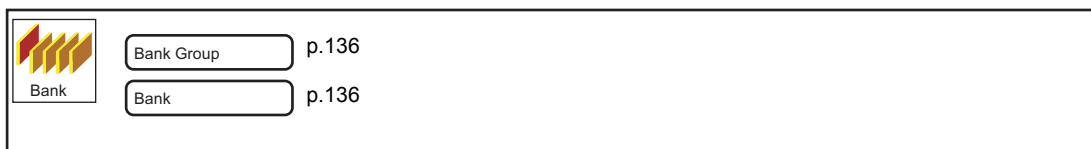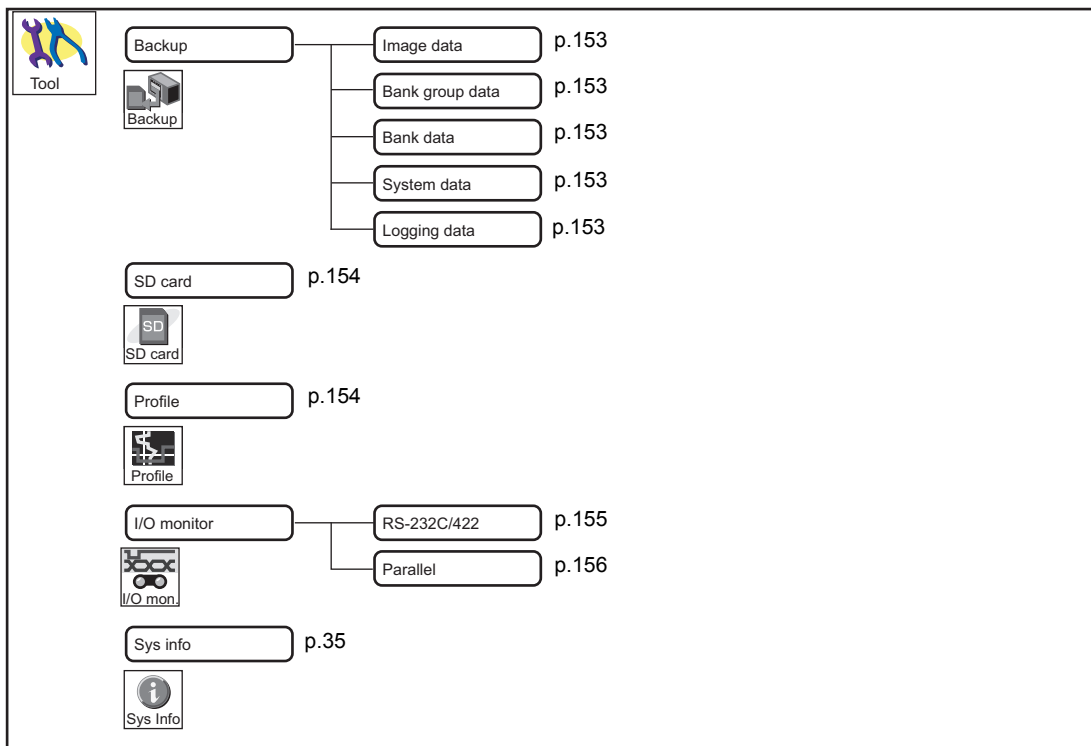

MEMO

# INDEX

## A

Additional Functions	117
ADJ Mode	31, 42, 129
Adjusting focus	21
Adjusting Measurement Conditions	132
All results/Judge	126, 129
All results/Region	126, 129
Angle	85
Area	63
AUTO button (RUN mode)	149
AUTO Setting in Individual Adjustment	Screens 184
AUTO Setting of Measurement Items	182

## B

Backup	153
Bank	137
Bank Group	137
Bank Settings	136
BGS level	104
Binary	102
Bright	89
Bright/Color Inspection	89
Brightness value	230

## C

Calculation	
Data	117
Judgement	117
List Settings	146
Setting the Number of Display Digits	120
Variables	117
Calibration	109
Camera	
Connecting	29
Extension cable	15
External Dimensions	191
Installing	19
Part Names and Functions	16
Specifications	186
Camera connector	18
Camera specifications	138
Checking Communication Status	155
Checking Density Distribution	154
Checking Measurement Status	42, 129

## Checking/Adjusting the Measurement

129	
Circuit diagram	164, 165
Color Filter	101, 226
Color images processing	225
Color Pickup	102, 228
Communication Setup	
Parallel Communication	139
Serial Communication	138
Connecting Devices	28
Connecting the camera	29
Connecting the power supply	28
Console connector	18
Control keys	17
Controller	
External Dimensions	198
Installing	25
Part Names and Functions	17
Specifications	196
Coordinates mode	77
Count	82

## D

Data	117
Data list	126, 129
Data output destination	142
Date format (Serial)	143, 144
Date setting	152
Defect	97
Designate Colors	146
Display capture	147
Display Setting	145
Displaying Measurement Information	126

## E

ECO Display	144
Edge Inspection	73
Error indicator	17
Executing automatic setting	41
Exhaust Unit	30
Extended Parallel Port	162
Extension Tube	24

## F

Ferrite Core	28
Flexible Search	56
Focus adjustment control	16

## G

Gain Setting	106
Graphic Search	51
Grouping	94

## H

How Items Are Displayed on the Logging Monitor	128
Hue	91, 230

## I

Image Adjustment	101
Image deletion	150
Image Rate	107
Image saving	150
Individual judgment result	169
Individual results	126, 129
Initialization	35
Input Methods	213
Inspection by Individual Application	94
Installing the mounting fixture	20, 23
Item No.	118

## J

Judge	117
Judgment	117
Judgment indicator	17
Judgment output destination	142
Judgments list	126, 129

## K

Key Lock	148
----------	-----

## L

Labeling	67
Lenses	23
Light Control	108
Loading Data	153
Logging monitor	122, 126, 128, 129

## M

Measurement Condition	
Adjusting	132
Setting	38
measurement display settings	145
Measurement items	
Selecting	39
Measurement items and banks	33
Measurement regions	
Setting	40
Measurement values/judgment	117

Measuring indicator	17
Memory capacity	156
Menu Button	
ADJ Mode	130
RUN Mode	127
MENU Mode	31, 38
Mode switch	17
Monitor connector	18
Monitoring the Measurement Status	126
Multi Colors	71

## O

Optical chart	
Camera only	22
Camera with lighting	19
Optional lighting	15, 30
Overall judgment result	169

## P

Panel output dimensions	208
Parallel Connector Specifications	160
Parallel I/O cable	
Connecting	162
Pin assignment	163
Parallel port	18
Parameter Setup	214
Partial Function Settings	107
Password	148
Pattern Search	46
Perform Re-measurement	131
Position	73
Position correction	115, 126, 129
Power connector	18
Pre-processing	103
Profile	154

## R

Recipe Function	108
Registering Images	114
Revision History	234
RS-232C/422 connector	18
RUN Mode	31, 42, 126

## S

Saturation	230
Save With AUTO Button	149
Saving Data	153
Saving during Switching of Bank	
Groups	148
Saving Setup Data	36
SD Card	143, 144
Select Camera	101



Sensitive Search	59
Setting Reflection of Individual Results	121
Setting the Region	41, 215
Shape Inspection	46
Shutter Speed	106
Size Inspection	63
Standard Parallel Port	160
Starting Measurement	42
Startup	151
Statistical data	126, 129
Stored image	129
Switching the image display	128, 131
System Configuration	14
System information	156

**T**


---

Terminal Block Adapter	
Pin assignment	161
Wiring	160
Timing Chart	
Bank group switching	175
Bank switching	175
ENABLE Signal Output	177
Measurement (Handshaking OFF)	171
Measurement (Handshaking ON)	174
Model re-registration	175
Operation at Startup	178
OR Signal Output	177
Reset Input	178
Trigger Input	176
Touch pen	17
Trigger indicator	17

**U**


---

USB port	17
----------	----

**V**


---

Variables list	126, 129
Ventilation film	16
Version information	156

**W**


---


Width	78
-------	----

MEMO

# How Color Images are Processed

The ZFX-C performs measurement with the processes "Color filter" or "Color Pickup" applied to images captured from the camera.


This section describes how color images are processed.

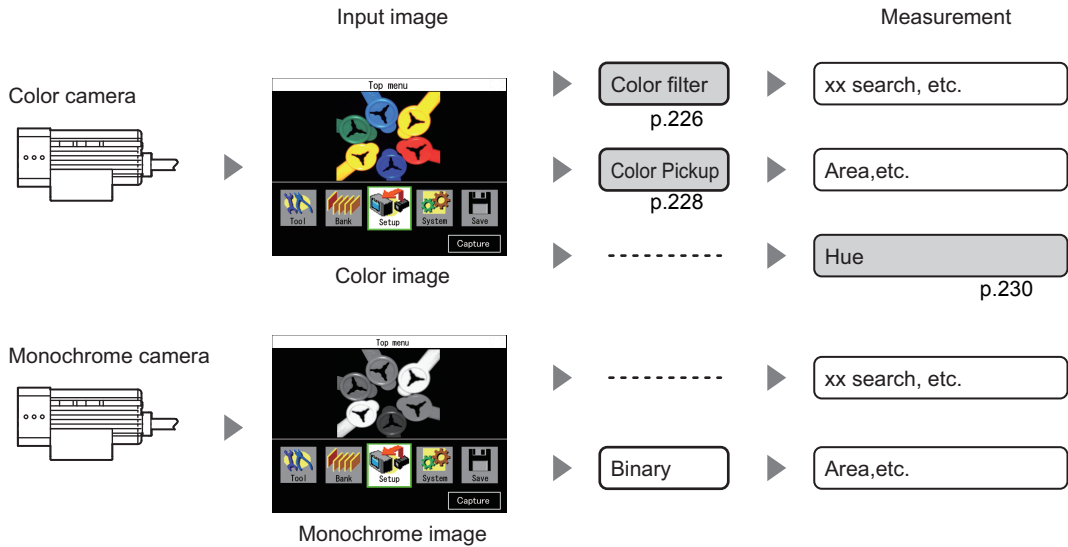


# Color Filter

This function improves the contrast of images. This function can be set only when a color camera is connected to the Controller.

Example:

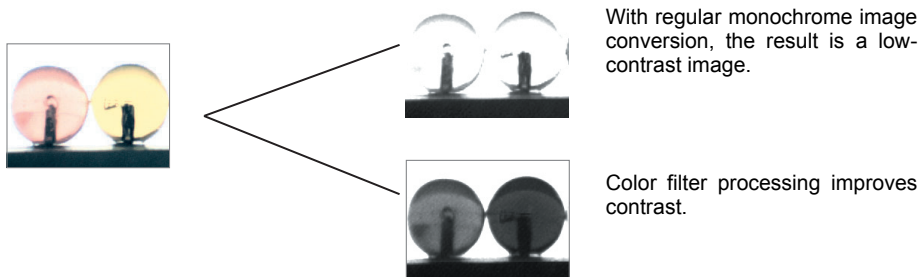

## Setting color filter processing

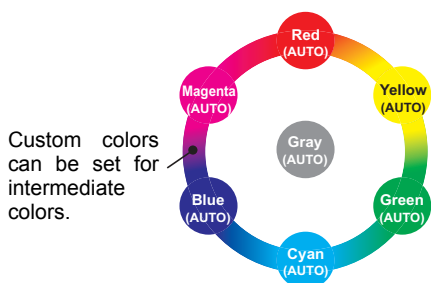

There are three ways of setting custom colors:

### AUTO

The optimum filter is automatically selected from seven color filters.

### Select filter

This setting allows you to select from six color filters + gray filter to match the color whose contrast is to be improved.

### Custom filter

This setting allows you to set the color filter to any custom color. You can select the desired color from the color palette.

### Note

For monochrome images, the color of the currently selected filter is displayed as white and complementary colors are displayed as black. "Complementary colors" refers to colors that lie on opposite sides of the white point in a chromaticity diagram.

Example: When the blue filter is selected, blue is displayed as white and yellow is displayed as black.

## AUTO


With measurement items that can use color filters, the optimum color filter is automatically set when the AUTO setting is executed. The color filter for enhancing the contrast between the color having the largest area and the color having the second largest area in the region is selected.

### Select Filter

The color filter can be selected to match the color whose contrast is to be improved. You can choose from Red, Blue, Green, Yellow, Cyan, Magenta, Gray, and Custom as the color filters.

#### ► MENU mode - [Setup] - [Item] - [Img Adj] - [Select camera] - [Color filter] - [Select filter]


When "Blue" is selected:

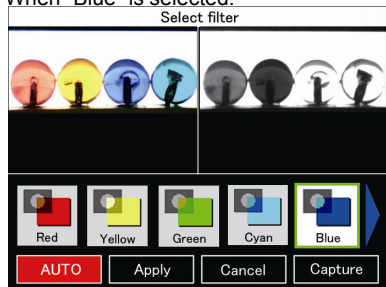

**1** Select the desired color.

**2** Select [Apply].


The color bar is displayed when [Custom] is selected from the color filters. You can set any color from this color bar to custom filters.

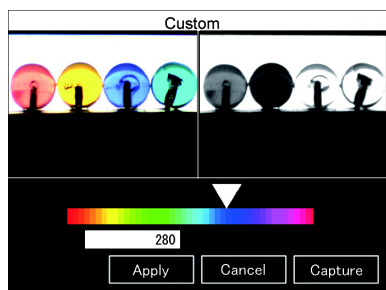

### Fixing the Color Filter

To hold the color filter without changing its settings when the AUTO setting is next executed, change [Auto function] to [OFF].

#### ► MENU mode - [Setup] - [Item] - [Img Adj] - [Select camera] - [Color filter] - [Auto function]

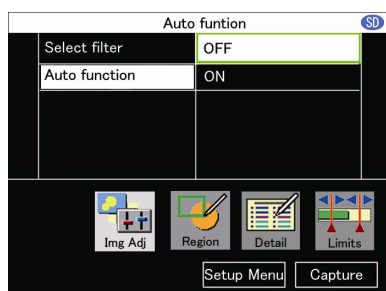

**1** Select [OFF].


# Color Pickup

This function picks up colors to be measured. This function can be set only when a color camera is connected to the Controller.

Up to four measurement target colors can be specified for one measurement item.

► **MENU mode - [Setup] - [Item] - [Img Adj] - [Select camera] - [Color Pickup]**

Automatically picking up colors

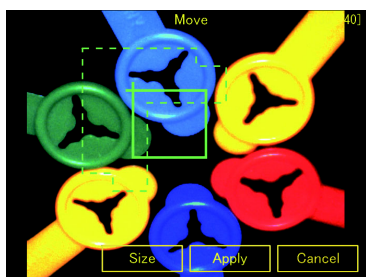

## 1 Select [Region].

Specify the area having the color to be measured.

For details on how to set the region p.215

## 2 Select [PickUp].

## 3 Select [AUTO].

Candidates for up to four colors are displayed in order of the color having the largest area.


## 4 Check whether or not the color to be measured is picked up.

Select the icon of a candidate color. Only an image of the corresponding color is displayed.

## 5 If there are colors not to be used as the measurement target, select [Enable/Disable]-[Disable].


Enable: The picked up color is used as the measurement target.

Disable: The picked up color is not used as the measurement target.

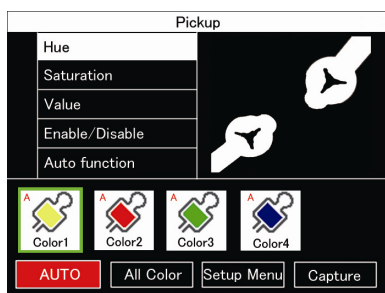

If the appropriate image is not obtained by automatic color pick up, fine-adjust three parameters hue, saturation and brightness. The image can be adjusted while comparing the picked up color image and original image.

## 6 Select [Hue/Saturation/Value].

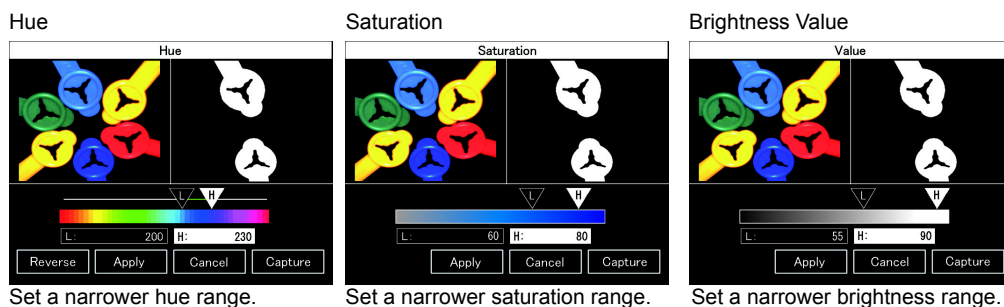

Hue, Saturation and Brightness Value p.230

## 7 Select [Apply].


## 8 Select [Auto function]-[OFF].

The picked up color is fixed. The icons of fixed colors are not cleared and are held even if the AUTO button is selected again.

# Hue, Saturation and Brightness Value

The parameters hue, saturation and brightness value are used in the measurement values in color inspection.

Parameter	Description
Hue	The name of a color, such as red, yellow or blue, that is perceived subjectively. Hue is expressed by a chromaticity diagram.
Saturation	The degree to which color is mixed with white. When a color has little saturation, it becomes an achromatic color. The higher saturation becomes, the purer the color becomes in proportion to hue.
Brightness value	The ratio of light intensity in a color.

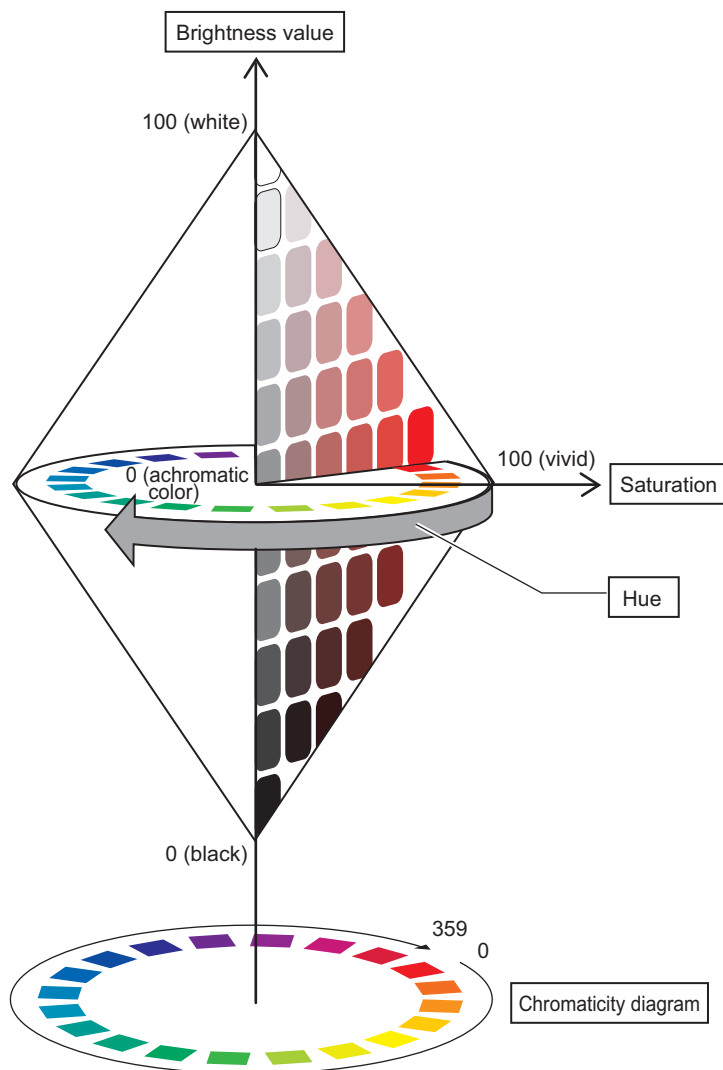



# Version Upgrade Information

The following describes the content of the version upgrade.

Ver1.00 → Ver1.20

Changes	Reference
The "coordinates mode" function has been newly added to the following measurement items. Pattern Search, Graphic Search, Flexible Search, Sensitive Search, Area, Labeling, Position, Width, Grouping, Defect	p.77
Camera images can now be displayed also when the "Variables list," "Data list" and "Judgments list" are displayed in the RUN mode or the ADJ mode.	p.128 p.131
Measurement data can now be prefixed with time information when measurement information is output on the serial interface or to SD card.	p.143
Clearing or holding saved image data in memory can now be selected at bank switching.	p.150

Ver1.20 → Ver1.30

Changes	Reference
Upper and lower limit values can now be set for area judgment in labeling.	p.69
"Angle" has been newly added to the measurement items.	p.85
"Angle" and "Graphic Search" have been newly added to the position correction items.	p.115
"IMAX" and "IMIN" have been added to the general functions in [Add Func]-[Calculation].	p.118
"Display Setting" and "Designate colors" have been added to the system settings.	p.145

Ver1.30 → Ver1.40

Changes	Reference
The No. of the model having the highest correlation can now be output for Flexible Search - "Possible output results".	p.58
The "Output position" function has been added to Sensitive Search - "Detailed settings".	p.61
The number of display digits for "Variables list," "Data list" and "Judgments list" in the RUN and ADJ modes can be changed.	p.120
"Gateway" has been added to the Ethernet communication Setup Items.	p.141
The display pattern for "Variables list," "Data list" and "Judgments list" in the RUN and ADJ modes can be changed.	p.146
The type of the display screen can now be set when the controller is started up.	p.151

Ver1.40 → Ver1.50

Changes	Reference
The "Brightness Control" function was added to image adjustment of areas and labeling.	p.105
Bank group No. can now be displayed in the measurement screen.	p.145
Up to five of the latest I/O-related errors can now be checked.	p.156
The number of commands that can be input by parallel signals has been increased. "Clear measured data", "Clear error", "Clear parallel terminal"	p.166

# Ver1.50→Ver1.61

Changes	Reference
The "Multi colors" inspection item was added.	p.71
Auto setting function was added.	p.149, p.149
The "Port number" item was added to Ethernet communication settings.	p.141

MEMO

# Revision History

A manual revision code appears as a suffix to the catalog number at the bottom of the front and back covers of this manual.

Cat. No. Z264-E1-09

↑  
Revision code

Revision code	Date	Revised contents
01	April 2007	Original production
02	August 2007	New details as explained in "Version Upgrade Information" added (Ver1.20)
03	November 2007	<ul style="list-style-type: none"> <li>• New details as explained in "Version Upgrade Information" added (Ver1.30)</li> <li>• Minor corrections</li> </ul>
04	March 2008	<ul style="list-style-type: none"> <li>• Inclusion of information of ZFX-C20/C25, ZFX-C10H/C15H and ZFX-C10/C15 Controllers</li> <li>• Right angle camera cable (ZFX-VSLA/VSRLA/VSLB/VSRLB) information added</li> <li>• Camera with lighting and Robot cable (ZFX-SR10R/SR50R/SC10R/SC50R/SC90R/SC150R) information added</li> <li>• Minor corrections</li> </ul>
05	June 2008	<ul style="list-style-type: none"> <li>• New details as explained in "Version Upgrade Information" added (Ver1.40)</li> <li>• Camera long-distance extension cable information added</li> <li>• Minor corrections</li> </ul>
06	September 2008	<ul style="list-style-type: none"> <li>• New details as explained in "Version Upgrade Information" added (Ver1.50)</li> </ul>
06A	January 2009	<ul style="list-style-type: none"> <li>• Information added accompanying remodeling of the mounting fixture accessory (ZFX-SR10R/SR50R/SC10R/SC50R/SC90R).</li> </ul>
07	March 2009	<ul style="list-style-type: none"> <li>• New details as explained in "Version Upgrade Information" added (Ver1.61)</li> <li>• ZFX-C2_-CD/C1_H-CD/C1_-CD information added</li> </ul>
08	November 2010	<ul style="list-style-type: none"> <li>• Minor corrections (P.8,56,82,104,105,106,110,111,131,170,176,181,182,192,201,202,203,204,205,206)</li> </ul>
08A	March 2012	Additions for Notice for Korea Radio Law
09	August 2015	Additions corresponding to change of EN standard



**OMRON Corporation    Industrial Automation Company**  
Kyoto, JAPAN

**Contact: [www.ia.omron.com](http://www.ia.omron.com)**

***Regional Headquarters***

**OMRON EUROPE B.V.**

Wegalaan 67-69, 2132 JD Hoofddorp  
The Netherlands  
Tel: (31)2356-81-300/Fax: (31)2356-81-388

**OMRON ASIA PACIFIC PTE. LTD.**

No. 438A Alexandra Road # 05-05/08 (Lobby 2),  
Alexandra Technopark,  
Singapore 119967  
Tel: (65) 6835-3011/Fax: (65) 6835-2711

**OMRON ELECTRONICS LLC**

2895 Greenspoint Parkway, Suite 200  
Hoffman Estates, IL 60169 U.S.A.  
Tel: (1) 847-843-7900/Fax: (1) 847-843-7787

**OMRON (CHINA) CO., LTD.**

Room 2211, Bank of China Tower,  
200 Yin Cheng Zhong Road,  
PuDong New Area, Shanghai, 200120, China  
Tel: (86) 21-5037-2222/Fax: (86) 21-5037-2200

**Authorized Distributor:**

© OMRON Corporation 2007 All Rights Reserved.  
In the interest of product improvement,  
specifications are subject to change without notice.

**Cat. No. Z264-E1-09**

**0815**