

Cat. No. X073-E1-01

Sensor I/O Connectors Group Catalog



TABLE OF CONTENTS

XS2	Sensor I/O Connectors (M12)	1
XS2W	Sockets and Plugs on Cable Ends	3
XS2F	Sockets on One Cable End	5
XS2H	Plugs on One Cable End	11
XS2	Sensor I/O Connectors on Cables (8-pole)	14
XS2G	Crimping/Soldering Plug Assemblies	16
XS2C	Crimping/Soldering Socket Assemblies	17
XS2G	Screw-on Plug Assemblies	18
XS2C	Screw-on Socket Assemblies	19
XS2P	Panel-mounting Sockets for Terminal Boxes	20
XS2R	Y-Joint Plug/Socket Connectors	21
XS2R	T-Joint Plug/Socket Connectors	22
XS2M	Sensor-embedded/Panel-mounting Plugs	24
XW3B	Connector Terminal Boxes	33
XS3	Sensor I/O Connectors (M8/S8)	39
XS3W	Sockets and Plugs on Cable Ends	41
XS3F	Sockets on One Cable End	43
XS3H	Plugs on One Cable End	46
XS3P	Panel-mounting Sockets for Terminal Boxes	49
XS3M	Sensor Embedded Plugs	51
XS3R	Y-Joint Plug/Socket Connectors	52
XS4	Power Supply Connectors (7/18-16UN Mini Connectors)	55

Sensor I/O Connectors (M12)


XS₂

Water- and Environment-resistive FA Connectors Save Wiring and Maintenance Effort

- Compact FA connectors meet IP67 requirements and ensure a 94V-0 fire retardant rating.
- A wide array of connectors makes a wiring system more modular, simplifies maintenance, and reduces downtime.
- Connectors with Cables and Connector Assemblies are available
- Three types of Connector Assembly: Crimping, soldering, and screw-on.
- Conforms to IEC 60947-5-2 and NECA 4202.
- UL-listed 4-core cables.



■ Construction (Connector Assembly)



■ Specifications

Rated current	3 A			
Rated voltage	125 VDC, 250 VAC			
Contact resistance	40 m Ω max. (20 mV max., 100 mA max.) (See note 1.)			
Insulation resistance	1,000 MΩ min. (at 500 VDC)			
Dielectric strength	1,500 VAC for 1 min (leakage current: 1 mA max.) (See note 2).			
Degree of protection	IP67 (IEC529)			
Insertion tolerance	200 times min.			
Assembled fixture strength	Tensile: 98 N/15 s Torsion: 0.98 N·m/15 s			
Cable holding strength	Cable diameter: 6 mm 98 N for 15 s 4 to 5 mm 49 N for 15 s 3 mm 29 N for 15 s			
Ambient tempera- ture	Operating: – 25°C to 70°C			

Note: 1. The contact resistance of the connector.

2. The dielectric strength of the connector.

■ Recommended Cables

	ble outer	Core sizes				
diameter		Crimping models	Soldering models	Screw-on models		
6 mm	5 to 6 mm	Two types of con-	0.5 mm ² max.	0.18 to		
4 mm	4 to 5 mm	tacts are avail- able.		0.75 mm ²		
3 mm	3 to 4 mm	• 0.18 to 0.3 mm ²				
		• 0.5 to 0.75 mm ²				

■ Materials and Finish

Ite	em	XS2F/H/W	XS2M/R/P	XS2C/G	
Contacts	Materials	Phosphor bronze	Brass		
	Finish	Nickel base, 0.4	-μm gold plating		
Fixtures	Materials	Brass (See note	2.)		
	Finish	Nickel plated (S	ee note 2.)		
Pin Block	Materials	PBT resin (UL94V-0)	PA resin (UL94V-0)	PBT resin (UL94V-0)	
	Finish	For DC: light gra	ay; for AC: dark g	ray	
O-ring/rub	ber bushing	Rubber			
Cover		Polyester elas- tomer		PBT resin (UL94V-0)	
Сар				PBT resin (UL94V-0)	
Cable clar	np			PA resin (UL94V-0)	
Pin clamp					
Lock spring				LCP resin (UL94V-0)	
Watertight	bushing			Rubber	
Ring				Steel	

Note: 1. The XS2H does not have an O-ring.

2. The T-joint of the XS2R is aluminum/white.

■ Socket Appearance

DC t	уре	AC 1	type
Male contacts	Female contacts	Male contacts	Female contacts

Note: The AC and DC connectors are different as shown here and therefore cannot be connected together.

OMRON

■ List of Products

Name	Model		Appearance	Page
Connectors attached to Cable	XS2W Sockets and Plugs on Cable	e Ends		3 to 4
	XS2F Sockets on One Cable End			6 to 10
	XS2H Plugs on One Cable End			11 to 12
Connector Assemblies (Crimping, Soldering, or Screw-on)	XS2G Plug Assemblies			16, 18
Used to enable using connectors for sensor	XS2C Socket Assemblies		Jampon Jampon	17, 19
cables and relay cables.	XS2F Crimp Tool (for Crimping Co	nnectors)		27
	XW4Z Screwdriver (for Screw-on C	Connectors)		29
Terminal Box Connectors Used to enable using connectors for terminal boxes.	XS2P Panel-mounting Sockets			20
T-Joints and Y-Joints Used for branching and for daisy-chain connec- tions.	XS2R T-Joint/Y-Joint Plug/Socket Connectors	T-Joints		22 to 23
		Y-Joints		21
Sensor Connector Assemblies Used to enable using connectors in sensors.	XS2M Plugs Embedded Plugs with Screw Threads			24 to 25
	Embedded Plugs with No Screw Threads			
Panel-mounting Con- nectors Used to enable using I/ O box connectors	XS2M Plugs	Flange- mounting Plugs		
mounted to panels.		Screw-mount- ing Plugs		

Sockets and Plugs on Cable Ends

XS2W

■ Model Number Legend

Use this model number legend to identify products from their model number. When ordering, use a model number from the table in *Ordering Information*.

1. Type

W: Connectors connected to cable, socket and plug on cable ends

2. AC/DC (Mating Section Form)

D: For DC

3. Connector Poles

4: 4 poles 5: 5 poles

4. Contact Plating

2: 0.4-μm gold plating

5. Cable Connection Direction

1: Straight/straight

2: L-shaped/L-shaped

3: Straight (XS2F)/L-shaped (XS2H)

4: L-shaped (XS2F)/straight (XS2H)

6. Cable Length

A: 0.3 m (straight/straight only)

B: 0.5 m (straight/straight only)

C: 1 m (straight/straight only)

D: 2 m

E: 3 m (straight/straight only)F: 4 m (straight/straight only)

G: 5 m

G: 5 mH: 7 m (straight/straight only)

J: 10 m (straight/straight only)

K: 15 m (straight/straight only)

L: 20 m (straight/straight only)

7. Connections

8: Brown White Blue Black (for DC)

Pin No.

1 2 3 4 5

G: Brown White Blue Black Gray

3. Connectors on One End/Both Ends

1: Both ends

9. Cable Specifications

A: Standard cable

R: Vibration-proof robot cable (straight/straight only)

F: Fire-retardant, vibration-proof cable

XS2W-D42 - 81-A Connectors with Standard Cable

XS2W-D421-81-R Connectors with Vibration-proof Robot Cable (Straight/Straight)

■ Ordering Information


Cable type	Cable connection	tion No. of cable Cable core	Cable length	DC		UL-	
	direction	cores	cross- sectional area	(m)	Model	Minimum order	listed
Standard cable	Straight/Straight	4	0.5 mm ²	1	XS2W-D421-C81-A	10	Yes
				2	XS2W-D421-D81-A		Yes
				5	XS2W-D421-G81-A	5	Yes
				10	XS2W-D421-J81-A		Yes
	L-shaped/L-shaped]		2	XS2W-D422-D81-A	10	Yes
				5	XS2W-D422-G81-A	5	Yes
	Straight/L-shaped]		2	XS2W-D423-D81-A	10	Yes
				5	XS2W-D423-G81-A	5	Yes
	L-shaped/Straight			2	XS2W-D424-D81-A	10	Yes
				5	XS2W-D424-G81-A	5	Yes
Vibration-proof ro-	Straight/Straight			1	XS2W-D421-C81-R	10	
bot cable				2	XS2W-D421-D81-R		
				5	XS2W-D421-G81-R	5	
				10	XS2W-D421-J81-R		

Note: 1. Orders are accepted in multiples of the minimum order.


2. Ask your OMRON representative about other cable lengths, and about 5-core cables.

■ Dimensions


Straight/Straight Connectors




L-shaped/L-shaped Connectors

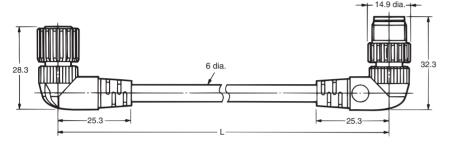


Wiring Diagram for 4 Cores




Straight/L-shaped Connectors

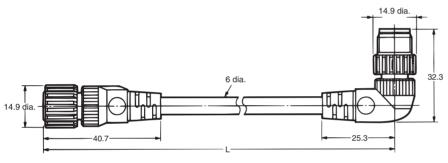

Wiring Diagram for 5 Cores



L-shaped/Straight Connectors

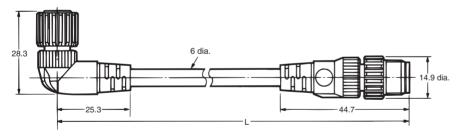

OMRON

Sockets on One Cable End

XS2F

■ Model Number Legend

Use this model number legend to identify products from their model number. When ordering, use a model number from the table in *Ordering Information*.

1. Type

F: Connector connected to cable, socket on one cable end

2. AC/DC (Mating Section Form)

A: For AC

D: For DC

3. Connector Poles

4: 4 poles

5: 5 poles

4. Contact Plating

0.4-μm gold plating

5. Cable Connection Direction

1: Straight

2: L-shaped

6. Cable Length

A: 0.3 m

B: 0.5 m

C: 1 m

D: 2 m

E: 3 m

F: 4 m

G: 5 m

H: 7 m

J: 10 m

K: 15 m

L: 20 m

Only the 2 m (D) and 5 m (G) cables are available for cables with 5 poles.

7. Connections

A: Brown --- Blue (for DC)

B: --- Brown Blue (for DC)

C: Brown --- Blue Black

8: Brown White Blue Black (for DC)

9: Brown White Blue Black (for AC)

Pin No.

1 2 3 4 9

G: Brown White Blue Black Gray

3. Connectors on One End/Both Ends

0: One end

9. Cable Specifications

A: Standard cable

R: Vibration-proof robot cable (straight/straight only)

F: Fire-retardant, vibration-proof cable

TR: For E2E Proximity Sensor (See note.)

Note: Refer to page 9 for connections. Connections for this item are different to those specified at item 7. A standard cable is used.

Designations for DC Polarity (For Limit Switches and Sensors)

6: Cable Length

3: 2 m

4: 5 m

7: Connections

Pin No.

1 2 3 4

1: --- Black White Connectors on One End/Both Ends

0: One end

9: Cable Specifications

Not designated.

Note: Model number standards are different for items 6, 7, and 9 for connectors with DC polarity.

XS2F-□42□-□□0-A	Connectors with Standard Cable
XS2F-□42□-□□0-R	Connectors with Vibration-proof Robot Cable
XS2F-□42□-□□0	DC-pole Connectors with Standard Cable

■ Ordering Information


Cable type	Cable	No. of	No. of	Cable	Мо	odel	Minimum	UL-listed
	connection direction	cable cores	cable cores	length (m)	DC	AC	order	
Standard cable	Straight	2	0.5 mm ²	1	XS2F-D421-CA0-A	XS2F-A421-CB0-A	10	
		3	1		XS2F-D421-CC0-A			
		4			XS2F-D421-C80-A	XS2F-A421-C90-A		Yes
		2		2	XS2F-D421-DA0-A	XS2F-A421-DB0-A	10	
		3			XS2F-D421-DC0-A			
		4			XS2F-D421-D80-A	XS2F-A421-D90-A		Yes
		2		5	XS2F-D421-GA0-A	XS2F-A421-GB0-A	5	
		3			XS2F-D421-GC0-A			
		4			XS2F-D421-G80-A	XS2F-A421-G90-A		Yes
		2		10	XS2F-D421-JA0-A	XS2F-A421-JB0-A	5	
		3			XS2F-D421-JC0-A			
		4			XS2F-D421-J80-A	XS2F-A421-J90-A		Yes
	L-shaped	2		1	XS2F-D422-CA0-A	XS2F-A422-CB0-A	10	
		3			XS2F-D422-CC0-A			
		4			XS2F-D422-C80-A			Yes
		2		2	XS2F-D422-DA0-A	XS2F-A422-DB0-A	10	
		3			XS2F-D422-DC0-A			
		4			XS2F-D422-D80-A			Yes
		2		5	XS2F-D422-GA0-A	XS2F-A422-GB0-A	5	
		3			XS2F-D422-GC0-A			
		4			XS2F-D422-G80-A			Yes
		2		10	XS2F-D422-JA0-A	XS2F-A422-JB0-A	5	
		3			XS2F-D422-JC0-A			
		4			XS2F-D422-J80-A			Yes
Vibration-proof	Straight	2		1	XS2F-D421-CA0-R	XS2F-A421-CB0-R	10	
robot cable		4			XS2F-D421-C80-R	XS2F-A421-C90-R		
		2		2	XS2F-D421-DA0-R	XS2F-A421-DB0-R	10	
		4			XS2F-D421-D80-R	XS2F-A421-D90-R		
		2		5	XS2F-D421-GA0-R	XS2F-A421-GB0-R	5	
		4			XS2F-D421-G80-R	XS2F-A421-G90-R		
		2		10	XS2F-D421-JA0-R	XS2F-A421-JB0-R	5	
		4			XS2F-D421-J80-R	XS2F-A421-J90-R		
	L-shaped	2		1	XS2F-D422-CA0-R	XS2F-A422-CB0-R	10	
	·	4			XS2F-D422-C80-R			
		2	1	2	XS2F-D422-DA0-R	XS2F-A422-DB0-R	10	
		4			XS2F-D422-D80-R			
		2	1	5	XS2F-D422-GA0-R	XS2F-A422-GB0-R	5	
		4	1	1	XS2F-D422-G80-R			
		2	1	10	XS2F-D422-JA0-R	XS2F-A422-JB0-R	5	
		4	1	1	XS2F-D422-J80-R			
Standard cable	Straight	2	1	2	XS2F-D421-310	XS2F-A421-310	10	
(non-polar)		2	1	5	XS2F-D421-410	XS2F-A421-410	5	
	L-shaped	2	1	2	XS2F-D422-310	XS2F-A422-310	10	
	<u>'</u>	2	1	5	XS2F-D422-410	XS2F-A422-410	5	

Note: 1. Orders are accepted in multiples of the minimum order.


^{2.} Ask your OMRON representative about other cable lengths.

■ Dimensions

Straight Connectors

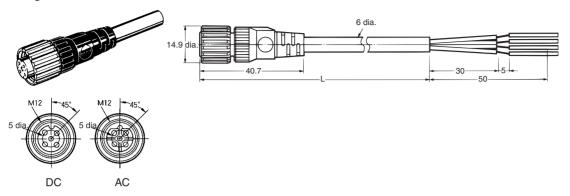

L-shaped Connectors

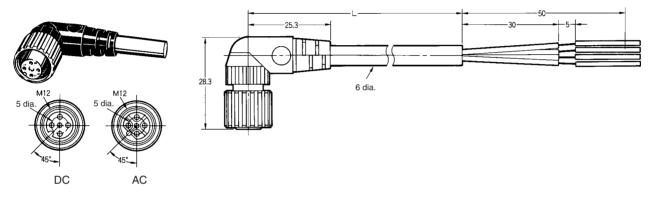

Wiring Diagram

Item	Standard cable Vibration-proof robot cable	Standard cable (non-polar DC) XS2F-□42□-□□0		
	XS2F-□42□-□□0-A XS2F-□42□-□□0-R			
Two-core model	Contact 1 Brown No. 2 Blue (DC) Cable lead colors	Contact (No. (2) Black		
	Contact () (AC) (AC) Cable lead colors	White Cable lead colors		
Three-core model	Contact No. Brown Blue Black (DC) Cable lead colors			
Four-core model	Contact No.			
	(DC/AC) Cable lead colors			

XS2F-□42□-□□0-TR Connecting Cables for E2E Proximity Sensors

The pin numbers and lead colors of the E2E Proximity Sensors are used for the XW2E Connecting Cable. This cable is designed specifically for the E2E. It is distinguished from normal XS2F models by the dark gray cable and the -TR suffix added to the 4-digit lot number.

■ Ordering Information

Cable connection	No. of cable	Cable core	Cable length	Model		Minimum order	
direction	cores	cross- sectional area	(m)	DC	AC		
Straight	2	0.5 mm ²	2	XS2F-D421-DD0-TR	XS2F-A421-DB0-TR	10	
			5	XS2F-D421-GD0-TR	XS2F-A421-GB0-TR	5	
L-shaped			2	XS2F-D422-DD0-TR	XS2F-A422-DB0-TR	10	
			5	XS2F-D422-GD0-TR	XS2F-A422-DB0-TR	5	
Straight	3		2	XS2F-D421-DC0-TR		10	
			5	XS2F-D421-GC0-TR		5	
L-shaped	1		2	XS2F-D422-DC0-TR		10	
			5	XS2F-D422-GC0-TR		5	

Note: 1. Orders are accepted in multiples of the minimum order.

■ Applicable Proximity Sensors

XS2F model	Proximity Sensor	Old connector model
XS2F-D42□-□D0-TR	E2E-X□D1-P1 E2E-X□D1-M1J-T E2E-X□D2-P1	Y92E-P1D2□
XS2F-D42□-□C0-TR	E2E-X□E1-P1	Y92E-P1D3□
XS2F-D42□-□80-□	E2E-X□D1S-P1	Y92E-P1D4□


Note: There is no difference in wiring method and cable wire color between the XS2F and Y92E.

^{2.} The XS2F Cables for E2E Proximity Sensors have different model number standards from those for standard XS2F models.


■ Dimensions

Straight Connectors






L-shaped Connectors

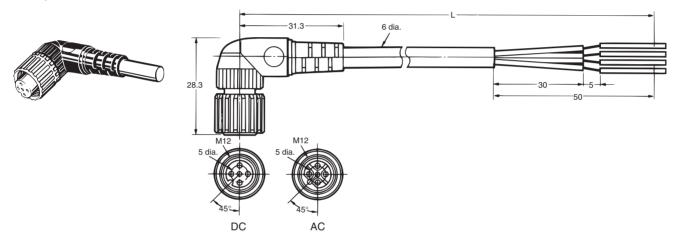

Wiring Diagram

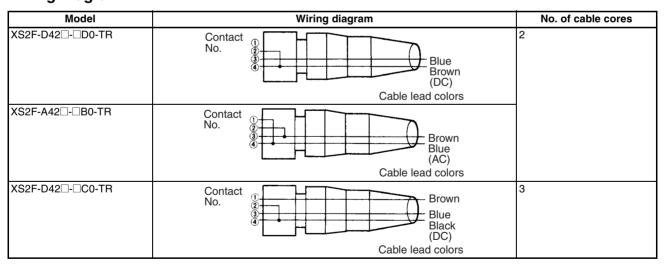

XS2F-D521-□G0-A 5-pole Connectors for DC

■ Ordering Information

	No. of cable cores		Cable length (m)	DC	
direction		sectional area		Model	Minimum order
Straight	5	0.3 mm ²	2	XS2F-D521-DG0-A	10
			5	XS2F-D521-GG0-A	5


- Note: 1. Orders are accepted in multiples of the minimum order.
 - 2. Ask your OMRON representative about other cable lengths.

■ Dimensions

Straight Connectors




Note: Use the XS2F-D521-□G0-A in combination with the XS2H-D521-□G0-A.

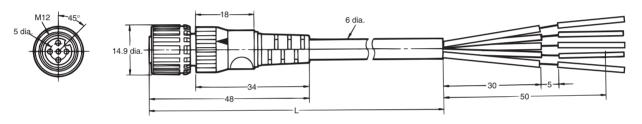

Wiring Diagram

Contact No.



Pin Arrangements (Engagement Side)



Plugs on One Cable End

XS2H

■ Model Number Legend

Use this model number legend to identify products from their model number. When ordering, use a model number from the table in *Ordering Information*.

1. Type

H: Connector connected to cable, plug on one cable end

2. AC/DC (Mating Section Form)

A: For AC D: For DC

3. Connector Poles

4: 4 poles 5: 5 poles

Contact Plating2: 0.4-μm gold plating

5. Cable Connection Direction

1: Straight

6. Cable Length

A: 0.3 m B: 0.5 m C: 1 m D: 2 m 7. Connections

Pin No.

1 2 3 4

A: Brown --- --- Blue (for DC)
B: --- --- Brown Blue (for AC)

C: Brown --- Blue Black (for DC)8: Brown White Blue Black (for DC)

: Brown White Blue Black (for AC)

Pin No.

2 3 4 5

G: Brown White Blue Black Gray

Connectors on One End/Both Ends

1: One end

9. Cable Specifications

A: Standard cable

R: Vibration-proof robot cable (straight/straight only)

F: Fire-retardant, vibration-proof cable

■ Ordering Information


No. of	Cable	No. of cable	Size	Cable	Model		Minimum	UL-listed
connector poles	connection direction	cores		length (m)	DC	AC	order	
4	Straight	2	0.5 mm ²	0.3	XS2H-D421-AA0-A	XS2H-A421-AB0-A	10	
		3			XS2H-D421-AC0-A			
		4			XS2H-D421-A80-A	XS2H-A421-A90-A		Yes
		2		1	XS2H-D421-CA0-A	XS2H-A421-CB0-A		
		3			XS2H-D421-CC0-A			
		4			XS2H-D421-C80-A	XS2H-A421-C90-A		Yes
5		5	0.3 mm ²	0.3	XS2H-D521-AG0-A			
				1	XS2H-D521-CG0-A			

Note: Orders are accepted in multiples of the minimum order.

XS2H-□421-□□0-A Connectors on Standard Cable


■ Dimensions

Straight Connectors

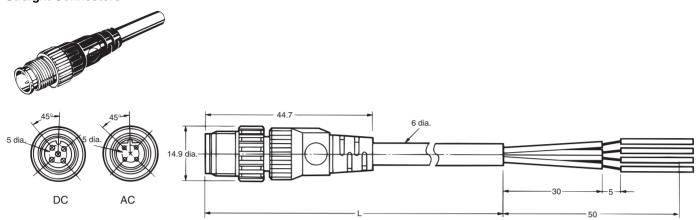


Wiring Diagram


Two-core Model

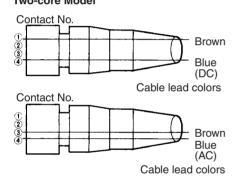

Three-core Model



Four-conductor Model




XS2H-D521-□G0-A Connectors on DC Cable (Five Poles)

■ Dimensions

Straight Connectors




Note: Use the XS2H-D521-□G0-A in combination with the XS2F-D521-□G0-A.

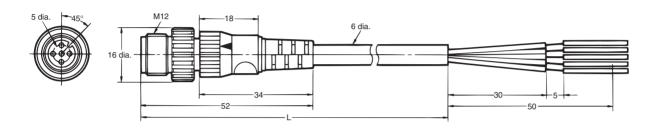

Wiring diagram

Pin Arrangements (Engagement Side)

Five-conductor Model







Sensor I/O Connectors on Cables (8-pole)

XS2

■ Ordering Information

Connector type	Cable connection direction	Number of cores	Cable length (m)	Model
Panel-mounting socket				XS2P-D821-2
				XS2P-D822-2
Panel-mounting plug				XS2M-D824-4
Plug on one cable end	Straight	8	0.3	XS2H-D821-AH0-C
			1	XS2H-D821-CH0-C
Socket on one cable end			2	XS2F-D821-DH0-C
			5	XS2F-D821-GH0-C
Plug and socket on ca-			2	XS2W-D821-DH1-C
ble ends			5	XS2W-D821-GH1-C

■ Pin Numbers and Cable Lead Colors

		Pin number						
XS2F/XS2H/XS2W	1	2	3	4	5	6	7	8
cable lead colors	White	Brown	Green	Yellow	Gray	Pink	Blue	Shield

■ Ratings and Characteristics

Rated current	1.5 A
Rated voltage	36 VDC
Contact resistance	40 M Ω max. (at 20 mVDC max. and 100 mA max.)
Insulation resistance	1,000 MΩ min. (at 500 VDC)
Dielectric strength	1,000 VAC for 1 min (leakage current: 1 mA max.)
Degree of protection	IP67
Insertion durability	200 times min.
Operating temperature	– 25 to 70°C


■ Materials and Finish

Contacts	Brass/nickel base, 0.4-μm gold-plating
Bracket, body, M16 nuts	Brass/nickel plated
Pin Block	PBT resin (UL94V-0)/light gray
Cover (See note 1.)	Polyester elastomer (UL94V-0)/black
Seal rubber and O- ring (See note 2.)	Rubber

Note: 1. XS2F/XS2H/XS2W only.

2. O-rings are on sockets only.


■ Wiring Example

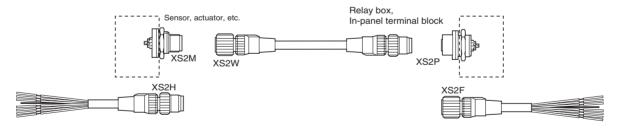

■ Dimensions


XS2H Plug on One Cable End (M12)






XS2F Socket on One Cable End (M12)






XS2W Plug and Socket on Cable Ends (M12)






XS2P-D821-2 Panel-mounting Socket (M12) with Solder Cup Pins and Rear Lock



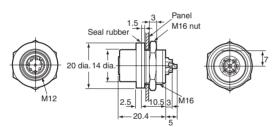


XS2P-D822-2 Panel-mounting Socket (M12) with Solder Cup Pins and Front Lock






XS2M-D824-4 Panel-mounting Plug (M12) with Solder Cup Pins and Front Lock

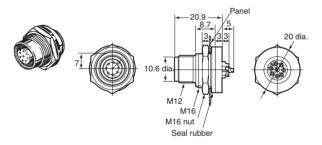


Panel Cutouts

Connector Pin Numbers (from Mating Side)







Note: 1. Mounting panel thickness: 1 to 4 mm

- 2. Applicable core wire size for solder cup pins: 0.5 mm² max.
- 3. The M16 nut and seal rubber are included.

Crimping/Soldering Plug Assemblies

XS2G

■ Ordering Information

Suitable cable dia.	Cable connection	Connection		Minimum order	
(mm)	direction	method	DC	AC	
6-mm-dia. model (5 to 6 mm dia.)	Straight	Crimping	XS2G-D4C1	XS2G-A4C1	50
		Soldering	XS2G-D421	XS2G-A421	
	L-shaped	Soldering	XS2G-D422		
4-mm-dia. model (4 to 5 mm dia.)	Straight	Crimping	XS2G-D4C3	XS2G-A4C3	
		Soldering	XS2G-D423	XS2G-A423	
	L-shaped	Soldering	XS2G-D424		
3-mm-dia. model	Straight	Crimping	XS2G-D4C5	XS2G-A4C5	
(3 to 4 mm dia.)		Soldering	XS2G-D425	XS2G-A425	
	L-shaped	Soldering	XS2G-D426		

Note: 1. Orders are accepted in multiples of the minimum order.

2. Crimping plug contacts are sold separately.


■ Dimensions

XS2G-□4C□ (Crimping Model) XS2G-□42□ (Soldering Model) Straight Connectors










XS2G-D42□ (Soldering Model) L-shaped Connectors




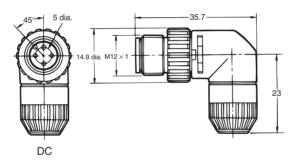

XS2U Crimping Pin for XS2G

■ Dimensions

XS2U-312□ (Plug Pin)



Dimensions

Model	Suitable core	Dime	nsion (No. of	
	size (mm²)	Α	В	C	slits
XS2U- 3121	0.18 to 0.3	20.0	6.1	8.0	1
XS2U- 3122	0.5 to 0.75	20.1	6.2	1.3	0

■ Ordering Information

Suitable core size (mm²)	Model	Minimum order
0.18 to 0.3	XS2U-3121	100
0.5 to 0.75	XS2U-3122	

Note: Orders are accepted in multiples of the minimum order.

Crimping/Soldering Socket Assemblies

XS2C

■ Ordering Information

Suitable cable dia.	Cable connection	Connection		Model		
(mm)	direction	method	DC	AC		
6-mm-dia. model	Straight	Crimping	XS2C-D4C1	XS2C-A4C1	50	
(5 to 6 mm dia.)		Soldering	XS2C-D421	XS2C-A421		
	L-shaped	Crimping	XS2C-D4C2	XS2C-A4C2		
1		Soldering	XS2C-D422	XS2C-A422		
4-mm-dia. model	Straight	Crimping	XS2C-D4C3	XS2C-A4C3		
(4 to 5 mm dia.)		Soldering	XS2C-D423	XS2C-A423		
	L-shaped	Crimping	XS2C-D4C4	XS2C-A4C4		
		Soldering	XS2C-D424	XS2C-A424		
3-mm-dia. model	Straight	Crimping	XS2C-D4C5	XS2C-A4C5		
(3 to 4 mm dia.)		Soldering	XS2C-D425	XS2C-A425		
	L-shaped	Crimping	XS2C-D4C6	XS2C-A4C6		
		Soldering	XS2C-D426	XS2C-A426		

Note: 1. Orders are accepted in multiples of the minimum order.

2. Crimping plug contacts are sold separately.


■ Dimensions

XS2C-□4C□ (Crimping Model) XS2C-□42□ (Soldering Model) Straight Connectors










L-shaped Connectors








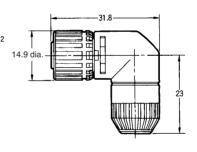

XS2U Crimping Pin for XS2C

■ Dimensions

XS2U-222□ (Socket Pin)



Dimensions	
------------	--

Model	Suitable core size	Di	Dimension (mm)		
	(mm²)	Α	В	С	
XS2U-2221	0.18 to 0.3	16.7	6.1	0.8	1
XS2U-2222	0.5 to 0.75	16.8	6.2	1.3	0

■ Ordering Information

Suitable core size (mm ²)	Model	Minimum order
0.18 to 0.3	XS2U-2221	100
0.5 to 0.75	XS2U-2222	

Note: Orders are accepted in multiples of the minimum order.



Screw-on Plug Assemblies

XS2G

■ Ordering Information

No. of poles	Suitable cable dia.	Mo	odel	Minimum order
	(mm)	Straight connectors (for DC) L-shaped connectors (for DC)		
5	8-mm-dia. model (7 to 8 mm dia.)	XS2G-D5S7 <u>NEW</u>		50
	7-mm-dia. model (6 to 7 mm dia.)	XS2G-D5S9 <u>NEW</u>		
	6-mm-dia. model (5 to 6 mm dia.)	XS2G-D5S1 <u>NEW</u>	XS2G-D5S2 _{NEW}	
4	8-mm-dia. model (7 to 8 mm dia.)	XS2G-D4S7 <u>NEW</u>		
	7-mm-dia. model (6 to 7 mm dia.)	XS2G-D4S9 <u>NEW</u>		
	6-mm-dia. model (5 to 6 mm dia.)	XS2G-D4S1	XS2G-D4S2	
	4-mm-dia. model (4 to 5 mm dia.)	XS2G-D4S3	XS2G-D4S4	
	3-mm-dia. model (3 to 4 mm dia.)	XS2G-D4S5	XS2G-D4S6	

Note: 1. Orders are accepted in multiples of the minimum order.


2. XS2G Screw-on Plugs cannot be connected side-by-side to the CN1 and CN2 connectors of XS2R Y-Joint Sockets/Plugs.

■ Dimensions

XS2G-D5S7 (5-pole, Straight, Applicable Cable Outer Diameter: 8 mm) XS2G-D5S9 (5-pole, Straight, Applicable Cable Outer Diameter: 7 mm) XS2G-D4S7 (4-pole, Straight, Applicable Cable Outer Diameter: 8 mm) XS2G-D4S9 (4-pole, Straight, Applicable Cable Outer Diameter: 7 mm)








XS2G-D5S1 (5-pole, Straight, Applicable Cable Outer Diameter: 6 mm)
XS2G-D4S□ (4-pole, Straight, Applicable Cable Outer Diameter: 3, 4, or 6 mm)








XS2G-D5S2 (5-pole, L-shaped, Applicable Cable Outer Diameter: 6 mm) XS2G-D4S□ (4-pole, L-shaped, Applicable Cable Outer Diameter: 3, 4, or 6 mm)



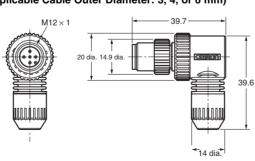



Screw-on Socket Assemblies

XS2C

■ Ordering Information

No. of poles	Suitable cable dia.	Mo	Model	
	(mm)	Straight connectors (for DC)	L-shaped connectors (for DC)	
5	8-mm-dia. model (7 to 8 mm dia.)	XS2C-D5S7 <u>NEW</u>		50
	7-mm-dia. model (6 to 7 mm dia.)	XS2C-D5S9 <u>NEW</u>		
	6-mm-dia. model (5 to 6 mm dia.)	XS2C-D5S1 <u>NEW</u>	XS2C-D5S2 <u>NEW</u>	
4	8-mm-dia. model (7 to 8 mm dia.)	XS2C-D4S7 <u>NEW</u>		
	7-mm-dia. model (6 to 7 mm dia.)	XS2C-D4S9 <u>NEW</u>		
	6-mm-dia. model (5 to 6 mm dia.)	XS2C-D4S1	XS2C-D4S2	
	4-mm-dia. model (4 to 5 mm dia.)	XS2C-D4S3	XS2C-D4S4	
	3-mm-dia. model (3 to 4 mm dia.)	XS2C-D4S5	XS2C-D4S6	


Note: Orders are accepted in multiples of the minimum order.

■ Dimensions

XS2C-D5S7 (5-pole, Straight, Applicable Cable Outer Diameter: 8 mm) XS2C-D5S9 (5-pole, Straight, Applicable Cable Outer Diameter: 7 mm) XS2C-D4S7 (4-pole, Straight, Applicable Cable Outer Diameter: 8 mm) XS2C-D4S9 (4-pole, Straight, Applicable Cable Outer Diameter: 7 mm)








XS2C-D5S1 (5-pole, Straight, Applicable Cable Outer Diameter: 6 mm)
XS2C-D4S□ (4-pole, Straight, Applicable Cable Outer Diameter: 3, 4, or 6 mm)








39.6

XS2C-D5S2 (5-pole, L-shaped, Applicable Cable Outer Diameter: 6 mm)
XS2C-D4S□ (4-pole, L-shaped, Applicable Cable Outer Diameter: 3, 4, or 6 mm)



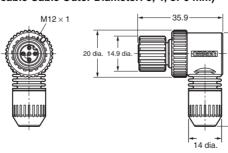



Panel-mounting Sockets for Terminal Boxes

XS2P

■ Ordering Information

Lock method	Pin shape	Model		Minimum order
		DC	AC	
Rear lock	Solder cup pin	XS2P-D421-2	XS2P-A421-2	50
Front lock	Solder cup pin	XS2P-D422-2	XS2P-A422-2	
	DIP pin	XS2P-D422-1	XS2P-A422-1	

Note: Orders are accepted in multiples of the minimum order.


■ Dimensions

XS2P-□421-2 (with Solder Cup Pins) Rear Lock Model







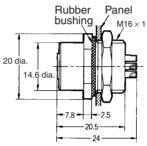





XS2P-□422-1 (with DIP Pins) XS2P-□422-2 (with Solder Cup Pins)


Front Lock Model








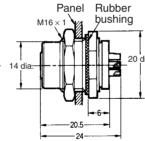

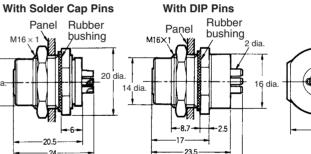


Panel Cutout



Note: The panel thickness is 1 to 4 mm.

PCB-mounting Dimensions





Y-Joint Plug/Socket Connectors

XS2R


■ Ordering Information

Туре	Connector		Minimum order	
		Cable length L (m)	Model	
With cable	Connectors on cable	0.5	XS2R-D426-B11-F	5
	ends	1	XS2R-D426-C11-F	
		2	XS2R-D426-D11-F	
		3	XS2R-D426-E11-F	
	Connector on one ca-	2	XS2R-D426-D10-F	
	ble end	5	XS2R-D426-G10-F	
Without cable	Y-Joint plug/socket		XS2R-D426-1	10
			XS2R-D426-5	
			XS2R-D426-81	
			XS2R-D426-82	

Note: 1. Orders are accepted in multiples of the minimum order.

2. XS2G Screw-on Plugs cannot be connected side-by-side to the CN1 and CN2 connectors.

■ Dimensions

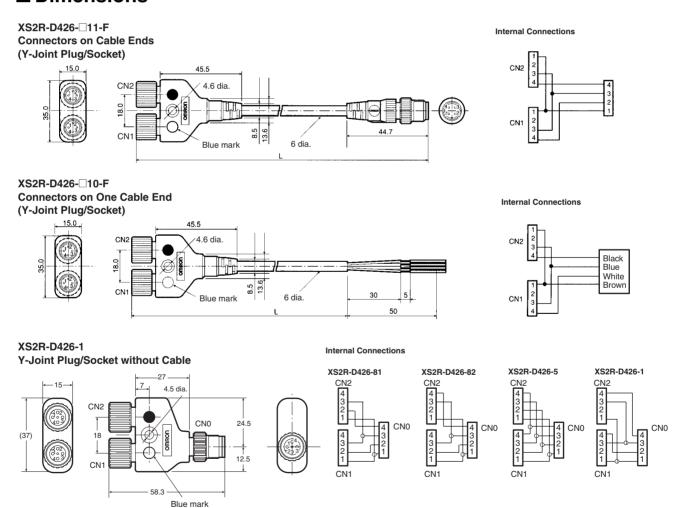

T-Joint Plug/Socket Connectors


XS2R

■ Ordering Information

Туре	DC			
	Model	Minimum order		
Aggregate model	XS2R-D422-1	20		
	XS2R-D422-5			
Bifurcated model	XS2R-D423-1			
Daisy-chain model	XS2R-D424-1			

Note: Orders are accepted in multiples of the minimum order.


■ Dimensions

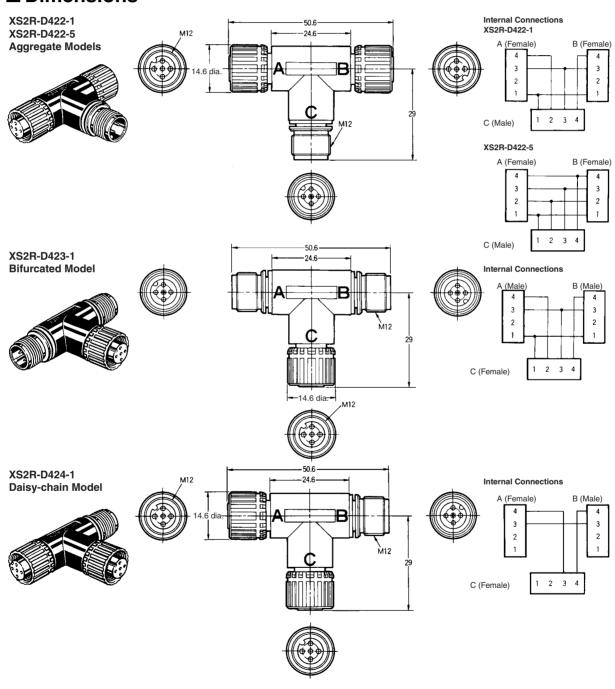

■ Precautions

Before using the XS2R for Sensors, make sure that the wiring of the Sensors and the internal connections of the XS2R are correct.

XS2R Application Examples

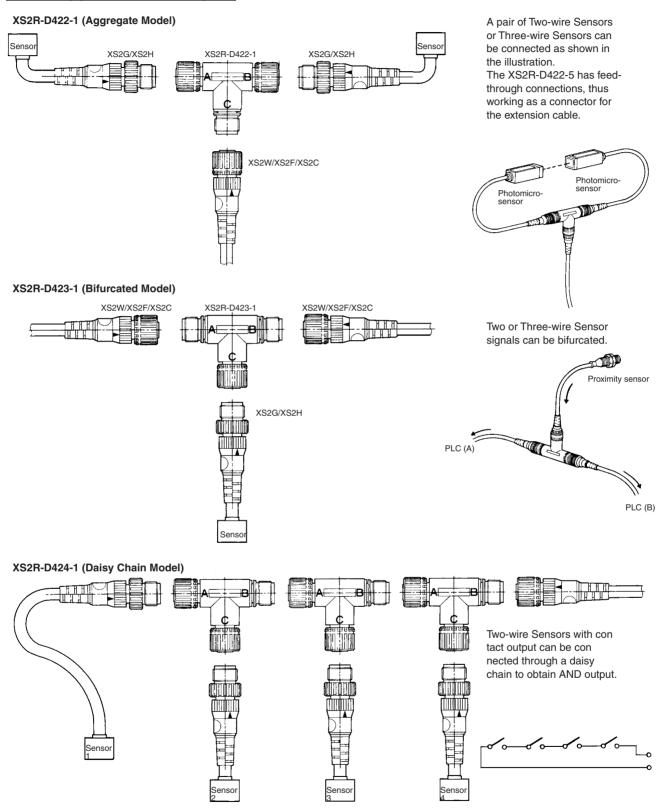

Sensor-embedded/Panel-mounting Plugs

XS2M

■ Ordering Information

Mounting method	Pin shape		Model	
		DC	AC	
Embedded with screw threads	Solder cup pin	XS2M-D421	XS2M-A421	50
Embedded with no screw threads		XS2M-D422	XS2M-A422	
Flange-mounting		XS2M-D423	XS2M-A423	
Screw-mounting	DIP pin	XS2M-D424-1	XS2M-A424-1	
	Solder cup pin	XS2M-D424-2	XS2M-A424-2	

Note: Orders are accepted in multiples of the minimum order.


XS2M-□42□ Sensor-embedded Plugs

■ Dimensions


XS2M-D421 (DC) XS2M-A421 (AC) (Embedded Plug with Screw Threads)





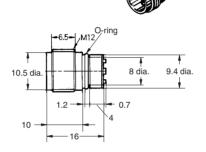




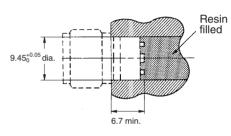

Note: After mounting, anchor the solder cups by injecting resin.


XS2M-D422 (DC) XS2M-A422 (AC) (Embedded Plug without Screw Threads)



Mounted Dimensions

Resin

filled




Note: After mounting, anchor the solder cups by injecting resin.


XS2M- □ 423	Flange-mounting Panel-mounting Plugs
XS2M-□424-□	Screw-mounting Panel-mounting Plugs


■ Dimensions


XS2M-D423 (For DC) XS2M-A423 (For AC) (Flange-mounting Model)




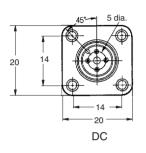

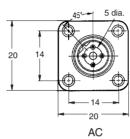


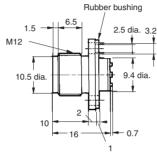

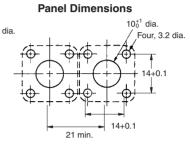






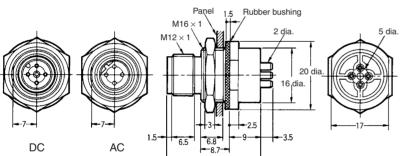


Panel Cutout



Note: The panel thickness is 1 to 4 mm.

PCB-mounting Dimensions



XS2 Accessories


■ XS2 Connector Covers

Water-resistive Covers

XS2Z-11


The Water-resistive Cover ensures IP67. When mounting the Water-resistive Cover to a Connector, be sure to apply a torque range between 0.39 and 0.49 N·m to tighten the Water-resistive Cover.





XS2Z-12






■ Ordering Information

Model	Minimum order	Material	Suitable connector		
			Model	Mounting portion	
XS2Z-11	50	Brass/nickel plated	XS2G/XS2H/XS2M/XS2R	M12 male screw	
XS2Z-12]		XS2C/XS2R/XS2F/XS2P/XW3B	M12 female screw (thread bracket)	

Note: Orders are accepted in multiples of the minimum order.

Dust Covers

XS2Z-13




The Dust Cover is for dust prevention and does not ensure IP67 degree of protection. When mounting the Dust Cover to a connector, be sure to press the Dust Cover onto the Connector until the Connector is fully inserted into the Dust Cover.

XS2Z-15/XS1Z-14







■ Ordering Information

Model	Minimum	Material	Suitable connector		
	order		Model Mounting portion		
XS2Z-13	50	Transparent polyvinyl chloride	XS2G/XS2H/XS2M/XS2R	M12 male screw	
XS2Z-14		Red polyvinyl chloride		Pin block (female pins)	
XS2Z-15			XW3B	M12 female screw (thread bracket)	

Note: Orders are accepted in multiples of the minimum order.

■ Tools

Crimp Tool

XY2F-0002



Locator

XY2F-0003



Pin-block Extraction Tool


XY2F-0001



Use the Crimp Tool to crimp a cable core to the XS2U Crimping Pin used with the XS2C or XS2G Crimping Connector.

Note: The XY2F-0002 Crimp Tool is DMC's AFM8 (M22520/2-01).

Mount the XY2F-0003 Locator (sold separately) to the locator guide of the Crimp Tool with a screw provided with the XY2F-0003 Locator.

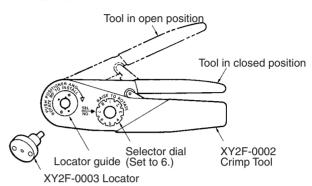

Use this tool to extract a Pin Block from the covers in order to make wiring changes or corrections after the cover has been mounted to the pin block for Connector Assemblies (XS2C/XS2G, soldering/crimping).

■ Assembly Procedure for XS2C/XS2G Connector Assemblies

Connector and Cable External Diameters


- Connectors for 6-, 4-, and 3-mm-diameter Cables (i.e., Cables that are 5 to 6, 4 to 5, and 3 to 4 mm in diameter respectively) are available. When assembling a Connector used with a cable, make sure that the external diameter of the Connector is suited to that of the cable.
- Connectors for 6-mm-diameter Cables use white cable clamps.
 Connectors for 4 and 3-mm-diameter Cables use black cable clamps.

A watertight bushing for 6-mm-diameter Cable has no stripe, that for 4-mm-diameter Cable has a single stripe, and that for 3-mm-diameter Cable has two stripes.


Note: When connecting a commercially available cable to a connector assembly, use a cable with an outside diameter of 3 to 6 mm and core sizes of 0.18 to 0.75 mm² for crimping connectors and 0.5 mm² maximum for soldering connectors.

Component Insertion

Straight Connectors



L-shaped Connectors




Note: A ring is not required for Screw-on Connectors.

 As shown in the above illustration, connect the above components to the Cable with its end processed.

Note: The diagram shows the cover for Soldering or Crimping Connectors. The shape of the cover is different for Screw-on Connectors

Wiring (Processing Cable Ends)

Soldering Connectors



- Strip 10 mm of the Cable sheath and 4 mm of each core.
- Before soldering cores and solder cup pins together, solder-coat each of them.
- The following conditions are recommended for soldering each solder cup pin.


Soldering iron: 30 to 60 W

Soldering temperature: 280°C to 340°C

Soldering period: 3 s max.

 The length marked *A should be 6.5 mm max., otherwise the proper degree of protection of the connector will not be maintained.


Crimping Connectors



- Strip 14 mm of the Cable sheath and 4 mm of each core.
- Make sure that each core is not damaged and its end strands are not spread out.
- Mount the XY2F-0003 Locator to DMC's AFM8 (M25520/2-01) Crimping Tool, both of which are sold separately, and set the selector dial of the Crimping Tool to 6 for the XS2U-□□21 and to 7 for the XS2U-□□22.
- After mounting the crimping pins to the Locator, fully insert the cores to the crimping pins.
- Squeeze the handle of the Crimp Tool to press-fit the cores to the crimping pins.


(Squeeze the handle firmly until the handle automatically returns to the release position.)

Crimping Cable Cores to Pin Clamp



 After press-fitting the cores to the pins, insert the pins into the pin clamp as shown in the illustration. Then make sure that the lead colors correspond to the pin clamp numbers that are identical to the connector pin numbers.

Mounting Pin Clamp to Pin Block

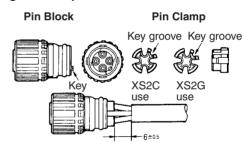


• Tentatively insert the pins to the pin block holes so that the key on the pin block will coincide with the key groove on the pin clamp. Then insert the cable along with the pin clamp.

Screw-on Connectors

Inserting Parts

Confirm that you have all of the required parts.

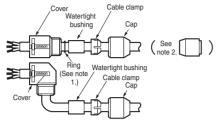


Insulation caps and insulation tubes are included with 5-pole Connectors (XS2C-D5S \square and XS2G-D5S \square).

Note: 1. Rings are not required with 7-mm and 8-mm cables.


2. Insert the waterproof bushing for 7-mm and 8-mm cables in the direction shown in the diagram.

Cable End Processing

Four-pole Connectors




 Loosen the screws on pins 1 to 4 and insert the cores according to the pin numbers.




 Use the special Screwdriver (XW4Z-00B) and tighten the screws securely so that the cores do not pull out (tightening torque: 0.15 to 0.2 N·m).

Five-pole Connectors


• Strip the cable sheath for a total of 15 mm and strip the core covering for 8 mm for the core to connect to pin 5.



- Connect the core to pin 5 (in the center) first.
- Insert the core from the side of the hold with the tab and tighten the screw securely (tightening torque: 0.15 to 0.2 N·m), and then cut off the excess wire with wire cutters.




 Bend the cable as shown below, attached the enclosed insulation cap, and then strip the other cores.



• Connect the cores to pins 1 to 4.

Connecting Shielded Cables to Five-pole Connectors

- Place the insulation tub on the drain line of the shield and connect ti to the terminal.
- Tighten the screw and then check visually to see if there is insulation between the cores.




• Connect the cores to pins 1 to 4.

Note: When tightening the screws, use the dedicated XW4Z-00B Screwdriver that matches with the screw-slot dimensions.



Inserting Pin Block

Pin Block Cover (Soldering Model) (Straight Model)




(Crimping Model)

(L-shaped Model)





- Mount the cover to the pin block so that the triangle mark on the pin block will coincide with the triangle mark on the cover.
- If the cover is used for an L-shaped model, the relationship between the position of the polarity key on the engaged side and cable connection direction will be determined by the direction in which the positioning key is inserted into the cover, which can be rotated by 90°.
- Fully insert the positioning key until the positioning key is hidden by the casing.

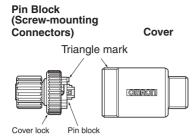


- Align the triangular marks on the pin block and cover and insert the pin block into the cover.
- Press them together firmly (0.39 to 0.49 N·m) until the pin block does not come out of the cover.

Mounting Cap

 After mounting the cover to the pin block and the cover snaps into place, tighten the cap securely by hand within a torque of 0.39 and 0.49 N·m.

Note: If the cap is not tighten securely enough, the degree of protection (IP67) may not be maintained or vibration may cause the cap to become loose. Do not tighten the cap with pliers or similar tools; they may damage the cap.



After fully tightening the cap, length A should be approximately one
of the following according to the cable external diameter and the
Connector model.

Connector	Cable external diameter (mm)			
	6 mm 5 mm 4 mm 3			
For 6-mm-dia. cable	1	0		
For 4-mm-dia. cable		2	1	
For 3-mm-dia. cable			2	1


After Assembly

• Confirm the insulation between cores after completing assembly.

■ Extraction Procedure


Disconnecting Components

• Disconnect all components on the cap side from the cover.

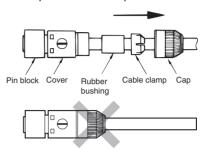


Extracting Pin Block


• Insert the claws of the Tool into the four holes of the cover.

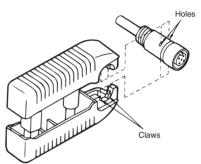

• Make sure that the pin block is outside the Tool.



Press the Tool so that the guides of the Tool are in close contact.
 Then pull the pin block straight.



-∕!∖ Caution

The pin block must not be extracted from the same Connector more than 3 times, otherwise the proper degree of protection of the pin block or Connector will not be maintained.

■ Precautions

Refer to Correct Use for precautions for individual products.

Correct Use

Mating


- XS2 and XS3 Connectors will not mate with each other.
- When using Sensors with Connectors or Limit Switches, use the Sensor I/O Connectors specified in the catalog.

Tightening Cap (Connector Assemblies)

- Do not use pliers to tighten caps, otherwise the caps may be damaged. Be sure to tighten each cap by hand within a torque range between 0.39 and 0.49 N·m.
- If caps are not tightened securely, the Connectors may not maintain their proper degree of protection (i.e., IP67) or the caps may become loose due to vibration.


Connector Connection and Disconnection

- Always turn OFF the power supply before connecting or disconnecting connectors.
- When connecting or disconnecting Connectors, be sure to hold the Connectors by hand. Do not hold the cable part when disconnecting Connectors.
- Do not touch the mating surfaces with wet hands. Remove an water on the Connectors or surrounding area before connecting or disconnecting Connectors. Water can cause internal shorts or insulation faults.
- Do not allow pieces of metal or powder to enter the mating sections.
- Connectors mating with sockets must be fully inserted into the sockets. Tighten the thread brackets carefully so that the threads will not be damaged.
- Fully tighten thread brackets within a torque range between 0.39 and 0.49 N·m and be sure that the threads of the opposite parts are hidden by the thread brackets.
- When disconnecting Connectors, be sure to loosen the thread brackets first. Do not loosen the caps.
- Thread brackets must be loosened in the cutout direction.

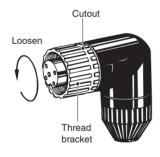

Connector Arrangement

• For safety, when constructing a connection system between a Sensor and panel with a connector, make sure that the connector plug is on the Sensor side and the connector socket is on the panel side (i.e., the female pins are located on the power-supply side).



Recommended Cables

 When connecting a commercially available cable to a connector assembly, use a cable with an outside diameter of 3 to 6 mm and core sizes of 0.18 to 0.75 mm² for crimping connectors and 0.5 mm² maximum for soldering connectors.

Degree of Protection

- Do not impose external force continuously on the joints of pin blocks and covers, otherwise the Connectors may not keep its proper degree of protection (i.e., IP67).
- The degree of protection of connectors (IP67) is not for a fully watertight structure. Do not use them underwater.
- The Connectors are not oil-resistant. Do not use them where they would be subject to oil.
- When using a Connector in a location subject to constant vibration or shock, secure them near the mating sections. The Connectors may become loose or fall off, and the degree of protection (IP67) may be lost.
- Connectors are of resin mold construction. Do not impose excessive force on them.

Storage

Do not store Connectors for long periods of time in the following locations

- · Locations subject to dust or high humidity
- · Locations subject to ammonia gas or sulfide gas

Changes in Standards Accompanying International Standardization

■ Changes in Standards for Sensor I/O Connectors Accompanying International Standardization

Changes in standards are progressing to enable international standardization of control components in line with movements in trade friction and EC unification. In Japan as well, domestic standards and regulations are being revised in the face of international standardization. OMRON is working positively to achieve internationalization of standards, and the pin number and lead wire colors of one-piece Sensor I/O Connectors have been changed as described below. We know that this will create extra work for our customers, but we ask for your understanding and cooperation in making the required changes.

<u>Changes in Pin Numbers and Lead</u> Colors for XS2 Sensor I/O Connectors

 Accompany the establishment of IEC standards, JIS standards for proximity and photoelectric sensors (JIS C4524 (High-frequency Proximity Switches) and JIS C4525 (Photoelectric Switches) were revised in 1992, resulting in changes to the lead wire color standards. Also, the standards of the Nippon Electric Control Equipment Industries Association (NECA) were also revised in line with JIS standards. Following these changes, OMRON has changed the cable pin numbers and lead wire colors for XS2 Sensor I/O Connectors

Excerpt from General Rules on External Lead Colors for Control Devices (NECA 0402)

3.5 As a rule, the contact numbers and lead wire colors of connectors for FA sensors shall combine the lead wire colors given in *Table 6* and the contact number meanings given in *Table 7* for non-contact detection switches and limit switches with connectors.


Table 6 Lead Wire Colors, M12

Applicable cable outer diameter		Contact number			
		1	2	3	4
AC	M12AC2			Brown	Blue
	M12AC4	Brown	White	Blue	Black
DC	M12DC2A	Brown			Blue
	M12DC2B			Black	White
M12DC3		Brown		Blue	Black
	M12DC4	Brown	White	Blue	Black

Note: 1. The above is only an except from Table 6.

Production of products using the previous colors was terminated in September 1994.

Lead Wire Color Model Number Standards

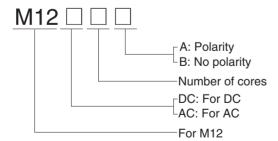

OMRON


Connector Terminal Boxes

XW3B

Series Includes New Lightweight, Lowprofile Connector Terminal Boxes for Use Outside of Control Boxes to Centralize Sensor I/O Connectors with Reduced Labor and Greater Environmental Resistance.

- Tough model with a significantly lower profile satisfies IP67.
- Available for Photoelectric Sensors, Proximity Sensors, and Limit Switches with Sensor I/O Connectors (M12).
- Incorporates power and operation indicators.
- Uses a single mounting method regardless of the number of ports, which ensures easy system expansion.



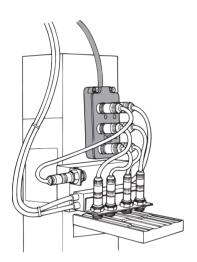

■ Materials and Finish

Item	Part name	Materials and finish	
Connectors	Anchor	Brass/nickel plated	
	Contacts	Brass/nickel base, 0.4-μm gold plating	
Cable	Cable	Sheath color: gray Core size: AWG18/AWG22 (See note.)	
Case	Case	PBT resin (UL94V-0)/light gray	
	Bushing	Rubber	
	PCB	Glass-epoxy board	
	Seal resin	Urethane resin	

Note: The positive power supply, negative power supply, and ground lines are AWG18. Signal lines are AWG22.

■ Ratings and Characteristics

Rated current	4 A/port (signal lines)		
	12 A/box (power lines)		
Rated voltage	10 to 30 VDC		
Contact resistance	40 M Ω max. (with 100 mA max., 20 mV max.) (See note 1.)		
Insulation resistance	100 MΩ min. (at 500 VDC)		
Dielectric strength	500 VAC for 1 min (leakage current: 1 mA max.) (See note 2.)		
Degree of protection	IP67 (IEC529)		
Cable retention force	98 N/15 s		
Insertion tolerance	200 times		
Operating temperature	−25 to 70°C		

Note: 1. The contact resistance of the Connector.

2. The dielectric strength of the Connector.

■ Compatible Connectors

XS2G	Connector Plug Assemblies (crimping, soldering, or screw-on)
XS2W	Connectors on cable ends (Sockets or Plugs)
XS2H	Connectors on one cable end (Plugs)

XW3B-P□5□-G11 Connector Terminal Box

■ Ordering Information

Sensor type and connections		3-wire DC NPN/2-wire 3-4	2-wire DC1-4/without polarity 3-4	3-wire DC PNP/2-wire DC 1-4
Actuator of	onnections	Actuator connections 1-4		Actuator connections 3-4
No. of ports	Cable length (m)	Model	Model	Model
4	5	XW3B-P455-G11	XW3B-P452-G11	XW3B-P453-G11
6	5	XW3B-P655-G11	XW3B-P652-G11	XW3B-P653-G11
8	5	XW3B-P855-G11	XW3B-P852-G11	XW3B-P853-G11

Note: Here 1-4 and 3-4 are connector pin numbers.

Waterproof Cover (Sold Separately)

XW2Z-12



Model	Minimum order	Materials
XW2Z-12	50	Brass/nickel plated

Note: The XW3B/XW3A comes with a dust cover. Use the optional XW2Z-12 Waterproof Cover when an IP67 degree of protection is required.

■ Connection Diagram

Standard Japanese Specification XW3B-P□55-G11 for 3-wire DC NPN, 2-wire DC (without polarity 3-4), and Actuator (1-4)

Japanese Specification


XW3B-P□52-G11 for 2-wire DC (with polarity 1-4, without polarity 3-4)


Note: Cannot be used with NPN-type Photoelectric and Proximity Sensors.
Cannot be used with Proximity Sensors with polarity 3-4.

2-Wire

European Specification XW3B-P□53-G11 for 3-wire DC PNP, 2-wire DC (with polarity 1-4), and Actuator (3-4)


3-Wire

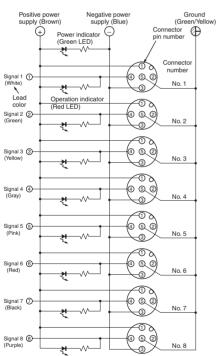

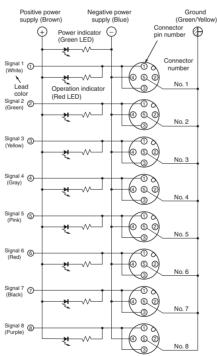

3-Wire
PNP

e power (Brown) Negative power supply (Blue) Green
Connector Connector

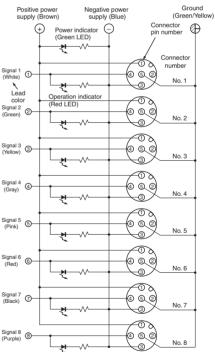



Note: Refer to pages 36 to 37 for input devices that can be connected through the above connectors.

- **Note: 1.** The above wiring diagrams are for eight-port use.
 - 2. Figures in parentheses indicate lead colors.
 - 3. The expression "white/red" means white and red stripes.
 - 4. Here 1-4 and 3-4 are pin numbers.
 - 5. Contact numbers 5 through 8 in the above diagrams do not exist on Terminal Boxes with four inputs. The lead colors for signals 1 through 4, power supply, and ground are the same.
 - **6.** Contact numbers 7 and 8 in the above diagrams do not exist on Terminal Boxes with six inputs. The lead colors for signals 1 through 6, power supply, and ground are the same.


■ Dimensions


XW3B-P45□-G11 (Four Input Ports)

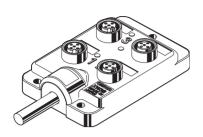

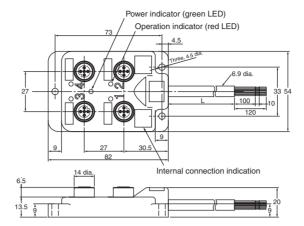



XW3B-P65□-G11 (Six Input Ports)

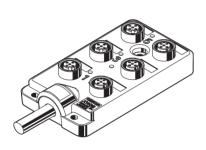


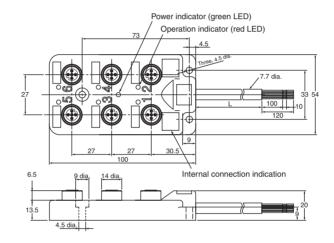

XW3B-P85□-G11 (Eight Input Ports)

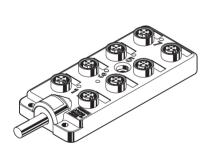


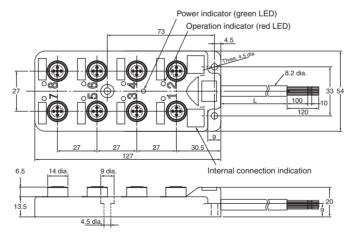



Note: Mounting hole dimensions are always the same regardless of the number of ports.

Input Device Connections Using Sensor I/O Connectors

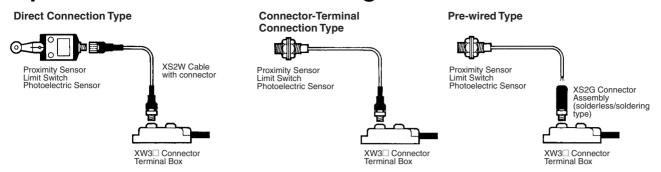

■ Input Devices Using Sensor I/O Connectors

Connector Terminal Box	Cable	Input devices using Sensor I/O Connectors			
XW3B-P□52-G11		2-wire DC Proximity Sensor	Connector–Terminal connection type	E2E-X3D1-M1GJ, E2E-X3D1-M1J-T, E2E- X7D1-M1GJ, E2E-X7D1-M1J-T, E2E-X10D1- M1GJ, and E2E-X10D1-M1J-T	
				E2E-X8MD1-M1GJ, E2E-X14MD1-M1GJ, and E2E-X20MD1-M1GJ	
				E2EQ-X3D1-M1GJ, E2EQ-X7D1-M1GJ, and E2EQ-X10D1-M1GJ	
	XS2W-D42□-□81-A		Direct connection type	E2E-X3D1-M1G, E2E-X7D1-M1G, and E2E-X10D1-M1G	
				E2E-X8MD1-M1G, E2E-X14MD1-M1G, and E2E-X20MD1-M1G	
		Limit Switch	Connector–Terminal connection type	WL□-□DK1EJ□ (See note 1.), WL□-□-M1GJ (See note 1.), and D4C-□0□□-DK1EJ□ (See note 2.)	
	XS2W-D42□-□81-A		Direct connection type	WL□-□K13 (See note 1.), D4E-□□10N (See note 2.), and D4CC-□□□□ (See note 2.)	
XW3B-P□53-G11	XS2W-D42□-□81-A	3-wire DC Proximity Sensor (PNP)	Direct connection type	E2E-X2F1-M1, E2E-X5F1-M1, and E2E-X10F1-M1	
				E2E-X5MF1-M1, E2E-X10MF1-M1, and E2E-X18MF1-M1	
	XS2W-D42□-□81-A	Photoelectric Sensor (PNP)	Direct connection type	E3S-AT36, E3S-AT86, E3S-AD36, E3S-AD37, E3S-AD38, E3S-AD86, E3S-AD87, E3S-AD88, E3S-AR36, and E3S-AR86	
XW3B-P□55-G11		2-wire DC Proximity Sensor	Connector–Terminal connection type	E2E-X3D1-M1J-T, E2E-X7D1-M1J-T, and E2E-X10D1-M1J-T	
			Direct connection type	E2E-X□D1-M1	
	XS2W-D42□-□81-A	3-wire DC Proximity Sensor (NPN)	Direct connection type	E2E-X2E1-M1, E2E-X5E1-M1, and E2E-X10E1-M1	
				E2E-X5ME1-M1, E2E-X10ME1-M1, and E2E-X18ME1-M1	
	XS2W-D42□-□81-A	Photoelectric Sensor (NPN)	Direct connection type	E3S-AT16, E3S-AT66, E3S-AD16, E3S-AD17, E3S-AD18, E3S-AD66, E3S-AD67, E3S-AD68, E3S-AR16, and E3S-AR66	
		Limit Switch	Connector–Terminal connection type	WL□-□DK1EJ□ (See note 1.), WL□-□-M1J (See note 1.), and D4C-□0□-DK1EJ□ (See note 2.)	
	XS2W-D42□-□81-A		Direct connection type	WL□-□K13 (See note 1.), and D4E-□□10N (See note 2.)	

Note: 1. Any of these models is available provided that only its SPST-NO contact is used.

- 2. Any of these models is available provided that it uses an NO connection.
- 3. Use the XS2G Connector assembly in combination with a pre-wired input device.

■ Attaching the XS2G Connector to Pre-wired Input Device

Connector		lı	Input devices and connector pin number				
Terminal Box	3-wire DC (NPN) 2-wire DC (with 1: +, 3: -, polarity) 4: output 1: +, 4: -		2-wire DC (with polarity) 3: -, 4: +	2-wire DC (with no polarity) 3, 4	Limit Switch	3-wire DC (PNP) 1: +, 3: -, 4: output	
XW3B-P□52-G11	No	Yes	No	Yes	Yes	No	
XW3B-P□53-G11	No	No	No	No	No	Yes	
XW3B-P□55-G11	Yes	No	Yes	Yes	Yes	No	

■ Connector Terminal Boxes for Input Devices with Sensor I/O Connectors

			Input device		Cable	Connector
Туре		Connection method	Model		Terminal Box	
Photoelectric Sen- sors		NPN Direct connection ty		E3S-AT16/66, E3S-AR16/66, and E3S-AD16/17/18/66/67/68	XS2W-D42□-□81-A	XW3B-P□55-G11
	PNP			E3S-AT36/86, E3S-AR36/86, and E3S-AD36/37/38/86/87/88		XW3B-P□53-G11
Proximity Sensors	2-wire Do	С	Connector-Terminal	E2E-X□D1-M1J-T		XW3B-P□55-G11
			connection type	E2E-X□D1-M1GJ and E2E- X□D1-M1J-T	1	XW3B-P□52-G11
				E2E-X□MD1-M1GJ		
				E2EQ-X□D1-M1GJ	1	
			Direct connection type	E2E-X□D1-M1G		
				E2E-X□MD1-M1G	1	
				E2E-X□D1-M1		
	3-wire	NPN		E2E-X□E1-M1		XW3B-P□55-G11
	DC			E2E-X□ME1-M1		
		PNP		E2E-X□F1-M1		XW3B-P□53-G11
				E2E-X□MF1-M1		
Limit Switches		Connector–Terminal connection type	WL□-□DK1EJ□ (See note 1.), WL□-□-M1J (See note 1), and D4C-□00□-DK1EJ□ (See note 2.)		XW3B-P□52-G11 XW3B-P□55-G11	
		Direct connection type	WL□-□K13 (See note 1.) and D4E-□□10N (See note 2.)			
				D4CC-□□□□ (See note 2.)		XW3B-P□52-G11

Note: 1. Any of these models is available provided that only its SPST-NO contact is used.

^{2.} Any of these models is available provided that it uses an NO connection.

^{3.} See the models above for components that are compatible with Sensor I/O Connectors.

■ Precautions

Correct Use

Connector Connection or Disconnection

- Before using a Sensor or Limit Switch, check this catalog and be sure that the Sensor or Limit Switch can be connected.
- Be sure to turn OFF the power supplied to the XW3A before Connector connection or disconnection.
- Do not touch the engaged side of any Connector with a wet hand.
- If a Connector is wet with water, wipe the Connector and be sure that the connector is completely dry.
- Be sure that there is no metal plate or power on the engaged side of any Connector.

Cable Connection

- Be sure to wire the cable correctly according to the wiring diagram so that the blue wire will be connected to the negative power supply terminal and the brown wire will be connected to the positive power supply terminal.
- If there is any wiring mistake, the load will not operate or the operation indicator will not light.
- Be sure to connect a load to the signal lines to operate the Sensor.

Applicable Connectors

- Applicable Connectors are the XS2G (assembly type), XS2H (monoblock type), and XS2W (monoblock type).
- After a Connector is engaged, tighten the Connector securely with a mounting bracket.
- Be sure to put the XS2Z-12 Waterproof Cover or XS2Z-15 Dust Cover on any Connector that is not used.

Power Supply and Operation Indicators

- When power is supplied, the green power indicator will be lit. When the Sensors and Actuators are operating, the corresponding red operation indicators will be lit.
- Only DC Sensors and Actuators can be connected to the XW3B.
 Do not connect AC Sensors or Actuators. Connector Terminal Boxes are internally wired with 2 or 3 wires. The type is marked on the case.

3-WIRE NPN 3-WIRE PNP 2-WIRE

OMRON

Sensor I/O Connectors (M8/S8)

XS3

More Compact than the Popular XS2 Sensor I/O Connectors. Saves Wiring Effort and Ideal for Compact Machines and Installations

- Water-resistive, compact connector meets IP67 requirements.
- Conventional M8 screw-mounting models are available along with S8 snap-in models that connect and disconnect with one touch.
- Greatly saves installation space, such as terminal box or conduit space.
- Ideal for a wide variety of FA and OA applications.
- Using connectors for wiring ensures ease of equipment maintenance and reduces downtime required for equipment maintenance.
- Connectors on cable ends require no harness work.



■ Specifications

Rated current	1 A
Rated voltage	125 VDC
Contact resistance	40 M Ω max. (20 mV max., 10 mA max.) (See note 1.)
Insulation resistance	1,000 MΩ min. (at 500 VDC)
Dielectric strength	1,000 VAC for 1 min (leakage current: 1 mA max.) (See note 2.)
Degree of protection	IP67 (IEC529)
Insertion tolerance	200 times
Cable tensile strength	50 N/15 s)
Ambient temperature	Operating: – 25°C to 70°C

Note: 1. The contact resistance of the connector.

2. The dielectric strength of the connector.

■ Materials and Finish

Pin Block	PBT resin/light gray or black
Contacts	Brass/nickel base, 0.4- μ m gold plating
Thread bracket (M8) Shell (S8)	Brass/nickel plated
Cover	Thermoplastic elastomer/black
O-ring	Rubber

■ Pin Arrangement (Engaged Side)

DC						
Plug (20 04 10 03)	Socket (40 02 30 01)					

OMRON

■ List of Products

Name	Model	Appearance	Page
Connectors attached to Cable	XS3W Sockets and Plugs on Cable Ends		41 to 42
	XS3F Sockets on One Cable End		43 to 45
	XS3H Plugs on One Cable End		46 to 48
Terminal Box Connectors	XS3P Sockets	h.	49 to 50
Used to enable using connectors for terminal boxes.			
Sensor Connector Assemblies	XS3M Plugs		51
Used to enable using connectors in sensors.		a	
Y-Joints	XS3R Plugs/Sockets		52
Used for branching and for daisy-chain connections.			

Sockets and Plugs on Cable Ends

XS3W

■ Model Number Legend

Use this model number legend to identify products from their model number. When ordering, use a model number from the table in *Ordering Information*.

$$XS3W - 242 - 40 - R$$

1. Fastening Method

M: M8

S: S8

2. Connector Poles

4: 4 poles

3. Cable Connection Direction

1: Straight/straight

2: L-shaped/L-shaped

3: Straight (XS3F)/L-shaped (XS3H)

4: L-shaped (XS3F)/straight (XS3H)

4. Connections

Pin No.

1 2 3 4

4: Brown White Blue Black

5. Cable Length

01: 1 m

02: 2 m

05: 5 m

6. Cable Specifications

R: Vibration-proof robot cable


■ Ordering Information

Item	Cable connection direction	No. of cable cores	Cable length (m)	Model
M8 Connectors	Straight/Straight	4	1	XS3W-M421-401-R
Vibration-proof robot cable			2	XS3W-M421-402-R
cable			5	XS3W-M421-405-R
	L-shaped/L-shaped		2	XS3W-M422-402-R
			5	XS3W-M422-405-R
	Straight/L-shaped		2	XS3W-M423-402-R
			5	XS3W-M423-405-R
	L-shaped/Straight		2	XS3W-M424-402-R
			5	XS3W-M424-405-R
S8 Connectors	Straight/Straight	4	1	XS3W-S421-401-R
Vibration-proof robot cable			2	XS3W-S421-402-R
Cable			5	XS3W-S421-405-R
	L-shaped/L-shaped		2	XS3W-S422-402-R
			5	XS3W-S422-405-R
	Straight/L-shaped		2	XS3W-S423-402-R
			5	XS3W-S423-405-R
	L-shaped/Straight		2	XS3W-S424-402-R
			5	XS3W-S424-405-R


XS3W-M42 -4 -R M8 Screw-mounting Connectors with Vibration-proof Robot Cable

Dimensions


Straight/Straight Connectors




L-shaped/L-shaped Connectors

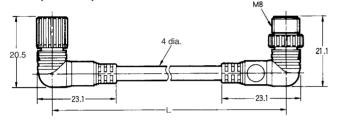


Wiring Diagram



Straight/L-shaped Connectors



L-shaped/Straight Connectors

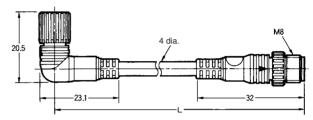

Mating Connectors


Item	Socket side	Plug side
		XS3F (M8), XS3W (M8), XS3P (M8)


- Note: 1. Cables can be extended with more than one XS3W.
 - M8 screw models and S8 snap-in models cannot be connected to each other.

XS3W-S42□-4□□-R S8 Snap-in Connectors with Vibration-proof Robot Cable


■ Dimensions

Straight/Straight Connectors







L-shaped/L-shaped Connectors



L-shaped/Straight Connectors



Wiring Diagram



Mating Connectors

Item	Socket side	Plug side
XS3W (S8)	XS3M (M8/S8), XS3H (S8)	MS3F (S8), XS3W (S8), XS3P (S8)

Note: 1. Cables can be extended with more than one XS3W.

Sockets on One Cable End

XS3F

■ Model Number Legend

Use this model number legend to identify products from their model number. When ordering, use a model number from the table in *Ordering Information*.

1. Fastening Method

M: M8

S: S8

2. Connector Poles

4: 4 poles

3. Cable Connection Direction

1: Straight

2: L-shaped

4. Connections

Pin No.

1 2 3 4

4: Brown White Blue Black

5. Cable Length

01: 1 m

02: 2 m

05: 5 m

6. Cable Specifications

A: Standard cable

R: Vibration-proof robot cable

■ Ordering Information

M8 Model

Item	Cable connection direction	No. of cable cores	Cable core cross- sectional area	Cable length (m)	Model
Standard cable	Straight	4	0.2 mm ²	2	XS3F-M421-402-A
				5	XS3F-M421-405-A
	L-shaped			2	XS3F-M422-402-A
				5	XS3F-M422-405-A
Vibration-proof robot	Straight	4]	1	XS3F-M421-401-R
cable				2	XS3F-M421-402-R
				5	XS3F-M421-405-R
	L-shaped			1	XS3F-M422-401-R
				2	XS3F-M422-402-R
				5	XS3F-M422-405-R


S8 Model

Cable connection direction	No. of cable cores	Cable core cross- sectional area	Cable length (m)	Model
Straight	4	0.2 mm ²	1	XS3F-S421-401-R
			2	XS3F-S421-402-R
			5	XS3F-S421-405-R
L-shaped			1	XS3F-S422-401-R
			2	XS3F-S422-402-R
			5	XS3F-S422-405-R

XS3F-M42□-4□□-□ M8 Screw-on Cables with Vibration-proof Robot Cable/Standard Cable


■ Dimensions

Straight Connectors




L-shaped Connectors



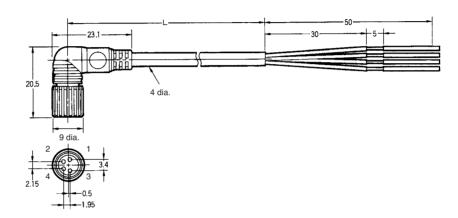

Wiring Diagram



Cable lead colors


Mating Connectors

Item	Model
XS3F (M8)	XS3M (M8/S8), XS3H (M8), XS3W (M8)


XS3F-S42□-4□□-R S8 Snap-in Connectors with Vibration-proof Robot Cable

■ Dimensions

Straight Connectors

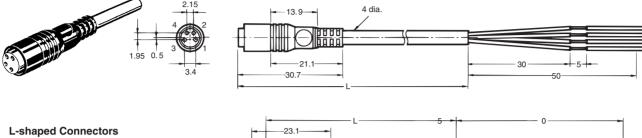




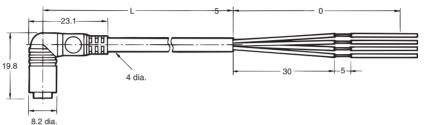



Wiring Diagram



Cable lead colors

Mating Connectors

Item	Model
XS3F (S8)	XS3M (M8/S8), XS3H (S8), XS3W (S8)

Plugs on One Cable End

XS3H

■ Model Number Legend

Use this model number legend to identify products from their model number. When ordering, use a model number from the table in *Ordering Information*.

$$XS3H_{1} - 2420 - 400 - R_{1}$$

1. Fastening Method

M: M8

S: S8

2. Connector Poles

4: 4 poles

3. Cable Connection Direction

1: Straight

2: L-shaped

4. Connections

Pin No.

1 2 3 4

4: Brown White Blue Black

5. Cable Length

C3: 0.3 m

01: 1 m

6. Cable Specifications

R: Vibration-proof robot cable


■ Ordering Information

Item	Cable connection direction	No. of cable cores	Cable core cross- sectional area	Cable length (m)	Model
M8 Model	Straight	4	0.2 mm ²	0.3	XS3H-M421-4C3-R
Vibration-proof robot cable			1	XS3H-M421-401-R	
	L-shaped			0.3	XS3H-M422-4C3-R
				1	XS3H-M422-401-R
S8 Model	Straight	4	1	0.3	XS3H-S421-4C3-R
Vibration-proof robot cable			1	XS3H-S421-401-R	
	L-shaped			0.3	XS3H-S422-4C3-R
				1	XS3H-S422-401-R

XS3H-M42□-4□□-R M8 Screw-on Connectors with Vibration-proof Robot Cable


■ Dimensions

Straight Connectors

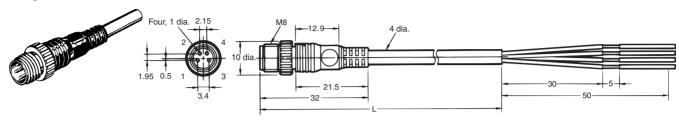


L-shaped Connectors



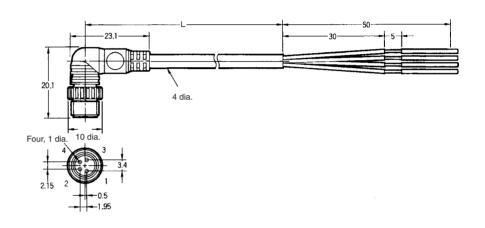

Wiring Diagram




Mating Connectors

Item	Model
XS3H (M8)	XS3F (M8), XS3W (M8), XS3P (M8)

XS3H-S42□-4□□-R S8 Snap-in Connectors with Vibration-proof Robot Cable


■ Dimensions


Straight Connectors




L-shaped Connectors



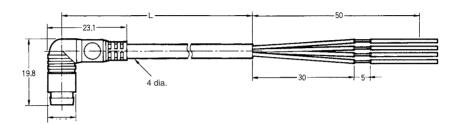



Wiring Diagram



Cable lead colors

Mating Connectors

Item	Model
XS3H (S8)	XS3F (S8), XS3W (S8), XS3P (S8)

Panel-mounting Sockets for Terminal Boxes


XS3P

■ Ordering Information

Connection method	Panel mounting	Pin shape	Model	Minimum order
M8 screw-mounting	Front lock or rear lock	DIP pins	XS3P-M421-1	50
		Solder cup pins	XS3P-M421-2	
	Rear lock	Solder cup pins	XS3P-M422-2	
S8 snap-in	Front lock or rear lock	DIP pins	XS3P-S421-1	
		Solder cup pins	XS3P-S421-2	


Note: Orders are accepted in multiples of the minimum order.

■ Dimensions

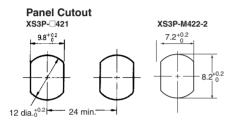


Note: The panel thickness is 1 to 3 mm.

PCB-mounting Dimensions



Note: The panel thickness is 2.4 mm minimum.

Panel-mounting Dimensions

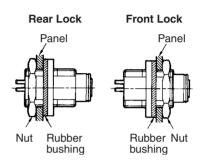


XS3P-M421-1 M8 Screw-mounting Sockets with DIP Pins

XS3P-M421-2 M8 Screw-mounting Sockets with Solder Cup Pins


XS3P-M422-2 M8 Screw-mounting Sockets with Solder Cup Pins

■ Dimensions


XS3P-M421-1 (DIP Pins)

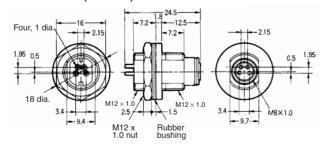

XS3P-M422-2 (Solder Cup Pins), Rear Lock Slim Models



XS3P-M421-2 (Solder Cup Pins)

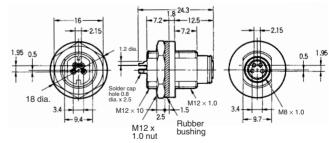

Mating Connectors


Item	Model
XS3P (M8)	XS3H (M8), XS3W (M8)

XS3P-S421-1 S8 Snap-in Sockets with DIP Pins


XS3P-S421-2 S8 Snap-in Sockets with Solder Cup Pins

■ Dimensions

XS3P-S421-1 (DIP Pins)

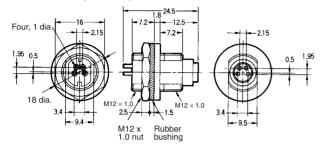

XS3P-S421-2 (Solder Cup Pins)

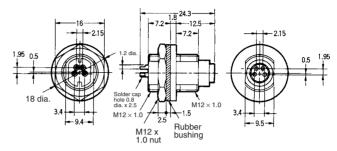

Mating Connectors

Item	Model
XS3P (S8)	XS3H (S8), XS3W (S8)

Note: M8 screw models and S8 snap-in models cannot be connected to each other.

■ Precautions

Correct Use

Panel Mounting

When mounting XS3P Panel-mounting Connectors to panels, refer to page 49 and provide rubber bushings and nuts for the Connectors. Apply a tightening torque of between 0.4 and 0.6 N·m to mount the Connectors.

Sensor Embedded Plugs

XS3M

XS3M-K421-1 Embedded Plugs with Screw Threads and DIP Pins
XS3M-K421-2 Embedded Plugs with Screw Threads and Solder Cup Pins

■ Ordering Information


Connection method	Pin shape	Model	Minimum order
Embedded model	DIP pins	XS3M-K421-1	200
	Solder cup pins	XS3M-K421-2	

Note: Orders are accepted in multiples of the minimum order.


■ Dimensions

XS3M-K421-1 Embedded Model with DIP Pins



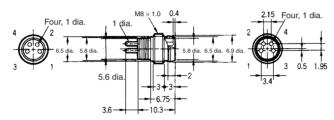


Mounting Dimensions




XS3M-K421-2 Embedded Model with Solder Cup Pins





Mounting Dimensions



Mating Connectors

Item	Model
XS3M	XS3F (M8/S8), XS3W (M8/S8)

Note: The plug can be connected to both M8 screw and S8 snap-in models.

Y-Joint Plug/Socket Connectors

XS3R

■ Ratings and Characteristics

Rated current	1 A
Rated voltage	125 VDC
Contact resistance	60 M Ω max. (20 mV max., 100 mA max.) (See note 1.)
Insulation resistance	1,000 MΩ min. (at 500 VDC)
Dielectric strength	1,000 VAC for 1 min (leakage current: 1 mA max.) (See note 2.)
Degree of protection	IEC IP67
Insertion tolerance	200 times min.
Ambient temperature	Operating: -25°C to 70°C

Note: 1. The contact resistance of the connector.

2. The dielectric strength of the connector.

■ Materials and Finish

Pin Block	PBT resin (UL94V-0)/light gray
Contacts	Phosphor bronze/nickel base, 0.4-µm gold plating
Thread bracket (M8) Shell (S8)	Brass/nickel plated
Cover	Polyester elastomer (UL94-0)/black
O-ring	Rubber

■ Applicable Connectors

XS3H	Plug on one cable end		
XS3F	Socket on one cable end		
XS3W	Socket/plug on cable ends		
XS3P	Panel-mounting socket		


■ Ordering Information

Cable	Connector	For M8 Connectors			
		Cable length L (m)	Model	Minimum order	
With cable	Connectors on cable	0.5	XS3R-M426-1C51-A	5	
	ends	1	XS3R-M426-1011-A	5	
		2	XS3R-M426-1021-A	5	
		3	XS3R-M426-1031-A	5	
	Connector on one ca- ble end	2	XS3R-M426-1020-A	5	
		5	XS3R-M426-1050-A	5	
Without cable	Connectors on both ends		XS3R-M426-1	10	
			XS3R-M426-5	10	


■ Dimensions

XS3R-M426-1□□1-A Connectors on Cable Ends (Y-Joint Plug/Socket)






Wiring Diagram




XS3R-M426-1□□0-A Connector on One Cable End (Y-Joint Plug/Socket)


2 -10.5 - 1 23 4 2 3 1 4 66 3 3




Wiring Diagram




XS3R-M426-□ Connector on Both Ends (Y-joint Plug/Socket) without Cable






Wiring Diagram XS3R-M426-1



XS3R-M426-5




Accessories


■ XS3 M8/S8 Connector Cover (Order Separately)

Dust Cover

XS3Z-13

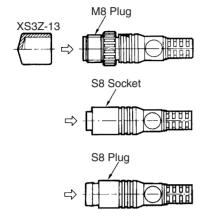

XS3Z-15



The Dust Cover is for dust prevention and does not ensure IP67. When mounting the Dust Cover to a Connector, be sure to press the Dust Cover onto the Connector until the Connector is fully inserted into the Dust Cover.

■ Ordering Information

Model	Material	Suitable connector	
		Model	Mounting portion
XS3Z-13	Polyvinyl chloride/red	XS3H/XS3M	M8 plug
		XS3F	S8 socket
		XS3H	S8 plug
XS3Z-15	Polyvinyl chloride/red	XS3F	M8 socket

■ Precautions

Refer to Correct Use for precautions for individual products.

Correct Use

Connections

- The XS3 and XS2 Sensor I/O Connectors cannot be connected to each other.
- When using Sensors with Connectors or Limit Switches, use the Sensor I/O Connectors specified in the catalog.
- Do not connect M8 screw models and S8 snap-in models together, otherwise the proper degree of protection of the Connectors will not be maintained.

Connector Connection and Disconnection

- Before connecting or disconnecting Connectors, make sure that no power is being supplied to the Connectors.
- When connecting or disconnecting Connectors, be sure to hold the Connectors by hand.
- Do not touch the engagement side of any Connector with wet hands. If there is any water on the Connector or near the Connector, be sure to wipe off the water before connecting or disconnecting the Connector, otherwise the Connector may short-circuit internally or not ensure good insulation.
- Make sure that engagement side of any Connector is free of metal dust or power.
- Do not use pliers to tighten mounting the thread bracket, otherwise the thread bracket may be damaged. Be sure to tighten each thread bracket by hand within a torque of 0.3 and 0.4 N·m. If the thread bracket is not tightened securely, the Connector may not maintain its proper degree of protection or the thread bracket may fall off due to vibration.
- Fully insert S8 snap-in models until the Connectors are hidden by the metal casing of the opposite parts, otherwise the Connectors will not maintain their proper degree of protection or the thread brackets may drop off due to vibration.

Cable Wire Color

The M8/S8 Sensor I/O Connectors use the following lead wire colors.

Model			Pin No.			
		1	2	3	4	
DC	8-mm-dia. DC4	Brown	White	Blue	Black	

Degree of Protection

- Do not impose external force continuously on the joints of pin blocks and covers, otherwise the Connectors may not keep its proper degree of protection (i.e., IP67).
- Connectors are not fully watertight. Do not use them underwater.
- The Connectors are not oil-resistant. Do not use them where they would be subject to oil.
- If Connectors are used in places with vibration or shock, secure the engaged side of each Connector, otherwise the Connectors may be disconnected or fail to maintain their proper degree of protection.
- Connectors are of resin mold construction. Do not impose excessive force on them.

Storage

Do not store Connectors for long periods of time in the following locations


- · Locations subject to dust or high humidity
- · Locations subject to ammonia gas or sulfide gas



Power Supply Connectors (7/18-16UN Mini Connectors)

XS4

- Four-pin Connectors ideal for power supply lines.
- Complies with IP67.
- Product line includes T-branch Connectors and cables with Connectors.

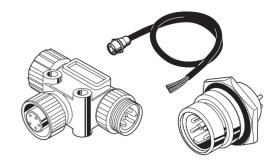

■ Ratings and Characteristics

Item	XS4□-D421-1□□-A Cables with Connector	XS4R-D424-5 T-branch Connectors	XS4P-D421-1C5-A Panel Mounting Cables	XS4M-D421-1 Panel Mounting Cables	
Rated current		10) A		
Rated voltage		125	VDC		
Contact resistance (See note 1.)		30 m Ω max. (at 20 n	nVDC, 100 mA max.)		
Insulation resistance		1,000 MΩ min	. (at 500 VDC)		
Dielectric strength (See note 2.)	1,500 VAC for 1 min (leakage current: 1 mA max.)				
Operating tempera- ture	−20 to 65°C				
Storage temperature		−25 to 70°C			
Enclosure rating		IEC IP67			
Insertion durability	200 times				
Cable holding strength	98 N/15 s 98 N/15 s				
Vibration	No break in current for simple harmonic motion (10 to 500 Hz, 1.52-mm amplitude or 100 m/s² whichever has the smallest amplitude) for more than 1 μs min.				

Note: 1. The contact resistance of the Connector.

2. The dielectric strength of the Connector.

3. The rated current between heavy gauge wires is 8 A.

■ Materials and Finish

		XS4□ (4-pin Type for Power Supplies)
Connector	Contact block	Polyester elastomer (UL94V-0)/light gray
	Contact	Brass/1.5-μm nickel base, 0.4-μm gold plating
	Anchor	Copper/nickel plated
	Body (See note.)	Brass/nickel plated
	Cover	Polyester elastomer (UL94V-0)/black
	O ring	Rubber
Cable	Model (manufacturer)	UL STO cable (Shinagawa Densen) or the equivalent
	Cores	AWG16 × 4 cores (black, white, red, and green)
	Diameter	Approximately 11 dia.
	Sheath color	Black

Note: Only panel-mounted bodies are used.


■ Ordering Information

For Power Supplies (4-pin Type)

Appearance	Туре	Cable length (m)	Model
		1	XS4W-D421-101-A
	_ [2	XS4W-D421-102-A
		5	XS4W-D421-105-A
		10	XS4W-D421-110-A
		1	XS4F-D421-101-A
		2	XS4F-D421-102-A
		5	XS4F-D421-105-A
	L → 50 mm	10	XS4F-D421-110-A
		1	XS4H-D421-101-A
		2	XS4H-D421-102-A
		5	XS4H-D421-105-A
	L 50 mm	10	XS4H-D421-110-A
	T-branch Connectors		XS4R-D424-5
	1-Dianeir Connectors		X34n-D424-5
	Panel-mounted Connectors (Sockets) with 50-cm cable		XS4P-D421-1C5-A
	Panel-mounted Connectors (Plugs) with DIP terminals		XS4M-D421-1

■ Dimensions


XS4W-D421-1□□-A Cables with Connectors at Both Ends (4-pin Type for Power Supplies)



Wiring

Terminal No.	Color
1	Black
2	White
3	Red
4	Green


XS4F-D421-1□□-A Cables with a Connector on One End (4-pin Sockets for Power Supplies)



Wiring

Terminal No.	Color
1	Black
2	White
3	Red
4	Green


XS4H-D421-1 □ -A Cables with a Connector on One End (4-pin Plugs for Power Supplies)



Wiring


Terminal No.	Color
1	Black
2	White
3	Red
4	Green

XS4P-D421-1C5-A Panel Mounting Connectors (4-pin Sockets for Power Supplies)



Note: The rubber bushing and nut used for in-panel mounting are supplied.


Panel dimensions



Wiring

Terminal No.	Color
1	Black
2	White
3	Red
4	Green

XS4R-D424-5 T-branch Connectors (4-pin Type for Power Supplies)

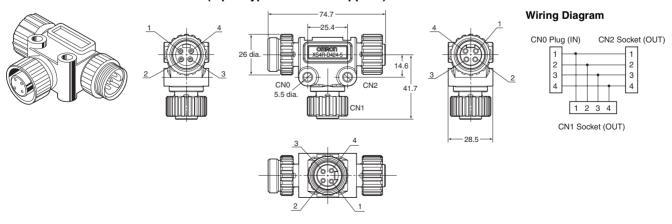


XS4M-D421-1 Panel Mounting Connectors (4-pin Plugs for Power Supplies)


Panel dimensions Mounting holes 37 min.

Note: The rubber bushing and nut used for in-panel mounting are supplied.

XS4Z-11 Waterproof Caps (for Plugs)

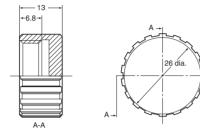

XS4Z-12 Waterproof Caps (for Sockets)

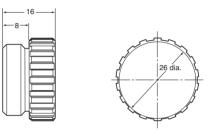

■ Precautions

Correct Use

Handling

- Do not connect or disconnect Connectors with the power turned ON.
- Hold the Connector when connecting or disconnecting Connectors.
- Never pull on the cable to disconnect a Connector.
- Before mating Connectors, insert the matable parts fully. Use a torque of 0.7 to 0.8 N m to tighten the Anchor, and do so carefully to prevent damage to the threads.
- Do not use pliers or other tools because they may damage the Anchor. Anchors that are not properly tightened cannot maintain the enclosure rating and may become loose with vibration.
- The body is made of molded resin. Do not step on it or place heavy objects on top of it.

Enclosure Rating

• The IP67 enclosure rating is not completely waterproof. Do not use the product in locations where it will be continually under water.

Observe the following long-term storage precautions.

- 1. Make sure the storage location is dust- and moisture-proof.
- 2. Do not store near locations generating ammonia gas, sulfurized gas, or other harmful gases.

Peripheral Devices for DeviceNet Communications

• T-branch Taps and Terminal-block Terminator



■ Ordering Information

General-purpose Models

Product	Appearance	Model	Specificat	ion
T-branch Tap for 1 branch line		DCN1-1NC	Cable wiring direction: Toward top Cable lock direction: From top Connector screw direction: From top	Provided with 3 parallel con- nectors with clamps (XW4G- 05C1-H1-D), standard termi- nating resistor
		DCN1-1C	Cable wiring direction: Toward side Cable screw direction: From top Connector screw direction: From side	Provided with 3 parallel con- nectors with screws (XW4B- 05C1-H1-D), standard termi- nating resistor
		DCN1-2C	Cable wiring direction: Toward top Cable screw direction: From side Connector screw direction: From top	
		DCN1-2R	Cable wiring direction: From side Cable screw direction: From top Connector screw direction: From top	Provided with 3 orthogonal connectors with screws (XW4B-05C1-VIR-D), stan- dard terminating resistor
T-branch Tap for 3 branch lines		DCN1-3NC	Cable wiring direction: Toward top Cable lock direction: From top Connector screw direction: From top	Provided with 5 parallel clamp connectors with screws (XW4G-05C1-H1-D), stan- dard terminating resistor
		DCN1-3C	Cable wiring direction: Toward side Cable screw direction: From top Connector screw direction: From side	Provided with 5 parallel con- nectors with screws (XW4B- 05C1-H1-D), standard termi- nating resistor
		DCN1-4C	Cable wiring direction: Toward top Cable screw direction: From side Connector screw direction: From top	
		DCN1-4R	Cable wiring direction: Toward side Cable screw direction: From top Connector screw direction: From top	Provided with 5 orthogonal clamp connectors with screws (XW4B-05C1-VIR-D), stan- dard terminating resistor

OMRON

Prod	uct	Appearance	Model	Specification
Power Supp	ply Tap		DCN1-1P	One-branch tap provided with 2 connectors, standard terminating resistor, and fuse
Connectors	3		XW4G-05C1- H1-D	Parallel clamp connector with screws Connector insertion and wiring both performed horizontally.
			XW4G-05C4- TF-D	Parallel multi-branching clamp connector with screws Connector insertion and wiring performed in same direction.
		6866	XW4B-05C1- H1-D	Parallel connector with screws Connector insertion and wiring performed in same direction.
		60000	XW4B-05C4-T-D	Parallel, screwless, multi-branching connector Connector insertion and wiring performed in same direction.
		EGG GE	XW4B-05C4- TF-D	Parallel, multi-branching connector with screws Connector insertion and wiring performed in same direction.
			XW4B-05C1- VIR-D	Orthogonal connector with screws Connector insertion and wiring performed at a right angle.
DeviceNet Cables	Thin Cables		DCA1-5C10	Outer diameter: 7.00 mm Length: 100 m
	Thick Cables		DCA2-5C10	Outer diameter: 11.6 mm Length: 100 m
Terminal-block Terminator			DRS1-T	Resistance of 121 Ω

Environment-resistive Models for Thin Wires and M12 Micro Connectors

Product	Appearance		Model	Speci	fications
Sealed Assembling- type Connector (male)			XS2G-D5S7	For communications	s (plug)
Sealed Assembling- type Connector (fe- male)			XS2C-D5S7	For communications	s (socket)
Sealed T-branch Con- nector			DCN2-1	For 1 branch line	
Sealed Connector			DRS2-1	Plug	
with Terminating Resistor			DRS2-2	Socket	
Cables with Sealed			DCA1-5CNC5W1	Length (L): 0.5 m	Cable with connec-
Connectors			DCA1-5CN01W1	Length (L): 1 m	tors on both ends
			DCA1-5CN02W1	Length (L): 2 m	
		L	DCA1-5CN03W1	Length (L): 3 m	
	O		DCA1-5CN05W1	Length (L): 5 m	
			DCA1-5CN10W1	Length (L): 10 m	
		☐☐☐ — — 50mm	DCA1-5CNC5F1	Length (L): 0.5 m	Cable with connec-
			DCA1-5CN01F1	Length (L): 1 m	tor socket on one end
			DCA1-5CN02F1	Length (L): 2 m	
			DCA1-5CN03F1	Length (L): 3 m	
			DCA1-5CN05F1	Length (L): 5 m	
			DCA1-5CN10F1	Length (L): 10 m	
			DCA1-5CNC5H1	Length (L): 0.5 m	Cable with connector plug on one end
			DCA1-5CN01H1	Length (L): 1 m	
			DCA1-5CN02H1	Length (L): 2 m	
		L50mm	DCA1-5CN03H1	Length (L): 3 m	
			DCA1-5CN05H1	Length (L): 5 m	-
			DCA1-5CN10H1	Length (L): 10 m	
Shielded Panel- mounting Connector, female			DCA1-5CNC5P1	Connector socket for ble: 0.5 m	r Panel-mounting Ca-
	<u> </u>		XS2P-D522-2	Connector socket for ble: 0.5 m Solder-cup terminal	r Panel-mounting Ca-
Shielded Panel- mounting Connector, male			DCA1-5CNC5M1	-	Panel-mounting Cable:
			XS2M-D524-4	Connector plug for I Solder-cup terminal	

Environment-resistive Models for Thick Wires with 7/8-16UN Mini Connectors

Product	Appearance		Model	Speci	fications	
Sealed T-branch Con-			DCN3-11	T-branch Connecto	r	
nector			DCN3-12	T-branch Connecto	T-branch Connector	
				(Branch connector	is M12.)	
Sealed Connector with Terminating Re- sistor			DRS3-1	Plug		
Cables with Sealed			DCA2-5CN01W1	Length (L): 1 m	Cable with connec-	
Connectors			DCA2-5CN02W1	Length (L): 2 m	tors on both ends	
		← L →	DCA2-5CN05W1	Length (L): 5 m		
	9 II		DCA2-5CN10W1	Length (L): 10 m		
			DCA2-5CN01F1	Length (L): 1 m	Cable with connec-	
		L	DCA2-5CN02F1	Length (L): 2 m	tor socket on one end	
			DCA2-5CN05F1	Length (L): 5 m		
			DCA2-5CN10F1	Length (L): 10 m		
		L	DCA2-5CN01H1	Length (L): 1 m	Cable with connec-	
	8 M		DCA2-5CN02H1	Length (L): 2 m	tor plug on one end	
			DCA2-5CN05H1	Length (L): 5 m		
			DCA2-5CN10H1	Length (L): 10 m		
			DCA1-5CN01W5	Length (L): 1 m	Cable with connec-	
			DCA1-5CN02W5	Length (L): 2 m	tors on both ends	
			DCA1-5CN05W5	Length (L): 5 m	Thin cable M12 socket	
			DCA1-5CN10W5	Length (L): 10 m	WI12 SOCKEL	
Panel-mounting Con- nector (female)			DCA2-5CNC5P1	Connector socket for Cable: 0.5 m	or panel mounting	
Panel-mounting Con- nector (male)			DCA2-5CNC5M1	Connector plug for Cable: 0.5 m	panel mounting	
Panel-mounting Con- nector (male)			XS4M-D521-1	Connector plug for DIP terminals	panel mounting	

■ Specifications

General-purpose Models (T-branch Taps)

Ratings/Characteristics

		8 A (power supply line) and 2 A (signal line) 3 A (power supply line) and 1 A (signal line)	
Insulation resistance	100 M Ω min. (at 500 VDC)		
Dielectric strength	500 VAC for 1 min, leakage current: 1 mA max.		
Ambient temperature	Operating: 0°C to 55°C		

Materials

Item	Component	Materials
Unit	Main and Expansion Units	PBT resin with glass (UL14V-0)/gray
	DIN track lock	POM resin/yellow
Terminal block connector (See note.)	Housing	PA66 resin (UL94V-0)
	Contact	Phosphor bronze/gold plated
PCB	Glass epoxy resin	

Note: The terminal block connector is a product of Phoenix Contact.

Environment-resistive Models (Thin Wire Communications Connectors)

Ratings/Characteristics

Item	DCA1-5CN□□1 Connectors with Cables	DCN2-1 T-branch Connector	XS2□-D5S7 Assembling-type Connector	DRS2-□ Connectors with Terminating Resistor	
Rated current	3 A				
Rated voltage	125 VDC	125 VDC			
Contact resistance (connector)	40 m Ω max. (at 20 mVDC m	ax. and 100 mA max.)			
Insulation resistance	1,000 M Ω min. (at 500 VDC)				
Dielectric strength (connector)	, , , , , , , , , , , , , , , , , , , ,				
Ambient temperature range	-20 to 65°C				
Storage temperature range	-25 to 70°C				
Enclosure rating	IEC IP67				
Insertion durability	200 times				
Cable strength	98 N for 15 s				
Vibration resistance	No current interruptions of more than 1 μ m while performing simple vibrations at either 10 to 500 Hz with 1.52-mm full amplitude or at acceleration 100 m/s ² , whichever is smaller				

Environment-resistive Models (Thick Wire Communications Connectors)

Ratings/Characteristics

Item	DCA2- 5CN□□□1 Connectors with Thick Wires	DCA1- 5CN□□W5 Connectors with Thick Wires	DCN3-11 T-branch Connector	DCN3-12 T-branch Connector	DRS3-1 Connectors with Terminating Resistor	DCA2- 5CNC5P1 Panel Mounting Connector	XS4M-D521-1 Panel Mounting Connector
Rated current	8 A	3 A	8 A	3 A (See note.)	8 A		
Rated voltage	125 VDC						
Contact resistance (connector) 30 mΩ max. (at 20 mVDC max. and 100		and 100 mA ma	c.)				
Insulation resistance	1,000 MΩ min. (at 500 VDC)						
Dielectric strength (connector)	1,500 VAC for 60 seconds (leakage current: 1 mA max.)						
Ambient temperature range	-20 to 65°C						
Storage temperature range	–25 to 70°C						
Enclosure rating	IEC IP67						
Insertion durability	200 times						
Cable strength	98 N for 15 s					98 N for 15 s	
Vibration resistance	No current interruptions of more than 1 μm while performing simple vibrations at either 10 to 500 Hz with 1.52-n full amplitude or at acceleration 100 m/s², whichever is smaller			dz with 1.52-mm			

Note: The rated current between thick wires is 8 A.


■ Dimensions

Note: All units are in millimeters unless otherwise indicated.


General-purpose Models

DCN1-1NC T-branch Tap for 1 Branch Line (With Three Branching Connectors)



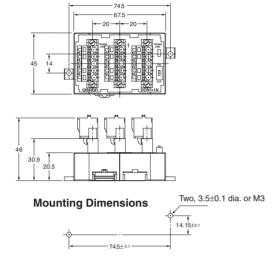


Internal Circuit



Terminal No.	Name
1	V–
2	CAN-L
3	DRAIN
4	CAN-H
5	V+

DCN1-1C T-branch Tap for 1 Branch Line (With Three Branching Connectors)

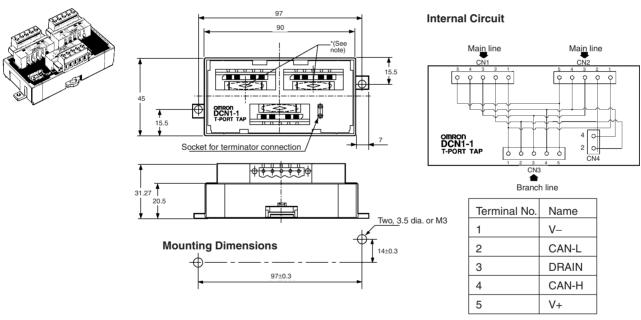


Note: When connecting a branch line to the main line, connect the main line to the connector marked with an asterisk because the resistance between the asterisks is minimal.




DCN1-3NC T-branch Tap for 3 Branch Lines (With Five Branching Connectors)




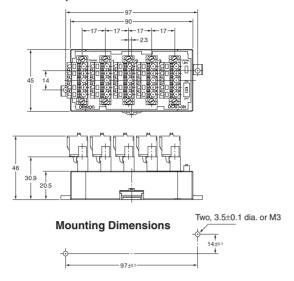


Internal Circuit




Terminal No.	Name
1	V–
2	CAN-L
3	DRAIN
4	CAN-H
5	V+

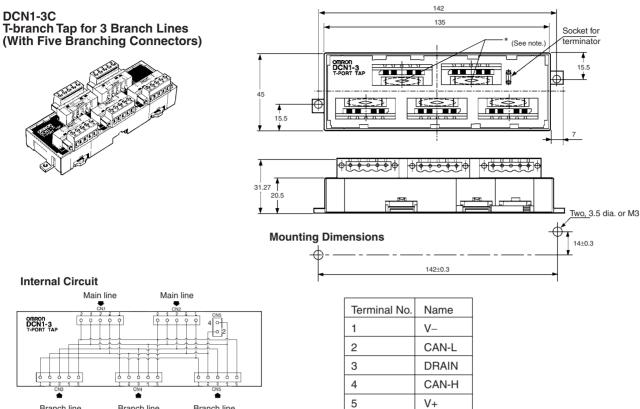


Note: When connecting a branch line to the main line, connect the main line to the connector marked with an asterisk because the resist

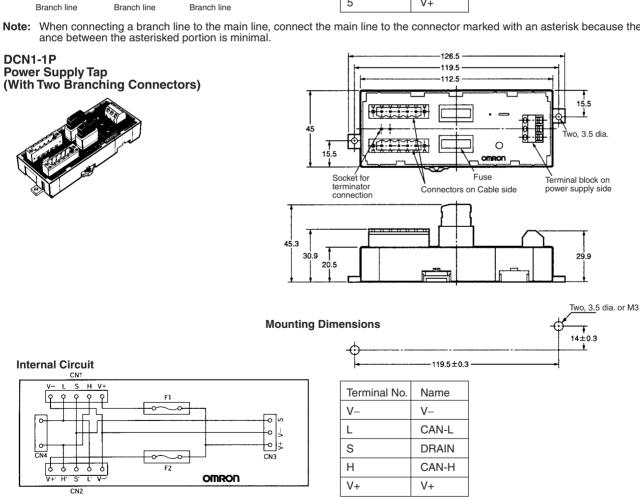



OMRON

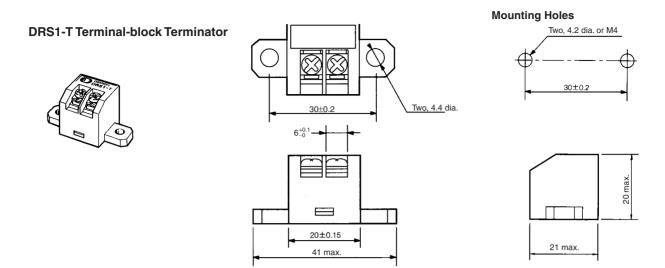

Environment-resistive Models for Thin Wires

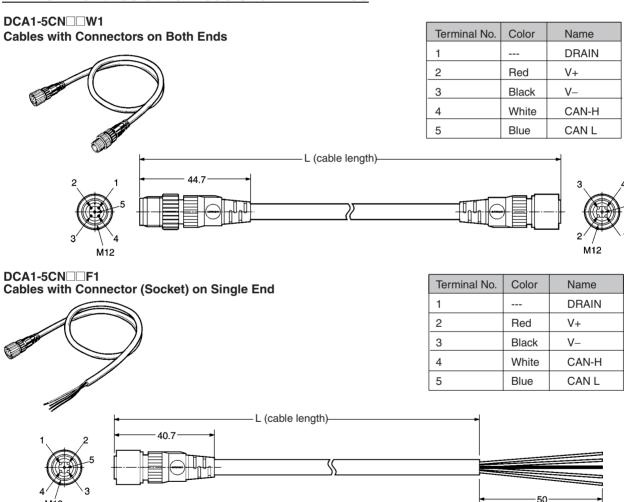



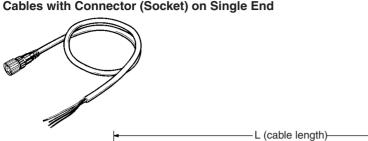

Terminal No.	Color	Name	
1		DRAIN	
2	Red	V+	
3	Black	V–	
4	White	CAN-H	
5	Blue	CAN L	

L (cable length)


40.7

M12

DCN2-1 T-branch Connector

DRS2-1 (Plug) DRS2-2 (Socket) Connectors with Terminating Resistance





Connections Diagram

Wiring


Terminal No.	Name
1	SHIELD
2	V+
3	V-
4	CAN-H
5	CAN-L




Wiring

Terminal No.	Name
1	DRAIN: NC
2	V+: NC
3	V-: NC
4	CAN-H: 121 Ω
5	CAN-L:

Note: Terminating resistance (121 Ω) is connected between terminals 4 and 5.

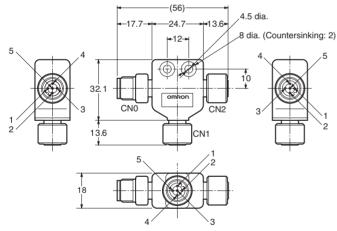

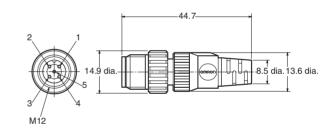


Note: The diagram shows the DRS2-1 (plug).

DCA1-5CNC5P1
Panel-mounting Connector Socket with 0.5 m Cable




Terminal No.	Color	Name		
1		DRAIN		
2	Red	V+		
3	Black	V–		
4	White	CAN-H		
5	Blue	CAN L		



XS2P-D522-2 Panel-mounting Connector Socket, Solder-cup Terminals



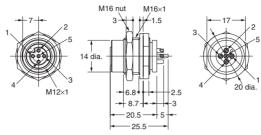


Panel Cutout

Terminal No.

Color

Name


DCA1-5CNC5M1
Panel-mounting Connector Plug with 0.5 m Cable

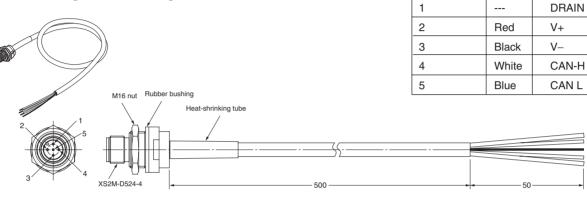


XS2P-D524-4
Panel-mounting Connector Plug, Solder-cup Terminals






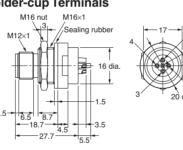



Environment-resistive Models for Thick Wires


DCA2-5CN□□W1
Thick Cable with Connectors on Both Ends (5 Conductors for Communications)



Wiring

Terminal No.	Color	Name
1		DRAIN
2	Red	V+
3	Black	V-
4	White	CAN-H
5	Blue	CAN-L


DCA2-5CN□□F1 Thick Cable with Connector Socket on One End (5 Conductors for Communications)



Wiring

Terminal No.	Color	Name		
1		DRAIN		
2	Red	V+		
3	Black	V-		
4	White	CAN-H		
5	Blue	CAN-L		


DCA2-5CN□□H1 Thick Cable with Connector Plug on One End (5 Conductors for Communications)



Wiring

Terminal No.	Color	Name
1		DRAIN
2	Red	V+
3	Black	V-
4	White	CAN-H
5	Blue	CAN-L

DCA1-5CN□□W5 Thin Cable with Connectors on Both Ends (5 Conductors for Communications)





Wiring

Terminal No.	Color	Name
1		DRAIN
2	Red	V+
3	Black	V-
4	White	CAN-H
5	Blue	CAN-L

DCA2-5CNC5P1 Thin Cable with Panel-mounting Connector Socket on One End (5 Conductors for Communications)








Wiring

	Terminal No.	Color	Name			
1			DRAIN			
	2	Red	V+			
	3	Black	V-			
	4	White	CAN-H			
	5	Blue	CAN-L			

Note: A rubber seal and nut for panel mounting are included.


Panel Cutout Dimensions




DCA2-5CNC5M1

Panel-mounting Connector Plug with 0.5 m Cable





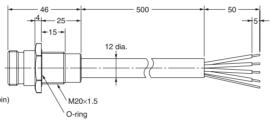



Wiring

Terminal No.	Color	Name
1		DRAIN
2	Red	V+
3	Black	V-
4	White	CAN-H
5	Blue	CAN-L

Note: A nut is included.


DCN3-11
T-branch Connector (5 Conductors for Communications, Thick Wire Branch Line)

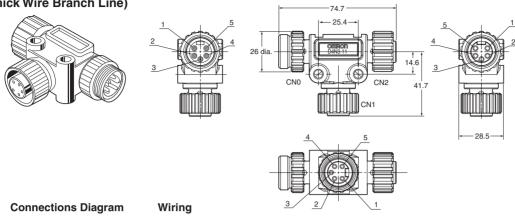



Terminal No.	Name
1	DRAIN
2	V+
3	V–
4	CAN-H
5	CAN-L

DCN3-12 T-branch Connector (5 Conductors for Communications)

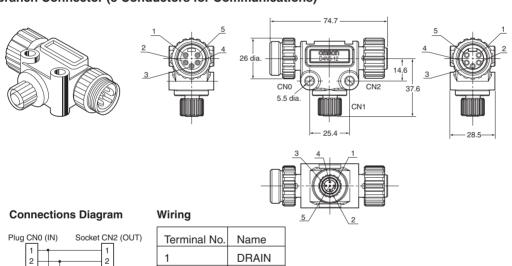

Plug	CN	0 (IN)	S	ocl	ket	CN	2 (0	UT)
	1 2 3 4 5						1 2 3 4 5		
		So	1 2	3 4 N1		5 TUC)		

Terminal No.	Name
1	DRAIN
2	V+
3	V–
4	CAN-H
5	CAN-L
	1 2 3 4


DRS3-1 Connector Plug with Terminating Resistance

Wiring




Name
DRAIN: NC
V+: NC
V-: NC
CAN-H: 121 Ω
CAN-L:


Note: Terminating resistance (121 Ω) is connected between terminals 4 and 5.



XS4M-D521-1 Panel-mounting Connector Plug (5 Pins for Communications)







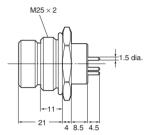

Panel Cutout Dimensions

PCB Processing Dimensions





Note: A rubber seal and nut for panel mounting are included.